



U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123

TRANSPORTATION RESEARCH CENTER

**Indiana University
Bloomington, Indiana 47403-1599**

ON-SITE AIR BAG INVESTIGATION

**CASE NO. - 96-16
FLEET - PRIVATE VEHICLE
LOCATION -
ACCIDENT DATE -**

Submitted By:

**Research Scientist
and**

Associate Scientist

1996

Revised Submission:

2000

Contract Number:

Prepared for:

**U.S. Department of Transportation
National Highway Traffic Safety Administration
National Center for Statistics and Analysis
Washington, D.C. 20590-0003**

DISCLAIMERS

This document is disseminated under the sponsorship of the Department of Transportation in the interest of information exchange. The United States Government assumes no responsibility for the contents or use thereof.

The opinions, findings, and conclusions expressed in this publication are those of the authors and not necessarily those of the National Highway Traffic Safety Administration.

The crash investigation process is an inexact science which requires that physical evidence such as skid marks, vehicular damage measurements, and occupant contact points be coupled with the investigator's expert knowledge and experience of vehicle dynamics and occupant kinematics in order to determine the pre-crash, crash, and post-crash movements of involved vehicles and occupants.

Because each crash is a unique sequence of events, generalized conclusions cannot be made concerning the crashworthiness performance of the involved vehicle(s) or their safety systems.

Technical Report Documentation Page

1. Report No. TRC/IU Case No. 96-16		2. Government Accession No.		3. Recipient's Catalog No.	
4. Title and Subtitle On-Site Air Bag Investigation Vehicle - 1995 Isuzu Rodeo Location -				5. Report Date: _____, 2000	
				6. Performing Organization Code	
7. Author(s)				8. Performing Organization Report No. Task #s 0055 & 0228	
9. Performing Organization Name and Address Transportation Research Center Indiana University 222 West Second Street Bloomington, Indiana 47403-1501				10. Work Unit No. (TRAIS)	
				11. Contract or Grant No.	
12. Sponsoring Agency Name and Address U.S. Department of Transportation (NRD-32) National Highway Traffic Safety Administration National Center for Statistics and Analysis Washington, D.C. 20590-0003				13. Type of Report and Period Covered Technical Report Crash Date: 1996	
				14. Sponsoring Agency Code	
15. Supplementary Notes On-site air bag deployment investigation involving a 1995 Isuzu Rodeo, 4x4, 4-door sport utility, with manual belts and dual front air bags					
16. Abstract This report covers an on-site investigation of an air bag deployment crash that involved a 1995 Isuzu Rodeo and a 1986 GMC C-1500, 4x2, regular cab pickup. This crash is of special interest because the Rodeo (case vehicle) is a sport utility and both the case vehicle's driver and front right passenger were fatally injured despite the deployment of the case vehicle's dual front air bags. The case vehicle (Rodeo) was entering a left-hand curve, traveling east-northeast in the eastbound lane of a two-lane, undivided, state road. The C-1500 pickup (vehicle #2) was negotiating a right-hand curve, traveling southwest on the same, two-lane, undivided, state road. The crash occurred in the eastbound lane of the roadway. The front left (half) of the case vehicle impacted the front left (half) of vehicle #2 causing the case vehicle's driver and front right passenger supplemental restraint systems (air bags) to deploy. The posture and seat track location of the case vehicle's driver (39 year-old male) is unknown. The case vehicle was not equipped with a tilt steering wheel. He was not wearing his available, active, three-point, lap and shoulder belt and sustained, according to his autopsy, multiple thoracic and abdominal injuries from the steering assembly, including: bilateral rib fractures, a transmural laceration and contusions to the left lateral ventricle, lacerated pericardium, bilateral lung lacerations and contusions with bilateral hemothorax, multiple liver lacerations, a lacerated spleen, and hemorrhagic injuries to the left adrenal gland and upper quadrant of mesentery. He sustained an atlanto-occipital subluxation, most likely from the roof. In addition there were abrasions to his left cheek and anterior neck from his air bag, and multiple soft tissue injuries to his chest and extremities. The posture of the front right passenger (49 year-old female) in the Rodeo is also unknown. According to the vehicle inspection, her seat track was located in its rearmost position, and she was also restrained by her available, active, three-point, lap and shoulder belt. She sustained, according to her autopsy, a lacerated basilar artery--at the level of the medulla oblongata, and a subarachnoid hemorrhage resulting from her atlanto-occipital subluxation. She also sustained seat belt contusions across the midline of her chest and suprapubic area of her abdomen, and to her right shoulder and left hip. In addition, she sustained a small right groin abrasion and contusions and lacerations to her left thigh.					
17. Key Words Air Bag Deployment Motor Vehicle Traffic Crash Injury Severity				18. Distribution Statement General Public	
19. Security Classif. (of this report) Unclassified		20. Security Classif. (of this page) Unclassified		21. No. of Pages 77	
				22. Price \$7,900	

TABLE OF CONTENTS

	<u>Page No.</u>
SUMMARY	1
CRASH SCHEMATIC	2
CRASH DATA	3
AMBIENT CONDITIONS	3
ROADWAY	3
TRAFFIC CONTROLS	4
VEHICLES	4
VEHICLE DAMAGE	5
EXTERIOR	5
Deployment Impact	5
INTERIOR	6
REPAIR	6
VEHICLE VELOCITY ESTIMATES	7
COLLISION SEQUENCE	7
PRE-CRASH	7
CRASH	7
POST-CRASH	8
Occupants	8
Police	8
Rescue	8
Removal	9
HUMAN FACTORS/OCCUPANT DATA	9
DRIVERS	9
FRONT RIGHT PASSENGER	10
CASE VEHICLE DRIVER INJURIES	10
CASE VEHICLE FRONT RIGHT PASSENGER INJURIES	12
CASE VEHICLE DRIVER KINEMATICS	13
CASE VEHICLE PASSENGER KINEMATICS	14
DISCUSSION	15
AIR BAG SYSTEM	16
Appendix A: Reconstruction Program Results	17
WinSMASH (Missing Vehicle Algorithm) -- including Barrier Equivalent Speeds)	18
EDCRASH (Missing Vehicle Algorithm)	24
TRC Vector Analysis Iterations	27
Appendix B: SELECTED PHOTOGRAPHS	32

TRC/IU ON-SITE AIR BAG INVESTIGATION

TRC/IU CASE NO. 96-16

FLEET - PRIVATE VEHICLE
LOCATION -

SUMMARY

This report concerns a motor vehicle crash involving an air bag equipped 1995 Isuzu Rodeo, 4x4, sport utility and a 1986 GMC C-1500, 4x2, regular cab pickup occurring in 1996 at 9:37 p.m., in a rural area on a state road. This crash is of special interest because the Rodeo (case vehicle) is a sport utility and both the Rodeo's driver and front right passenger were fatally injured despite the deployment of the Rodeo's dual front air bags.

The Rodeo was entering a left-hand curve, traveling east-northeast in the eastbound lane of a two-lane, undivided, state road when it impacted the C-1500 pickup which was negotiating a right-hand curve, traveling southwest in the same, two-lane, undivided, state road. The crash occurred in the eastbound lane of the roadway. The Rodeo was knocked approximately 7 meters (23 feet) southwestward (backward) and rotated approximately 120 degrees counterclockwise after impact. The Rodeo came to rest on the south roadside heading north-northwest. The C-1500 pickup rotated counterclockwise after impact leaving gouges in the eastbound lane. The pickup came to rest approximately 19 meters (62 feet) west of impact, rotated approximately 70 degrees counterclockwise, and came to rest straddling, perpendicularly, the westbound lane heading south.

The front left (half) of the Rodeo impacted the front left (half) of the C-1500 pickup. CDCs were determined to be: **11-FYEW-5** for the Rodeo and **12-FYEW-4** for the pickup. The WinSMASH reconstruction program, missing vehicle algorithm, was used to estimate the change in velocity (i.e., Delta V) on the highest severity impact to the Rodeo. The Total, Longitudinal, and Lateral Delta Vs are respectively: **42.6 km.p.h. (26.5 m.p.h.)**, **-40.0 km.p.h. (-24.9 m.p.h.)**, and **+14.6 km.p.h. (+9.1 m.p.h.)**.

The 1995 Isuzu Rodeo was equipped with both driver and front right passenger supplemental restraint systems (air bags) which deployed as a result of the frontal impact. The posture and seat track location of the Rodeo's driver (39-year-old male) are unknown. The Rodeo was not equipped with a tilt steering wheel. He was not wearing his available, active, three-point, lap and shoulder belt and sustained, according to his autopsy, multiple thoracic and abdominal injuries from the steering assembly, including: bilateral rib fractures, a transmural laceration and contusions to the left lateral ventricle, lacerated pericardium, bilateral lung lacerations and contusions with bilateral hemothorax, multiple liver lacerations, a lacerated spleen, and hemorrhagic injuries to the left adrenal gland and upper quadrant of mesentery. He sustained an atlanto-occipital subluxation, most likely from the roof. In addition, there were abrasions to his left cheek and anterior neck from his air bag and multiple soft tissue injuries to his chest and extremities. The posture of the front right passenger (49-year-old female) in the Rodeo is also unknown. According to the vehicle inspection, her seat track was located in its rearmost position, and she was restrained by her available, active, three-point, lap and shoulder belt. She sustained, according to her autopsy, a lacerated basilar artery--at the level of the medulla oblongata, and a subarachnoid hemorrhage resulting from her atlanto-occipital subluxation. She also sustained seat belt contusions across the midline of her chest, across the suprapubic area of her abdomen, to her right shoulder, and to her left hip. In addition, she sustained a small right groin abrasion and contusions and lacerations to her left thigh. The driver (26-year-old male) of the C-1500 pickup was not wearing his available, active, three-point, lap and shoulder belt and sustained, according to the Police Crash Report, serious injuries as a result of this crash.

CRASH SCHEMATIC

TRC/IU CASE NO. 96-16




Scale: 1 cm = 2.5 m
(prior to reduction @ 94%)

Case Vehicle at Final Rest heading 328 degrees after being driven backwards and rotating counterclockwise

Vehicle #2 at Final Rest heading 177 degrees

Point of impact and gouge mark from Vehicle #2 indicating location where Vehicle #2 began rotating counterclockwise

Road Surface: Asphalt
Road Condition: Wet
Curvature: Left-hand curve for Case Vehicle, Right-hand curve for Vehicle #2
Grade, at-impact: -2.9 % for Case Vehicle
Superelevation, at-impact: 8.7 % positive to south

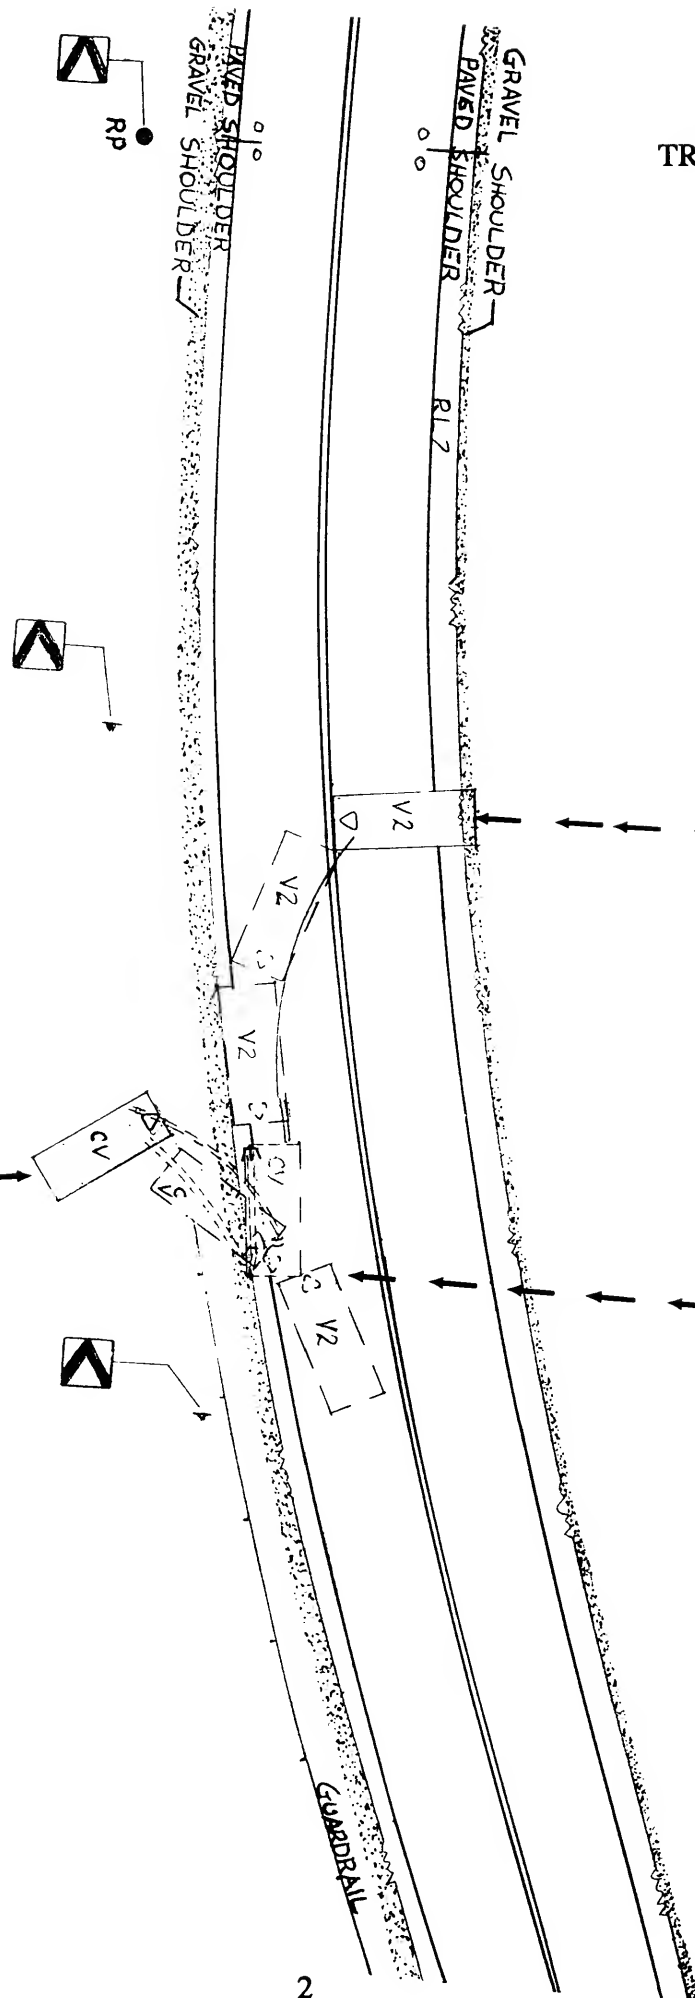

TRC/IU ON-SITE AIR BAG INVESTIGATION

TRC/IU CASE NO. 96-16

FLEET - PRIVATE VEHICLE
LOCATION -

CRASH DATA

Location/Street:	State Road
State:	
Area/Type:	Rural, agricultural
Accident Date/Time:	1996, @ 9:37 p.m.
Investigating Police Agency:	State Police
Accident Type:	Sport Utility / Pickup - head-on
Occupant Injury Severity (air bag vehicle):	Driver: laceration left lateral ventricle (AIS-5) Front Right Passenger: laceration basilar artery (AIS-5)

AMBIENT CONDITIONS

Light Conditions:	Dark
Weather Condition:	Cloudy
Precipitation:	None
Road Surface:	Wet
Temperature:	88 degrees F @ the nearest Indiana airport

ROADWAY

	<u>Case Vehicle</u>	<u>Vehicle #2</u>
Location:	State road	State road
Number of Travel Lanes:	Two-lanes, undivided	Two-lanes, undivided
Width:	3.8 meters (12.5 feet)	3.6 meters (11.8 feet)
Surface Type:	Bituminous	Bituminous
Median:	None	None

ROADWAY (CONTINUED)

	<u>Case Vehicle</u>	<u>Vehicle #2</u>
Shoulders:	0.7 m (2.3 ft) bituminous; 1.35 (4.4 ft) gravel	0.8 m (2.6 ft) bituminous; 1.3 m (4.3 ft) gravel
Vertical alignment:	Curve left	Curve right
Horizontal alignment:	2.9% grade negative to east	2.9% grade positive to west
Estimated Coefficient of Friction:	0.75	0.75
Traffic Density:	Light	Heavy

TRAFFIC CONTROLS

	<u>Case Vehicle</u>	<u>Vehicle #2</u>
Signals:	None	None
Signs:	CURVE warning signs (i.e., Chevron Alignment sign: W1-8)	CURVE warning signs (i.e., Chevron Alignment sign: W1-8)
Markings:	Double solid yellow center lines and solid white lane line on south roadway edge	Double solid yellow center lines and solid white lane line on north roadway edge
Speed Limit:	72 km.p.h. (45 m.p.h.)	72 km.p.h. (45 m.p.h.)

VEHICLES

	<u>Case Vehicle</u>	<u>Vehicle #2</u>
Year:	1995	1986
Make:	Isuzu	GMC
Model:	Rodeo	C-1500 Sierra Classic
Body Type:	Four-door sport utility	½ Ton pickup with camp- er shell
V.I.N.	4S2CM58V8S4-----	1GTDC14H2GJ-----
Color:	White	Blue
Mileage:	9,009 km (5,598 miles)	Unknown
Engine:	3.2 liters, V-6	5.0 liters, V-8

VEHICLES (CONTINUED)

	<u>Case Vehicle</u>	<u>Vehicle #2</u>
Transmission:	Four-speed automatic	Unknown, 3- or 4-speed, manual or automatic
Steering:	Power-assisted, worm-and-gear	Power-assisted or manual, recirculating ball gear
Brakes:	Power-assisted, front disc, rear drum	Power-assisted or manual, front disc, rear drum
Padding:	Steering wheel and hub, sunvisors, dash, "A"-pillars, side door surfaces	Unknown, dash per photographs
Active Restraints:	Three-point, manual, lap and shoulder belts in front and rear outboard seating positions; lap belt only at back center position	Three-point, manual, lap and shoulder belts in front outboard seating positions; lap belt only at front center position
Passive Restraints:	Factory installed driver and front right passenger supplemental restraint systems (air bags)	None
Defects:	None	Unknown
Fleet:	Private vehicle	Private vehicle
Tow status:	Towed due to damage	Towed due to damage

VEHICLE DAMAGE

<u>EXTERIOR</u>	<u>Case Vehicle</u>	<u>Vehicle #2</u>
<u>Deployment Impact</u>		
Event number:	First	First
Object Struck:	Vehicle #2	Case Vehicle
Damage location		
Damaged Plane:	Front	Front
Vertical Location		
On Plane:	Bumper	Bumper
Direct Begins:	49 cm (19.3 in) in from right bumper corner	At left bumper corner
Length Direct:	92 cm (36.2 in)	Unknown
Field L:	150 cm (59.1 in)	Unknown
C ₁ :	104 cm (40.9 in)	Unknown

VEHICLE DAMAGE¹ (CONTINUED)

<u>EXTERIOR</u> (Continued)	<u>Case Vehicle</u>	<u>Vehicle #2</u>
<u>Deployment Impact</u> (Continued)		
C ₂ :	65cm (25.6 in)	Unknown
C ₃ :	45cm (17.7 in)	Unknown
C ₄ :	22cm (8.7 in)	Unknown
C ₅ :	7 cm (2.8 in)	Unknown
C ₆ :	0 cm (0.0 in)	Unknown
D:	-29cm (-11.4 in)	Unknown
Maximum Crush:	104cm (40.9 in)	Unknown, but extensive per photographs
Location:	C ₁	C ₁ per photographs
CDC:	11-FYEW-5 (-20)	12-FYEW-4 (+5)
Damaged Components:	Bumper, grille, hood, radiator, right & left headlight assemblies & fenders, left parklamp assembly, left front tire, rim, and door	Bumper, grille, hood, radiator, left ¹ fender, headlight assembly, and left front tire, rim, & door per photographs
<u>INTERIOR</u>		
Damaged Components:	Steering wheel, instrument panel, left, center, & right dash, radio, rear-view mirror, driver's seat, driver & front right passenger air bag modules	Steering wheel, instrument panel, and left & center dash
Other Evidence of Occupant Contact:	Left front roof and sunvisor	Unknown
Manual Restraint System Failures:	None	Unknown
Seat Performance Failures:	None	Unknown
<u>REPAIR</u> ²		
Cost Estimate:	Approximately \$18,850 for submodel S, \$21,250 for submodel LS; the submodel cannot be identified from either the VIN or the photographs	Approximately \$1,550 - \$2,500 depended upon the vehicle's condition

¹ The damage to vehicle #2's front right and right front is unknown because no usable photographs of these areas are available.

² According to the Auto Loan department at the Indiana University Credit Union, the indicated values represent the "book value" for the involved vehicles.

VEHICLE VELOCITY ESTIMATES^{3,4}

<u>Highest Delta "V"</u>	<u>Case Vehicle</u> ³	<u>Vehicle #2</u>
Reconstruction Program:	WinSMASH/EDCRASH	WinSMASH/EDCRASH
Program Algorithm:	ROLDMISS	ROLDMISS
Travel Speed ⁴ :	32 km.p.h. (20 m.p.h.)	97 km.p.h. (60 m.p.h.)
Total Delta "V":	43 km.p.h. (27 m.p.h.)	47 km.p.h. (29 m.p.h.)
Longitudinal Delta "V":	-40 km.p.h. (-25 m.p.h.)	-47 km.p.h. (-29 m.p.h.)
Lateral Delta "V":	+15 km.p.h. (+9 m.p.h.)	-4 km.p.h. (-3 m.p.h.)

COLLISION SEQUENCE

PRE-CRASH: According to the Police Crash Report, the scene inspection, and this contractor's inspection of the case vehicle, the case vehicle (Rodeo) was entering a left-hand curve, traveling east-northeast in the eastbound lane of a two-lane, undivided, state road and was attempting to continue in its eastward direction of travel. Vehicle #2 (C-1500 pickup) was negotiating a right-hand curve, traveling southwest in the same, two-lane, undivided, state road and was attempting to continue in its westward direction of travel. According to the Police Crash Report and the scene evidence, the driver of the case vehicle braked and steered right toward the south shoulder, attempting to avoid vehicle #2. The case vehicle swerved toward the right (i.e., traveling eastward) and continued essentially straight ahead prior to impact. According to the Police Crash Report and the scene inspection, the driver of vehicle #2 made no pre-crash avoidance maneuvers. Vehicle #2 continued straight ahead in the right-hand curve prior to impact. The crash occurred in the eastbound lane of the roadway.

CRASH: According to the vehicle inspection and the photographs of vehicle #2 (see **SELECTED PHOTOGRAPHS #80 and #84**), the front left (half) of the case vehicle was impacted by the front left (half) of vehicle #2 causing both the driver and front right passenger supplemental restraint systems (air bags) to deploy. According to the Police Crash Report and the scene inspection, the case vehicle was knocked approximately 7 meters (23 feet) southwestward (backward) and rotated approximately 120 degrees counterclockwise after impact. The case vehicle came to rest on the south roadside heading north-northwest. According to the Police Crash Report and the scene inspection, vehicle #2 rotated counterclockwise after impact leaving gouges in the eastbound lane. Vehicle #2 came to rest approximately 19 meters (62 feet) west of impact, rotated approximately 70 degrees

³ The speed changes indicated below reflect only the case vehicle's crush and do not reflect the severity of the crash, as the case vehicle was knocked southwestward (backward) approximately 7 meters (23 feet) post-impact.

⁴ These speed estimates are based on the scene inspection and crash dynamics. For additional discussion, see the page entitled: **TRC VECTOR ANALYSIS ITERATIONS**.

COLLISION SEQUENCE (CONTINUED)

CRASH: (Continued)

counterclockwise, and came to rest straddling, perpendicularly, the westbound lane heading south.

POST-CRASH:

Occupants: According to the ambulance run report, the driver of the case vehicle remained inside the vehicle at final rest. He was initially conscious, but was unable because of his injuries and the vehicle's condition⁵ to exit the case vehicle. According to the ambulance run report, the front right passenger also remained inside the vehicle at final rest. She was unconscious and was unable because of her injuries and the vehicle's condition⁵ to exit the case vehicle. According to the Police Crash Report, the case vehicle's driver was not using his available, active, three-point, lap and shoulder belt. According to the Police Crash Report, the ambulance run report, and the vehicle inspection, the front right passenger was using her available, active, three-point, lap and shoulder belt.

Police: According to the Police Crash Report, the investigating police agency was notified of the accident within 16 minutes and arrived on-scene within 24 minutes post-crash. Traffic control procedures were established and emergency medical, fire, and towing services were called to assist.

Rescue: According to the ambulance run report, on arrival the front right passenger's pupils were fixed and dilated, with no pulse or respirations, and she was cyanotic. Because she was unconscious and required extrication and the extrication equipment had not yet arrived, the front right passenger was declared unviable and subsequently pronounced dead on arrival at the scene. According to the ambulance run report, the driver was awake⁶ and entrapped. The driver deteriorated and was subsequently pronounced dead at the scene. The case vehicle's driver sustained, according to his autopsy, multiple thoracic and abdominal injuries from the steering assembly, including: bilateral rib fractures, a transmural laceration and contusions to the left lateral ventricle, lacerated pericardium, bilateral lung lacerations and contusions with bilateral hemothorax, multiple liver lacerations, a lacerated spleen, and hemorrhagic injuries to the left adrenal gland and upper quadrant of mesentery. He sustained an atlanto-occipital subluxation, most likely from the roof. In addition, there were abrasions to his left cheek and anterior neck from his air bag and multiple soft tissue injuries to his chest and extremities. The case vehicle's front right passenger sustained, according to her autopsy, a lacerated basilar artery--at the level of the medulla oblongata, and a subarachnoid hemorrhage resulting from her atlanto-occipital subluxation. She also sustained seat belt contusions across the midline of her chest and suprapubic area of her

⁵ Neither of the case vehicle's doors could be opened without extrication tools. In this contractor's opinion, the case vehicle's driver was most likely entrapped by the intrusion of his vehicle's left dash and/or steering assembly. The front right passenger was most likely not entrapped in the NASS CDS meaning.

⁶ The driver's initial Glasgow Coma Scale score was 12; however, eighteen minutes later the score was 3.

COLLISION SEQUENCE (CONTINUED)

POST-CRASH: Rescue: (Continued)

abdomen, and to her right shoulder and left hip. In addition, she sustained a small right groin abrasion and contusions and lacerations to her left thigh.

Removal: Following the police investigation, the case vehicle and vehicle #2 were towed from the scene.

HUMAN FACTORS/OCCUPANT DATA

<u>DRIVERS:</u>	<u>Case Vehicle</u>	<u>Vehicle #2</u>
Age:	39-year-old	26-year-old
Sex:	Male	Male
Height:	188 cm (74 in)	Unknown
Weight:	75 kg (166 lbs)	Unknown
Occupation:	Construction foreman	Unknown
Active Restraint System/Usage:	Three-point lap and shoulder/Not used	Three-point lap and shoulder/Not used
Usage Source:	Vehicle inspection, Police Crash Report, and autopsy	Police Crash Report
Passive Restraint System/Usage:	Factory installed air bag/Air bag deployed	Not equipped
Usage Source:	Vehicle inspection, Police Crash Report, and ambulance run report	Not applicable
Eyeglasses/contacts:	None	Unknown
Vehicle Familiarity:	Two to three months with unknown usage; majority of usage on odometer was driven by front right passenger (wife's vehicle)	Unknown
Route Familiarity:	Daily	Unknown
Trip Plan:	Home to restaurant	Unknown
Manner of Leaving Scene:	Ambulance	Ambulance
Type of Medical Treatment:	Pronounced dead at the scene	Hospitalized

HUMAN FACTORS/OCCUPANT DATA (CONTINUED)

<u>FRONT RIGHT PASSENGER:</u>	<u>Case Vehicle</u>
Age:	49-year-old
Sex:	Female
Height:	168 centimeters (66 inches)
Weight:	92 kilograms (202 pounds)
Active Restraint System/Usage:	Three-point lap and shoulder/Used
Usage Source:	Vehicle inspection, interviewee, Police Crash Report, and medical records
Passive Restraint System/Usage:	Factory installed front right air bag/Air bag deployed
Usage Source:	Vehicle inspection, Interviewee, Police Crash Report, and ambulance run report
Eyeglasses/contacts:	None
Manner of Leaving Scene:	Ambulance
Type of Medical Treatment:	Dead on arrival at scene

CASE VEHICLE DRIVER INJURIES^{7,8,9}

<u>Description of Injury</u>	<u>A.I.S.</u>	<u>Source of Data</u>	<u>Injury Mechanism</u>	<u>Certainty</u>
Laceration, transmural ⁷ , left lateral ⁸ ventricle	441012.5,4	1	Steering wheel hub, spokes, and rim	{Certain}
Contusions anterior and lateral left ventricle, not further specified	441002.3,4	1	Steering wheel hub, spokes, and rim	{Certain}
Laceration {opened} pericardial sac {pericardium}	441602.2,4	1	Steering wheel hub, spokes, and rim	{Certain}
Laceration ⁹ {penetration} of lungs, bilaterally, with bilateral hemothorax, 500 cc	441450.4,3	1	Steering wheel hub, spokes, and rim	{Certain}
Contusions, multiple, of lungs, bilaterally	441410.4,3	1	Steering wheel hub, spokes, and rim	{Certain}

⁷ Dorland's Illustrated Medical Dictionary defines the following word as shown below:
transmural (trans-mu'ral) -- through the wall of an organ; extending through or affecting the entire thickness of the wall of an organ or cavity.

⁸ According to the driver's autopsy, his left lateral ventricle was punctured--1 centimeter (0.4 inches) in size, by either his left fifth or sixth rib.

⁹ According to the driver's autopsy, the lung lacerations (penetrations) corresponded to the rib fractures.

CASE VEHICLE DRIVER INJURIES^{10,11} (CONTINUED)

<u>Description of Injury</u>	<u>A.I.S.</u>	<u>Source of Data</u>	<u>Injury Mechanism</u>	<u>Certainty</u>
Lacerations liver: right lobe, small subcapsular, left lobe, large intraparenchymal but not involving vena cava	541824.3,1	1	Steering wheel rim	{Probable}
Laceration spleen, small sub-capsular	544222.2,2	1	Steering wheel rim	{Probable}
Injury {hemorrhage} left adrenal gland	540299.1,2	1	Steering wheel rim	{Probable}
Injury {hemorrhage} left upper quadrant of mesentery	542099.2,8	1	Steering wheel rim	{Probable}
Fractured ribs, bilaterally: Left--4th anteriorly, 5th and 6th posteriorly; Right--4th through 6th laterally	450240.4,3	1	Steering wheel hub, spokes, and rim	{Certain}
Subluxation ¹⁰ {dislocation} atlanto-occipital joint	650208.2,6	1	Roof ¹¹ , left side	{Possible ¹¹ }
Abrasions left cheek	290202.1,2	1	Air bag, driver's	{Certain}
Abrasions over Adam's apple on anterior neck	390202.1,5	1	Air bag, driver's	{Certain}
Contusions present in chest wall	490402.1,9	1	Steering wheel hub, spokes, and rim	{Certain}
Lacerations, dicing type, over shoulders, bilaterally	790602.1,3	1	Flying glass	{Certain}
Abrasion, two inches, on left wrist	790202.1,2	1	Air bag, driver's	{Probable}
Lacerations, two, small, right thumb	790602.1.1	1	Left instrument panel and below	{Probable}
Lacerations, two, small left thumb	790602.1,2	1	Left instrument panel and below	{Probable}
Contusion right thumb	790402.1,1	1	Left instrument panel and below	{Probable}
Abrasion, one inch in diameter, over right patellar	890202.1,1	1	Left instrument panel and below	{Probable}
Abrasion right medial lower leg and ankle	890202.1,1	1	Steering column, lower portion	{Probable}

¹⁰ The driver's autopsy does not report any measurement of the amount of subluxation; in addition, the autopsy report indicated that no assessment of the driver's spinal cord was undertaken.

¹¹ The roof is coded because of the upward movement of the case vehicle's driver as a result of the severe crash. The expanding air bag struck the driver's left cheek and anterior neck, most likely with the upper portion of the air bag, and the air bag may have further propelled the driver upward into the roof where his head would have been driven backwards relative to his spine; see **SELECTED PHOTOGRAPHS #51** and **#52**. However, this injury can only be coded possible because it is also possible that the air bag itself caused or contributed to the atlanto-occipital subluxation.

CASE VEHICLE DRIVER INJURIES (CONTINUED)

<u>Description of Injury</u>	<u>A.I.S.</u>	<u>Source of Data</u>	<u>Injury Mechanism</u>	<u>Certainty</u>
Contusion, rectangular, above right knee and over right patellar	890402.1,1	1	Left instrument panel and below	{Probable}
Contusion right medial calf	890402.1,1	1	Steering column, lower portion	{Probable}
Abrasions, two, small, over left knee	890202.1,2	1	Left instrument panel and below	{Certain}

CASE VEHICLE FRONT RIGHT PASSENGER INJURIES^{12,13,14,15,16}

<u>Description of Injury</u>	<u>A.I.S.</u>	<u>Source of Data</u>	<u>Injury Mechanism</u>	<u>Certainty</u>
Laceration of basilar artery ¹² at the level of the medulla oblongata	120402.5,8	1	Air bag, front right passenger's ¹⁶	{Possible}
Hemorrhage ¹³ , subarachnoid, 50 cc	140684.3,9	1	Air bag, front right passenger's	{Possible}
Subluxation ¹⁴ {dislocation} atlanto-occipital joint	650208.2,6	1	Air bag, front right passenger's	{Possible}
Contusion, pattern ¹⁵ , right shoulder	790402.1,1	1	Passenger's belt restraint webbing	{Certain}
Contusion, pattern ¹⁵ , across midline of chest	490402.1,4	1	Passenger's belt restraint webbing	{Certain}

¹² According to the front right passenger's autopsy, this injury was caused by the atlanto-occipital subluxation.

¹³ According to the front right passenger's autopsy, this hemorrhage resulted from the laceration of the basilar artery.

¹⁴ The front right passenger's autopsy does not report any measurement of the amount of subluxation; in addition, the autopsy report indicated that no assessment of the passenger's spinal cord was undertaken.

¹⁵ According the front right passenger's autopsy, these contusions were shaped in the pattern of a seat belt.

¹⁶ Please see the **DISCUSSION** section which follows, in addition to the material below, for greater detail pertaining to the selection of the indicated injury mechanism. The front right passenger's autopsy indicated that she sustained deceleration injuries. DORLAND'S ILLUSTRATED MEDICAL DICTIONARY defines this key term as follows: *deceleration injury (in'ja-re)* -- an injury sustained by sudden deceleration in the movement of the body, as in a motor vehicle accident; the brain is especially liable to such trauma. Acceleration-Deceleration injuries are further explained below. This material was taken from the chapter entitled: "Injuries of the Head and Spinal Cord" written by Shogan, Stephen H., M.D. and Kindt, Glenn W., M.D. from the book THE MANAGEMENT OF TRAUMA, 4TH EDITION, by Zuidema, George D., M.D.; Rutherford, Robert B., M.D.; and Ballinger, Walter F., M.D.; W.B. Saunders Company, Philadelphia, 1985.

Acceleration-deceleration injuries are most commonly seen in motor vehicle accidents. Here, the occupant of a car traveling at a high rate of speed may be rapidly brought to a near standstill. As the occupant's head abruptly stops, the cranial contents continue to travel forward, impacting against the inner surface of the skull. Widespread injury results as potentially tremendous amounts of kinetic energy are impacted to the brain and its coverings. Angular acceleration, differential deceleration, and rebound of the elastic tissues create marked shearing forces and resultant severe damage. Injuries of the acceleration-deceleration type tend to produce diffuse destruction. This is generally of greater severity than that seen with simple blunt impact.

CASE VEHICLE FRONT RIGHT PASSENGER INJURIES (CONTINUED)

<u>Description of Injury</u>	<u>A.I.S.</u>	<u>Source of Data</u>	<u>Injury Mechanism</u>	<u>Certainty</u>
Contusion, pattern ¹⁵ , left hip and across suprapubic area of abdomen	590402.1,8	1	Passenger's belt restraint webbing	{Certain}
Abrasion, small, linear, right groin area	890202.1,1	1	Unknown	{Unknown}
Contusion left thigh, not further specified	890402.1,2	1	Unknown	{Unknown}
Lacerations, multiple, small, left thigh, not further specified	890602.1,2	1	Flying glass	{Possible}

CASE VEHICLE DRIVER KINEMATICS

The posture of the case vehicle's driver, immediately prior to the crash, is unknown. However, based on the scene inspection, the driver most likely had his left foot on the floor and his right foot on the brake. According to the vehicle inspection, the driver's seat track position was not determinable, and the case vehicle was not equipped with a tilt steering wheel. According to the vehicle inspection, the Police Crash Report, and on-scene photographs (see **SELECTED PHOTOGRAPHS #20**), the case vehicle's driver was not wearing his available, active, three-point, lap and shoulder belt.

According to the scene evidence, the case vehicle's driver steered to the right and braked, attempting to avoid the crash. As a result of these attempted avoidance maneuvers and the nonuse of his available safety belts, he most likely moved slightly forward and to his left just prior to impact.

Based on the vehicle and scene inspections, nonuse of his safety belts, and occupant kinematic principles, the case vehicle's impact with vehicle #2 not only deployed the driver's air bag, but thrust the driver forward, slightly leftward, and rapidly upward (i.e., because of the severe nature of the crash). As the driver moved vertically forward, he was struck in the chest by his deploying air bag and the intruding steering column assembly causing his fatal thoracic lesions. Because of the severe nature of the crash, and possibly with the help of the upper portion of his deploying air bag¹⁷, the case vehicle's driver went over the top of the steering assembly and most likely struck the top of his head against the left roof near the left back corner of the driver side sunvisor; see **SELECTED PHOTOGRAPHS #51** and **#52**. An inspection of the driver's air bag revealed substances of an unknown origin¹⁸; see **SELECTED PHOTOGRAPHS #55** and **#61**. In addition, there was no evidence on the driver air bag module's cover flap.

¹⁷ The case vehicle's driver was most likely struck on his left cheek and on his anterior neck (i.e., over his Adam's apple) by the upper portion of his deploying air bag.

¹⁸ According to the driver's ambulance run report, two attempts were made to insert intravenous fluids into the driver, both of which were unsuccessful. It is possible that the marks on the driver's air bag were IV fluid residue.

CASE VEHICLE DRIVER KINEMATICS (CONTINUED)

The case vehicle's driver most likely rebounded rearward and, initially, leftward toward the left roof side rail and/or "B"-pillar (i.e., because the case vehicle rotated counterclockwise as a result of its impact). Subsequently, the case vehicle's driver most likely moved toward his right. However, his movement was restricted because of the severe intrusion of the case vehicle's left dash and steering column assembly. At final rest, the case vehicle's driver was seated upright--most likely similar to his pre-crash position, with his legs turned toward the right by the intruding dash, his torso pushed back against the seat back by the intruding steering assembly, and his head slumped over his deployed air bag; see **SELECTED PHOTOGRAPH #20**.

CASE VEHICLE PASSENGER KINEMATICS

The posture of the case vehicle's front right passenger, immediately prior to the crash, is also unknown. However, the passenger's feet were most likely on the floor, but her hand positions are unknown. Based on the vehicle inspection, the front right passenger's seat back was found in a slightly reclined position. The passenger's seat track was located in its rearmost position and, according to the emergency medical technicians, was not moved during or as a result of her extrication. According to the vehicle inspection, the Police Crash Report, her ambulance run report, the available on-scene photographs (see **SELECTED PHOTOGRAPHS #20**), she was restrained by her available, active, three-point, lap and shoulder belt.

As a result of the case vehicle's attempted avoidance maneuvers (i.e., steering right and braking) and the use of her available safety belts, the front right passenger most likely moved slightly forward and to her left just prior to impact.

Based on the vehicle and scene inspections, her use of her safety belts, and occupant kinematic principles, the case vehicle's primary impact with vehicle #2 not only deployed the front right passenger air bag, but thrust the front right passenger forward and slightly leftward. As the front right passenger moved forward, she loaded her safety belts resulting in discernable seat belt contusions across her right shoulder, chest, and abdomen. In addition, she almost certainly contacted her deploying front right air bag. An inspection of the front right passenger's air bag revealed possible occupant contacts; see **SELECTED PHOTOGRAPHS #69** through **#71**. In addition, there appeared to be no evidence of contact on the front right passenger air bag module's cover flap; see **SELECTED PHOTOGRAPH #72**. As a result of loading her safety belts and contacting her air bag, the passenger's forward momentum was brought to a halt.

The case vehicle's front right passenger most likely rebounded rearward and, initially, leftward toward the left side of her seat back (i.e., because the case vehicle rotated counterclockwise as a result of its impact). Her leftward movement was restricted by her lap belt but less so by her torso belt (i.e., since the torso portion was connected between her left hip and right shoulder). At final rest, the case vehicle's front right passenger was seated, slumped toward the left, with her head between the two front bucket seats; see **SELECTED PHOTOGRAPHS #17** and **#18**.

DISCUSSION

Of importance in this investigation is what influence did the case vehicle's safety restraints (i.e., safety belts and air bags) have in the fatalities of the two occupants. For the case vehicle's driver, his lack of safety belt usage most likely contributed to his thoracic cavity lesions because the primary thrust of his air bag, in addition to his intruding steering column assembly, was directed solely toward his torso rather than being spread evenly across his head and chest. It is also possible that the driver's air bag may have contributed to his atlanto-occipital subluxation¹⁹ because the upward expanding portion of the upper part of his air bag most likely caught the driver near his neck as he was moving upward from the collision forces. However, the presence of the air bag most likely kept the driver from being killed instantly when he otherwise would have been impaled on his steering assembly. Had the driver been wearing his safety belt, it is possible that he would have survived given the combination of his belts and air bag. However, it must be kept in mind that this was a severe collision and, because of the offset nature of the crash towards the driver's side and the fact that the reported Delta V's represent the velocity change at the vehicle's center-of-gravity, the driver's Delta V is most likely higher than the reconstruction model reported.

For the case vehicle's front right passenger, this contractor's conclusion is that she was possibly fatally injured by her deploying air bag; however, the evidence is far from conclusive. The front right passenger's seat track was most likely located at its rearmost position, thus putting her as far back as possible from her deploying air bag. The front right passenger's autopsy indicates that her cause of death was a deceleration injury (see footnote #16). According to the resident pathologist who performed the autopsy on the front right passenger, the pathologist thought that the fatal lesion most likely resulted when the occupant's head hyperflexed backwards over her seat back during the occupant's rebound from her successfully used safety belts. However, the pathologist did not know at the time of the autopsies that air bags were involved in the crash. In addition, the pathologist did not know that the case vehicle was equipped with adjustable head restraints that were at least adequately positioned; see **SELECTED PHOTOGRAPH #39**²⁰. Given the passenger's short stature [168 centimeters (66 inches)], age (49 years), documented injuries (i.e., atlanto-occipital subluxation resulting in a flexion type²¹ laceration of her basilar artery at the level of the medulla oblongata and most likely a spinal cord lesion), and the fact that she was most likely deceased at the time the emergency medical technicians arrived, this contractor considered the front right occupant as a likely candidate for having been fatally injured by her air bag. However: her seat was most likely positioned in its rearmost track position, there is no clearly discernable contact evidence on the front right passenger's air bag, and as the resident pathologist points out, there is no evidence of facial injury from contacting the

¹⁹ According to autopsy reports, the spinal cords of the case vehicle's driver and front right passenger were not examined. When questioned by this contractor regarding the significance of this non-examination, the resident pathologist who performed the autopsies indicated that when an atlanto-occipital subluxation occurs, there is a presumption of spinal cord injury.

²⁰ This photograph is the best photograph available that shows the front right passenger's head restraint just after the crash. This photograph shows the front right passenger's head restraint in front of the head restraint for the back right position and that the front right passenger's seat back was slightly reclined prior to the crash. In addition, this photograph shows the leftward tilting of the front right passenger's seat caused by the crash. This contractor, after noting the front right passenger's seat inclination, laid the seat backwards in order to obtain clearer photographs of the case vehicle's driver seating area.

²¹ According to the resident pathologist who performed the autopsy, the basilar artery laceration was a tension (stretching) type lesion rather than a shearing type lesion.

DISCUSSION (CONTINUED)

air bag. Based on the preponderance of the evidence, this contractor contends that it is no more than a possibility that the front right passenger's air bag caused the fatal lesions.

AIR BAG SYSTEM

	<u>DRIVER AIR BAG</u>	<u>PASSENGER AIR BAG</u>
Air Bag Diameter (seam-to-seam, deflated):	Width: 61 cm (24.0 in) Height: 65 cm (25.6 in)	Width: 50 cm (19.7 in) Height: 67 cm (26.4 in)
Number of Vent Holes:	Two	Two
Vent Hole Diameter:	5.0 cm (2.0 in)	6.0 cm (2.4 in)
Vent Hole Clock Positions:	Approximately Ten and Two o'clock	Approximately Ten and Two o'clock
Number of Air Bag Tethers:	Two	Two
Number of Air Bag Module Cover Flaps:	Two	One
Upper Cover Flap Dimensions:	Width: 13.5 cm (5.3 in) Height: 8.0 cm (3.1 in)	Width: 27 cm (10.6 in) Height: 8 cm (3.1 in)
Lower Cover Flap Dimensions:	Width: 13.5 cm (5.3 in) Height: 8.0 cm (3.1 in)	Not applicable
Distance between Dash and leading (i.e., closest) edge of Module's Cover Flap:	Not applicable	0 cm (0.0 in)
Generant Residue:	No unusual amount found	No unusual amount found

Appendix A:

RECONSTRUCTION PROGRAM RESULTS:

WINSMASH
(MISSING VEHICLE ALGORITHM)

EDCRASH
(MISSING VEHICLE ALGORITHM)

TRC VECTOR ANALYSIS ITERATIONS

WINSMASH
(MISSING VEHICLE ALGORITHM)
-- INCLUDING
BARRIER EQUIVALENT SPEEDS)

Two WinSMASH runs were made. The first run no crush measurements were entered for vehicle #2. In the second run, the mirror image of the case vehicle's crush was used for vehicle #2 (i.e., the case vehicle's C_1 crush measurement was also used for vehicle #2's C_1 crush, etc.). The only difference was that the undeformed end width for vehicle #2 (i.e., the L measurement) was estimated as larger than the case vehicle's undeformed end width.



U.S. Department of Transportation
National Highway Traffic Safety
Administration

SMASH PROGRAM SUMMARY

(All Measurements in Metric)

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

Identifying Title

10

Primary
Sampling Unit

9616

Case No.-Stratum

01

Accident Event
Sequence No.

1 1

Date (Month, day, year) of Run

GENERAL INFORMATION

VEHICLE 1

NASS Vehicle Number

Year

Make

Model

Body Style

CDC

PDOF

Heading Angle

01
1995

ISUZU

RODEO 4WD

4U

11 F Y E W S

020°

± 090°

VEHICLE 2

NASS Vehicle Number

Year

Make

Model

Body Style

CDC

PDOF

Heading Angle

02
1986

GMC

SIERRA CLASSIC C-1500

P U

12 F Y E W 4

0005°

± 245°

VEHICLE SPECIFICATIONS

VEHICLE 1

Wheelbase

Overall Length

Overall Width

Weight

1828 + 167 + 0 = 1995 kg

Curb Occupant(s) Cargo

Engine Displacement

Drive System

Size

Stiffness

276 cm

469 cm

174 cm

3.2 L

4WD

3

8

VEHICLE 2

Wheelbase

Overall Length

Overall Width

Weight

1602 + 104 + 100 = 1806 kg

Curb Occupant(s) Cargo

Engine Displacement

Drive System

Size

Stiffness

298 cm

491 cm

202 cm

5.0 L

RWD

5

8

DAMAGE INFORMATION

VEHICLE 1

Damage Known?

Damage Length

Damage Offset

Crush Depth:

Y

150 cm

29 cm

104 cm

65 cm

45 cm

22 cm

7 cm

0 cm

VEHICLE 2

Damage Known?

Damage Length

Damage Offset

Crush Depth:

N

_____ cm

± _____ cm

C1 _____ cm

C2 _____ cm

C3 _____ cm

C4 _____ cm

C5 _____ cm

C6 _____ cm

SCENE INFORMATION

Rest and Impact Positions ☐ No ☐ Yes

VEHICLE 1

Rest X _____ m
 Position Y _____ m
 Heading Angle _____ °
 Impact X _____ m
 Position Y _____ m
 Heading Angle _____ °
 Slip Angle (-180 to +180) _____ °

VEHICLE 2

Rest X _____ m
 Position Y _____ m
 Heading Angle _____ °
 Impact X _____ m
 Position Y _____ m
 Heading Angle _____ °
 Slip Angle (-180 to +180) _____ °

VEHICLE MOTION

Sustained Contact ☐ No ☐ Yes

VEHICLE 1

Vehicle Rotation ☐ No ☐ YesRotation Stop Before Rest ☐ No ☐ Yes

End of Rotation X _____ m

Position Y _____ m

Heading Angle _____ °

Curved Path ☐ No ☐ Yes

Point on Path

X _____ m Y _____ m

Rotation Direction ☐ None ☐ CW ☐ CCWRotation > 360° ☐ No ☐ YesSustained Contact ☐ No ☐ Yes

VEHICLE 2

Vehicle Rotation ☐ No ☐ YesRotation Stop Before Rest ☐ No ☐ Yes

End of Rotation X _____ m

Position Y _____ m

Heading Angle _____ °

Curved Path ☐ No ☐ Yes

Point on Path

X _____ m Y _____ m

Rotation Direction ☐ None ☐ CW ☐ CCWRotation > 360° ☐ No ☐ Yes

FRICTION INFORMATION

Coefficient of Friction _____

Rolling Resistance Option

1

Vehicle 1 Rolling Resistance

LF _____
 RF _____
 LR _____
 RR _____

Vehicle 2 Rolling Resistance

LF _____
 RF _____
 LR _____
 RR _____

IF THIS COMMON IMPACT WAS WITH A CDS VEHICLE NOT IN TRANSPORT, FILL IN THE INFORMATION BELOW.

Model Year: _____

Make: _____

Model: _____

VIN: _____

The Weight, CDC, Scene Data and Damage Information for this vehicle should be recorded above.

Complete and ATTACH the appropriate
 damage sketch and dimensions to the form.

General Information

TRC/IU 96-16

	<u>Vehicle 1</u>	<u>Vehicle 2</u>
Year:	1995	1986
Make:	Isuzu	GMC
Model:	Rodeo	Sierra Classic C-1500
Body Style:	4U	PU
CDC:	11FYEW5	12FYEW4
Damaged Side:		
PDOF:	-20°	5°
Heading Angle:	90°	245°

Vehicle Information

	<u>Vehicle 1</u>	<u>Vehicle 2</u>
Wheelbase:	276.0 cm	298.0 cm
Length:	469.0 cm	491.0 cm
Width:	174.0 cm	202.0 cm
Weight:	1995.0 kg	1806.0 kg
Center of Gravity:	228.1 cm	258.6 cm
Radius of Gyration:	140.7 cm	147.3 cm
D0:	105.7 sqrt(N)	105.7 sqrt(N)
D1:	8.0 sqrt(N)/cm	8.0 sqrt(N)/cm
Size Category:	3	5
Stiffness Category:	8	8

Vehicle 1: Used d0 and d1 values estimated from the vehicle size.

Vehicle 2: Used d0 and d1 values estimated from the vehicle size.

Damage Information

	<u>Vehicle 1</u>	<u>Vehicle 2</u>
Damage Length:	150.0 cm	ROLDMISS
Damage Offset:	0.0 cm	
Field L - D:	-29.0 cm	-45.0 cm
C1:	104.0 cm	
C2:	65.0 cm	
C3:	45.0 cm	
C4:	22.0 cm	
C5:	7.0 cm	
C6:	0.0 cm	

Summary of Results Using Damage

Vehicle 1

	Speed Change (Damage)	
Total:	42.6 km/h	(26.5 m.p.h.)
Longitudinal:	-40.0 km/h	(-24.9 m.p.h.)
Latitudinal:	14.6 km/h	(+9.1 m.p.h.)
PDOF:	-20°	
Energy Dissipated:	168,904 Joules	
Barrier Equivalent Speed:	44.9 km/h	(27.9 m.p.h.)
Moment Arm of Principle Force:	40.3 cm (CW)	
Change in Angular Velocity:	1.4 deg/seconds	


Used d0 and d1 values estimated from the vehicle size.

Vehicle 2

	Speed Change (ROLDMISS)	
Total:	47.1 km/h	(29.3 m.p.h.)
Longitudinal:	-46.9 km/h	(-29.1 m.p.h.)
Latitudinal:	-4.1 km/h	(-2.5 m.p.h.)
PDOF:	5°	
Energy Dissipated:	168,904 Joules	
Barrier Equivalent Speed:	44.7 km/h	(27.8 m.p.h.)
Moment Arm of Principle Force:	-67.4 cm (CCW)	
Change in Angular Velocity:	-2.3 deg/seconds	

Used d0 and d1 values estimated from the vehicle size.

Damage

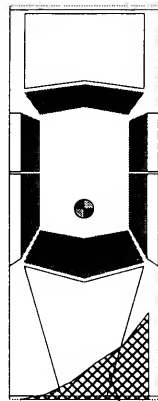

PDOF

Missing

1995 Isuzu Rodeo 4U

1986 GMC Sierra Classic C-1500 PU

General Information

TRC/IU 96-16

	<u>Vehicle 1</u>	<u>Vehicle 2</u>
Year:	1995	1986
Make:	Isuzu	GMC
Model:	Rodeo	Sierra Classic C-1500
Body Style:	4U	PU
CDC:	11FYEW5	12FYEW4
Damaged Side:		
PDOF:	-20°	5°
Heading Angle:	90°	245°

Vehicle Information

	<u>Vehicle 1</u>	<u>Vehicle 2</u>
Wheelbase:	276.0 cm	298.0 cm
Length:	469.0 cm	491.0 cm
Width:	174.0 cm	202.0 cm
Weight:	1995.0 kg	1806.0 kg
Center of Gravity:	228.1 cm	258.6 cm
Radius of Gyration:	140.7 cm	147.3 cm
D0:	105.7 sqrt(N)	105.7 sqrt(N)
D1:	8.0 sqrt(N)/cm	8.0 sqrt(N)/cm
Size Category:	3	5
Stiffness Category:	8	8

Vehicle 1: Used d0 and d1 values estimated from the vehicle size.

Vehicle 2: Used d0 and d1 values estimated from the vehicle size.

TRC/IU 96-16

WinSMASH 1. 2. 1

Damage Information

	<u>Vehicle 1</u>	<u>Vehicle 2</u>
Damage Length:	150.0 cm	180.0 cm
Damage Offset:	0.0 cm	0.0 cm
Field L - D:	-29.0 cm	-45.0 cm
C1:	104.0 cm	104.0 cm
C2:	65.0 cm	65.0 cm
C3:	45.0 cm	45.0 cm
C4:	22.0 cm	22.0 cm
C5:	7.0 cm	7.0 cm
C6:	0.0 cm	0.0 cm

Summary of Results Using Damage

Vehicle 1

	Speed Change (Damage)	
Total:	44.9 km/h	(27.9 m.p.h.)
Longitudinal:	-42.1 km/h	(-26.2 m.p.h.)
Latitudinal:	15.3 km/h	(+ 9.5 m.p.h.)
PDOF:	-20°	

Energy Dissipated:	168,904 Joules	
Barrier Equivalent Speed:	44.9 km/h	(27.9 m.p.h.)
Moment Arm of Principle Force:	40.3 cm (CW)	
Change in Angular Velocity:	1.5 deg/seconds	

Used d0 and d1 values estimated from the vehicle size.


Vehicle 2

	Speed Change (Damage)	
Total:	49.5 km/h	(30.8 m.p.h.)
Longitudinal:	-49.4 km/h	(-30.7 m.p.h.)
Latitudinal:	-4.3 km/h	(- 2.7 m.p.h.)
PDOF:	5°	


Energy Dissipated:	202,684 Joules	
Barrier Equivalent Speed:	49.3 km/h	(30.6 m.p.h.)
Moment Arm of Principle Force:	-64.7 cm (CCW)	
Change in Angular Velocity:	-2.4 deg/seconds	

Used d0 and d1 values estimated from the vehicle size.

Damage

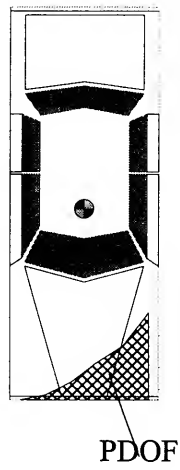

1995 Isuzu Rodeo 4U

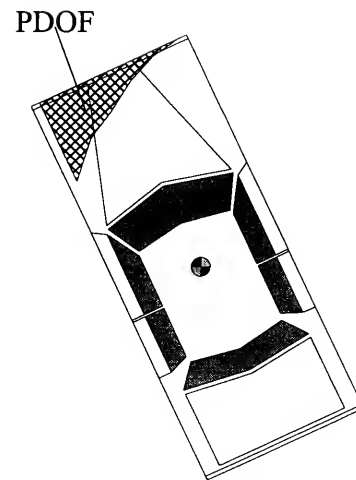

1986 GMC Sierra Classic C-1500 PU

CASE NUMBER IN9616

**NO
DATA**

The following page(s) were left intentionally blank.

PAGE NUMBER(S)

19-23

EDCRASH
(MISSING VEHICLE ALGORITHM)

CASE NUMBER IN9616

**NO
DATA**

The following page(s) were left intentionally blank.

PAGE NUMBER(S)

25 + 26

TRC VECTOR ANALYSIS ITERATIONS

The TRC Vector Analysis program was used to determine the resultant theoretical Direction of Principal Force for both vehicles. Heading angles were determined from a combination of the Police Crash Report, the scene, and the vehicle inspections, and weights were obtained from original specifications, the interviewee, and autopsies. Based on our inspection of the case vehicle's crush, this contractor initially estimated the case vehicle's Direction of Principal Force as -20 degrees. Based on the available police photographs, this contractor initially estimated vehicle #2's Direction of Principal Force as 360 degrees.

No driver interviews were obtained. The Police Crash Report and the physical evidence at the scene indicates that the case vehicle's driver steered right and brake to avoid vehicle #2. Based on the scene inspection, this contractor believes that the case vehicle was most likely traveling 64-80 km.p.h. (40-50 m.p.h.) prior to the driver's attempted avoidance maneuvers. Because skidmarks were noted on the Police Crash Report and observed at the scene, his speed at impact was most likely 24-40 km.p.h. (15-25 m.p.h.). According to the Police Crash Report, just prior to the crash vehicle #2 had passed several other vehicles at a *"high rate of speed"*. Because no skidmarks were present for vehicle #2, vehicle #2 most likely was traveling 80-97 km.p.h. (50-60 m.p.h.).

Twelve iterations of vehicle speeds are shown below: 24-40 km.p.h. (15-25 m.p.h.) for the case vehicle and 80-105 km.p.h. (50-65 m.p.h.) for vehicle #2. The program indicates that: (1) as the case vehicle's speed increases, the force collinearity vector rotates less than +5 degrees for both vehicles, and (2) as vehicle #2's speed increases, the force collinearity vector rotates no more than -2 degrees for both vehicles. Iteration number seven most closely matches the observed vehicle dynamics. Therefore, the impact speeds for the case vehicle and vehicle #2 are most likely 32 km.p.h. (20 m.p.h.) and 97 km.p.h. (60 m.p.h.), respectively. In accordance with NASS, CDS protocol, the Direction of Principal Forces were assigned at -20 for the case vehicle and +5 for vehicle #2.

CASE NUMBER IN9616

**NO
DATA**

The following page(s) were left intentionally blank.

PAGE NUMBER(S)

28-31

Appendix B:

SELECTED PHOTOGRAPHS

A total of eighty-eight color copies of photographs are presented and referenced as Photograph #01 through Photograph #88. Photographs numbered #17 through #20, and #88 were taken and made available by the applicable county Sheriff Department. Photographs #22, #23, #39, #65, and #80 through #87 were taken and made available by the State Police. The remainder of these photographs were taken by the Transportation Research Center.



01: Case Vehicle's eastward travel path approaching left hand curve approximately 90 meters (295 feet) west of impact area



02: Case Vehicle's eastward travel path entering left hand curve approximately 60 meters (197 feet) west of impact area



03: Case Vehicle's eastward travel path in left hand curve approximately 40 meters (131 feet) west of impact area



04: Case Vehicle's east-northeastward travel path approximately 20 meters (66 feet) west of impact area; NOTE: double gouges in mid-lane (cell F6)



05: Case Vehicle's east-northeastward travel path approximately 10 meters (33 feet) west of impact area; NOTE: two sets of double gouges (cells E7--E8 and F5)



06: Close-up of double gouges in mid-eastbound lane located approximately 5 meters (16 feet) west of impact; NOTE: gouges from Vehicle #2's post-impact travel



07: Case Vehicle's eastward travel path approximately 5 meters (16 feet) west of impact showing beginning of right front pre-impact skidmark on south edge line



08: Eastward close-up view of Case Vehicle's impact area showing right front skidmark and parallel double gouges from Vehicle #2's post-impact rotation




09: South-southeastward view of Case Vehicle's final rest position approximately 7 meters (23 feet) southwest of impact area; NOTE: paint locates tire positions



10: North-northwestward view of Case Vehicle's final rest position approximately 7 meters (23 feet) southwest of impact area; NOTE: paint locates tire positions



11: Westward view from impact area of Case Vehicle's eastward travel path into left hand curve; NOTE: negative slope in Case Vehicle's direction of travel

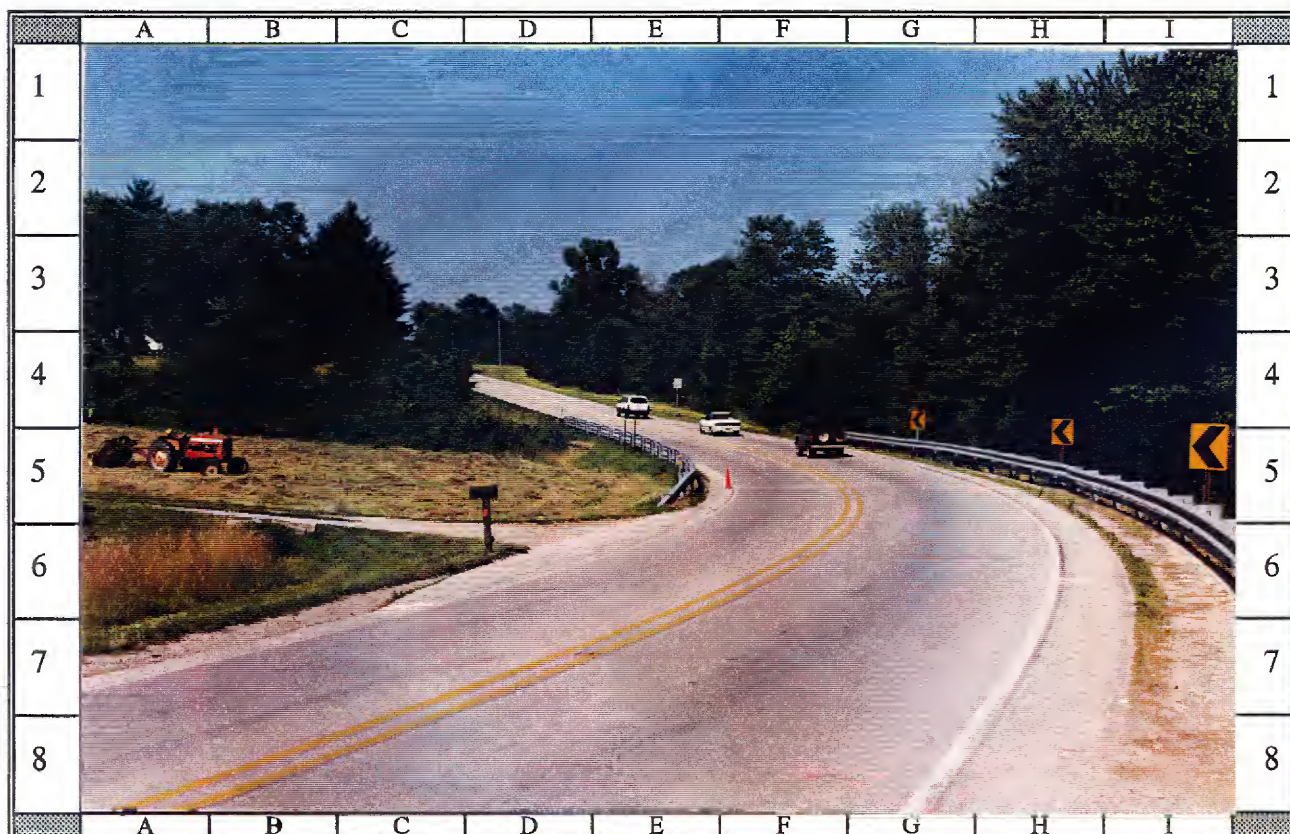

12: Northeastward view of Vehicle #2's southwest travel path in right hand curve viewed from beyond impact area; NOTE: orange cone marks location of sag



13: Vehicle #2’s southwestward travel path ~ 105 meters (344 feet) northeast of impact; NOTE: decreasing radius right hand curve and negative grade



14: Vehicle #2’s southwestward travel path approximately 50 meters (164 feet) north-east of impact; NOTE: Vehicle #2 has traversed sag and grade is positive



15: Vehicle #2's southwestward travel path approximately 16 meters (52 feet) north-east of impact; NOTE: impact is midway along south guardrail's end section



16: Southwestward view of Vehicle #2's impact area; NOTE: no pre-impact skid-marks by Vehicle #2 and final rest location of Case Vehicle in background

WARNING

The following two pages contain photographs with graphic detail
which show the tragic consequences of a motor vehicle crash!

“GRAPHIC” PHOTOGRAPHS AND IMAGES

The following “GRAPHIC” Photographs and Images have been removed from this case.

page 49 photos #17 + #18 page 50 photos #19 + #20


If you would like a copy of these photographs and/or images please write to:

MARJORIE SACCOCCIO
VOLPE NATIONAL TRANSPORTATION SYSTEMS CENTER
55 BROADWAY
CAMBRIDGE, MA 02142


In the body of your request please include the case, photograph and image number(s).



21: Northward view of Vehicle #2's final rest position perpendicular to westbound lane, heading southward; NOTE: rear tires were on the north edge line

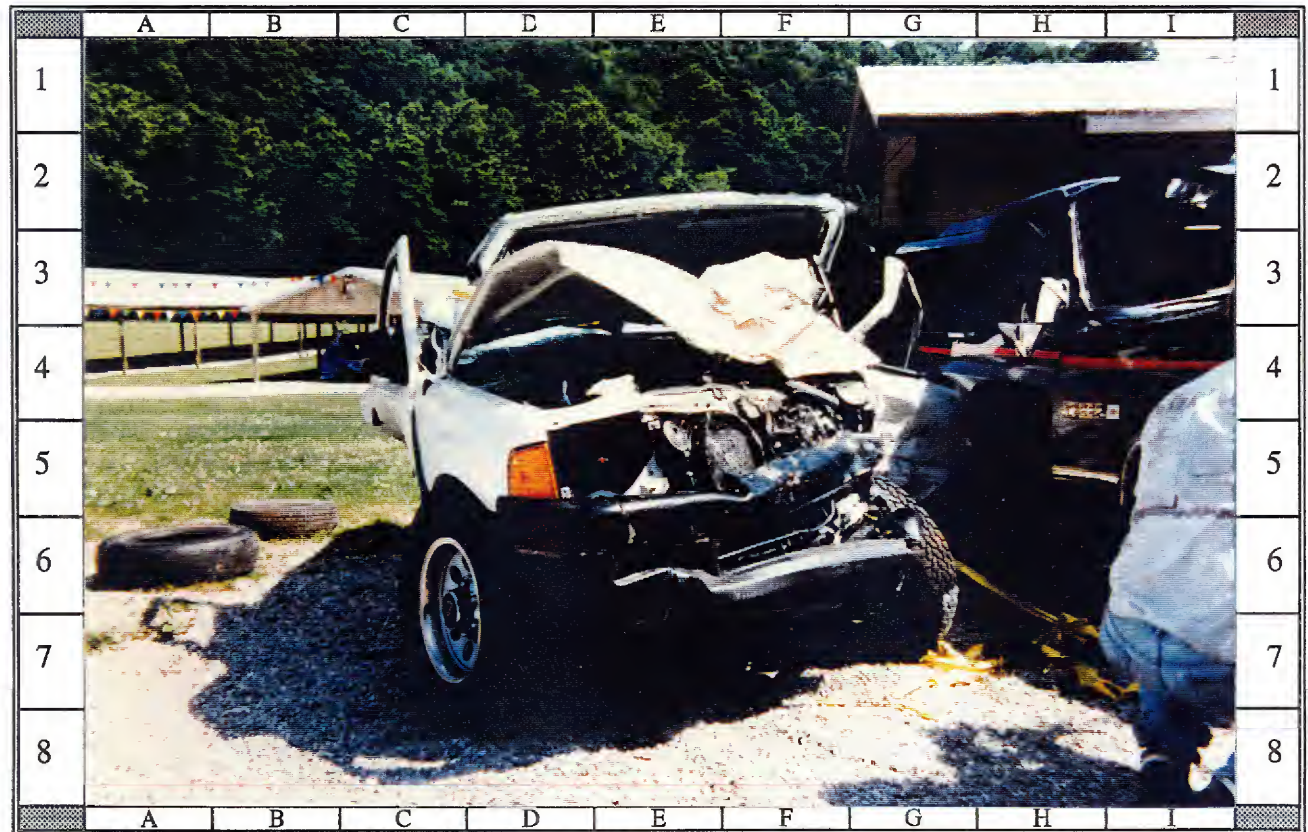


22: Case Vehicle's frontal damage viewed from front; NOTE: severe crush to front left half and leftward end shift

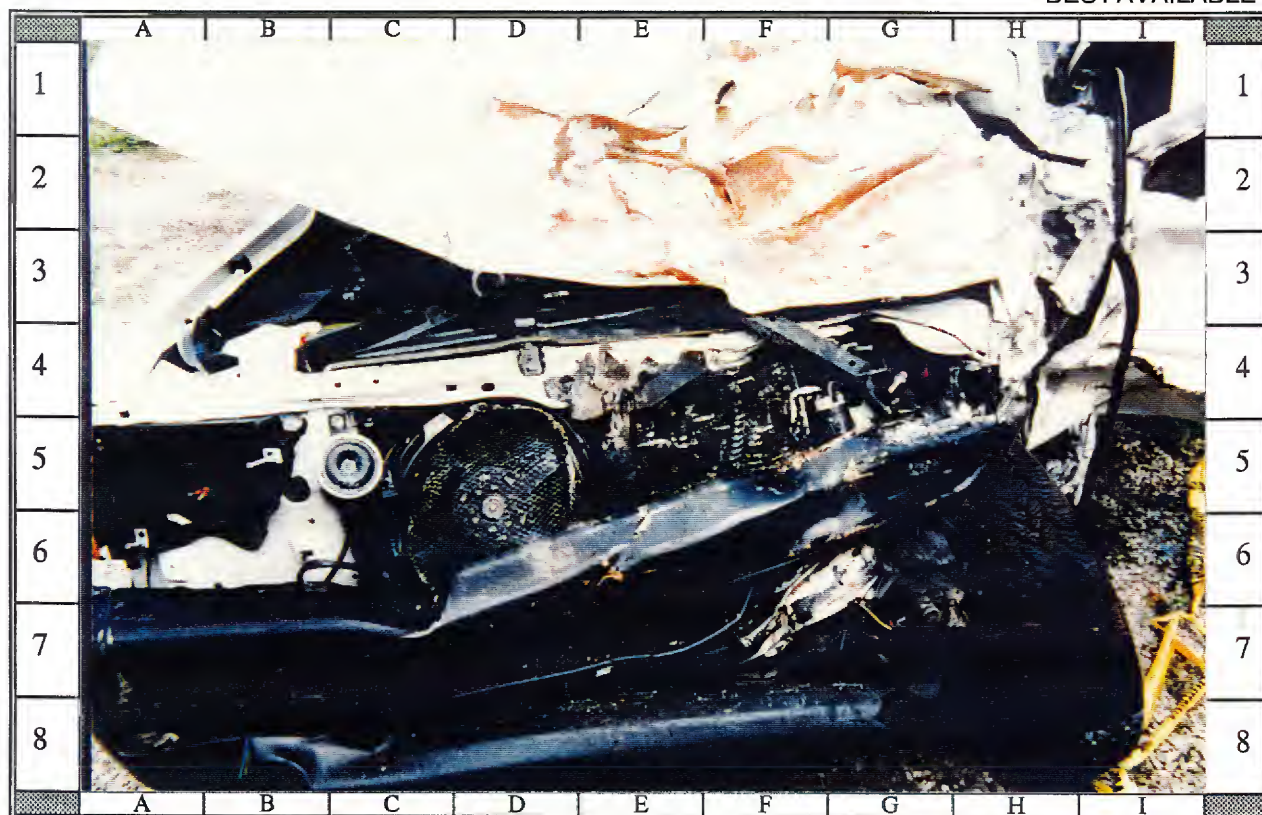

23: Close-up of Case Vehicle's front left damage viewed from approximately 30 degrees left of front



24: Case Vehicle's damaged front with contour gauge present; NOTE: direct damage extends from yellow tape (cells E4--E5) to the left front corner

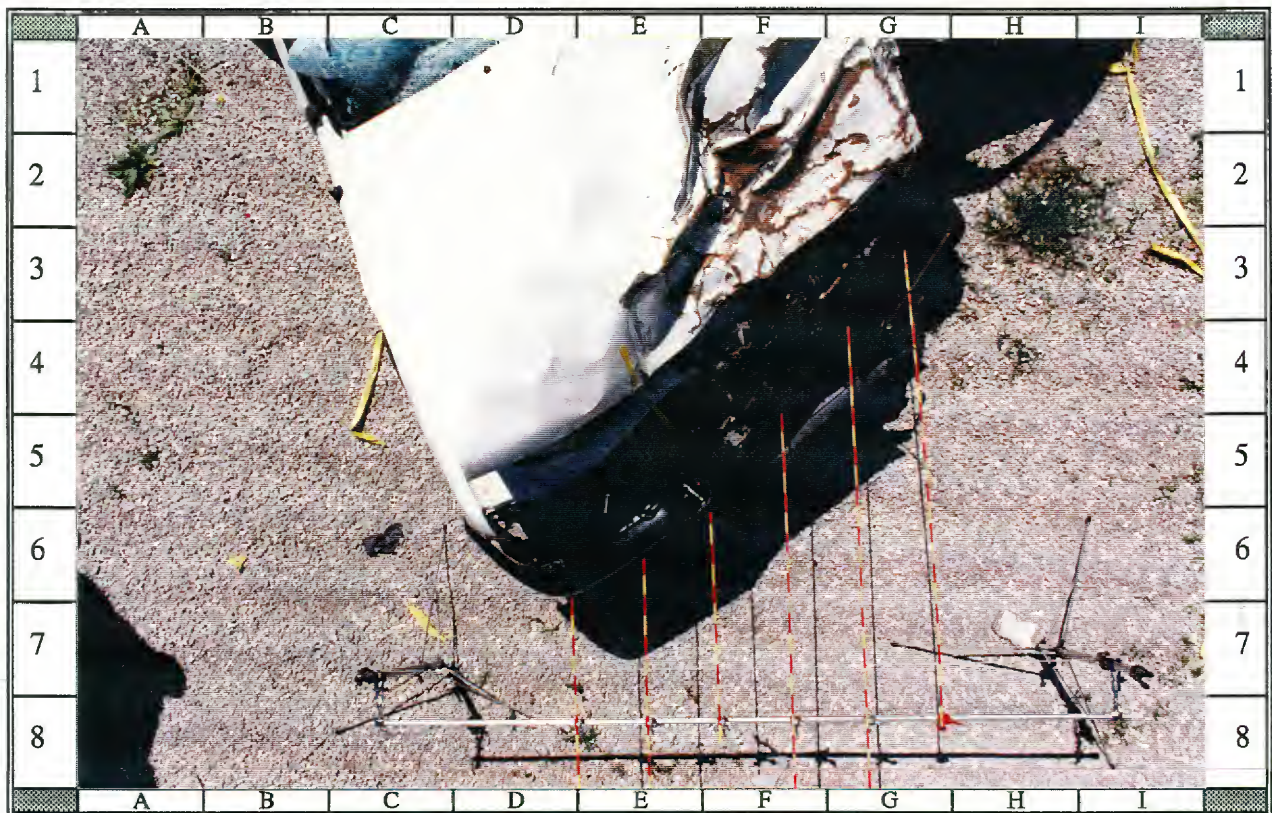

25: Overhead view of Case Vehicle's front left damage with contour gauge present showing extensive crush to front-left corner and leftward end shift



26: Front overhead view of Case Vehicle's front left damage viewed from ~ 30 degrees left of front; NOTE: direct damage extends to mid-left driver's door



27: Reference line view of Case Vehicle's damaged front and left side viewed from front showing severe front left crush and left front door damage and tire position



28: Case Vehicle's damaged front and left side viewed from approximately 30 degrees left of front with contour gauge present



29: Case Vehicle's front left damage viewed from approximately 45 degrees left of front; NOTE: extensive crush and buckling of left front door sill



30: Reference line view of Case Vehicle's damaged front viewed from left showing extensive front left crush and direct damage to driver's door and left side rail



31: Close-up of Case Vehicle's left front tire and front left bumper corner; NOTE: direct damage to left front door and downward buckling to left front door sill



32: Close-up of Case Vehicle's damaged left front tire and wheel; NOTE: front wheel and rim damage from vehicle #2, rear damage from bottom of fire wall



33: Case Vehicle's driver door viewed from approximately 45 degrees left of back showing separation of outer and inner door surfaces and extrication damage



34: Close-up of rear surface of Case Vehicle's driver door; NOTE: extrication tool-induced damage and separation of outer and inner door surfaces



35: Latch plate for Case Vehicle's driver door showing lack of crash-induced deformation (at yellow tape) and extrication marks on left rear door's surface



36: Close-up of latch plate for Case Vehicle's driver door; NOTE: no evidence of crash-induced deformation on latch plate



37: Case vehicle's left side and undamaged rear viewed from approximately 45 degrees left of back; NOTE: intact glazing rearward of left rear window



38: Reference line view of Case Vehicle's left side from back; NOTE: exterior sheet metal pulled away from the left front door panel



39: Case Vehicle's undamaged back plane showing four-wheel drive indicator and undamaged backlight



40: Reference line view of Case Vehicle's right side from back; NOTE: extrication tool-induced deformation to right front passenger door



41: Case Vehicle's right side and undamaged back viewed from approximately 45 degrees right of back; NOTE: intact glazing rearward of right front window



42: Close-up of Case Vehicle's lower right "B"-pillar; NOTE: extrication tool-induced damage to forward edge of right rear door and the lower "B"-pillar



43: Reference line view of Case Vehicle's damaged front viewed from right; NOTE: leftward front end shift exposes lower right "A"-pillar area



44: Case Vehicle's right side viewed from approximately 60 degrees right of front showing extrication tool-induced damage to right "A"-pillar at beltline




45: Case Vehicle's frontal damage with contour gauge present viewed from approximately 15 degrees right of front showing pronounced leftward front end shift



46: Reference line view of Case Vehicle's damaged front and right side viewed from front showing induced damage to right front fender and leftward front end shift



47: Residue of interior surface of Case Vehicle's driver door and front seating area;
NOTE: leftward displacement of driver's seat

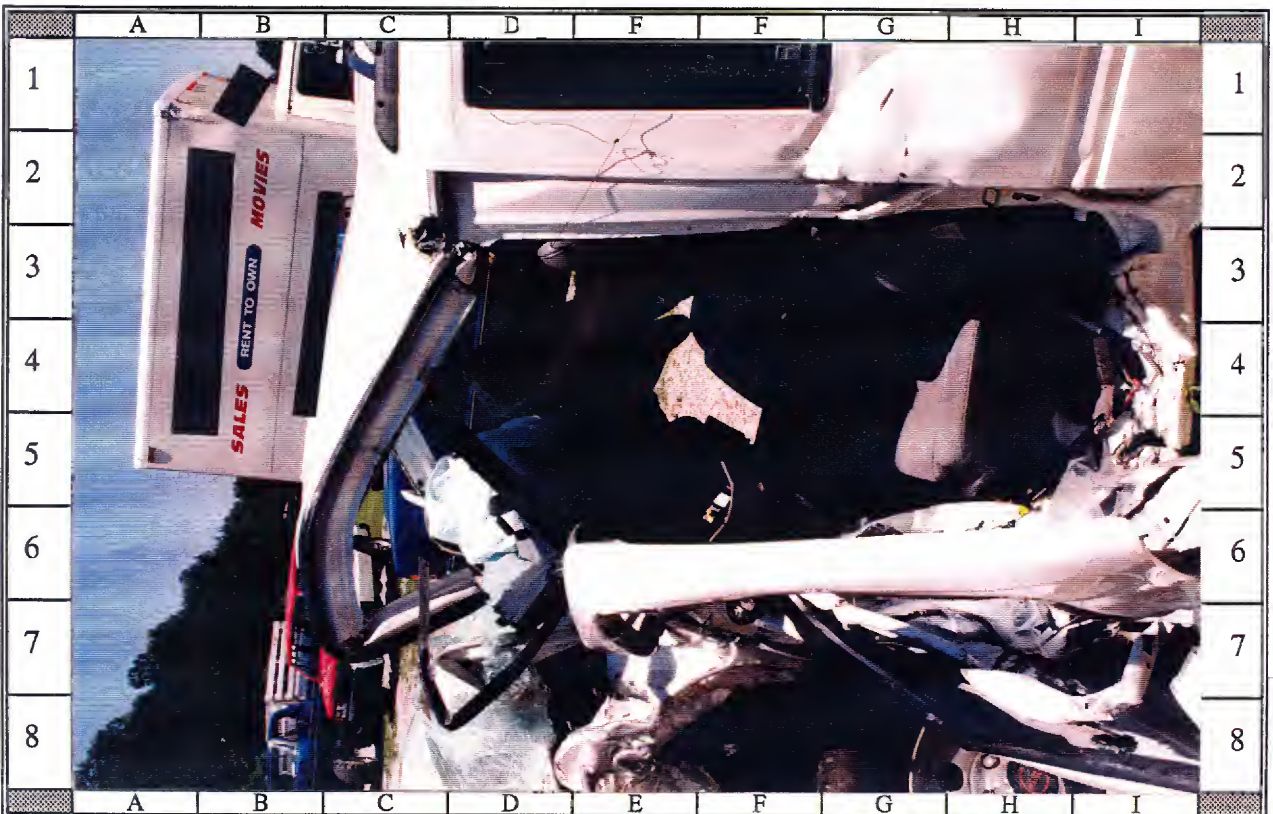

48: Case Vehicle's front seating area viewed from outside driver's door; NOTE:
deformed left "A"-pillar and unused male end of safety belt (cells F3--G3)




49: Close-up of Case Vehicle's left lower dash showing dash's rearward displacement and probable occupant contact points to lower dash and steering column




50: Close-up of Case Vehicle's lower center dash showing foot pattern on brake pedal; NOTE: rearward displacement of, and deformation to, the radio




51: Case Vehicle's left upper "A"-pillar, roof header, and roof side rail; NOTE: roof hole (cells B7--B8) caused by bending roof rearward after "A"-pillars were cut

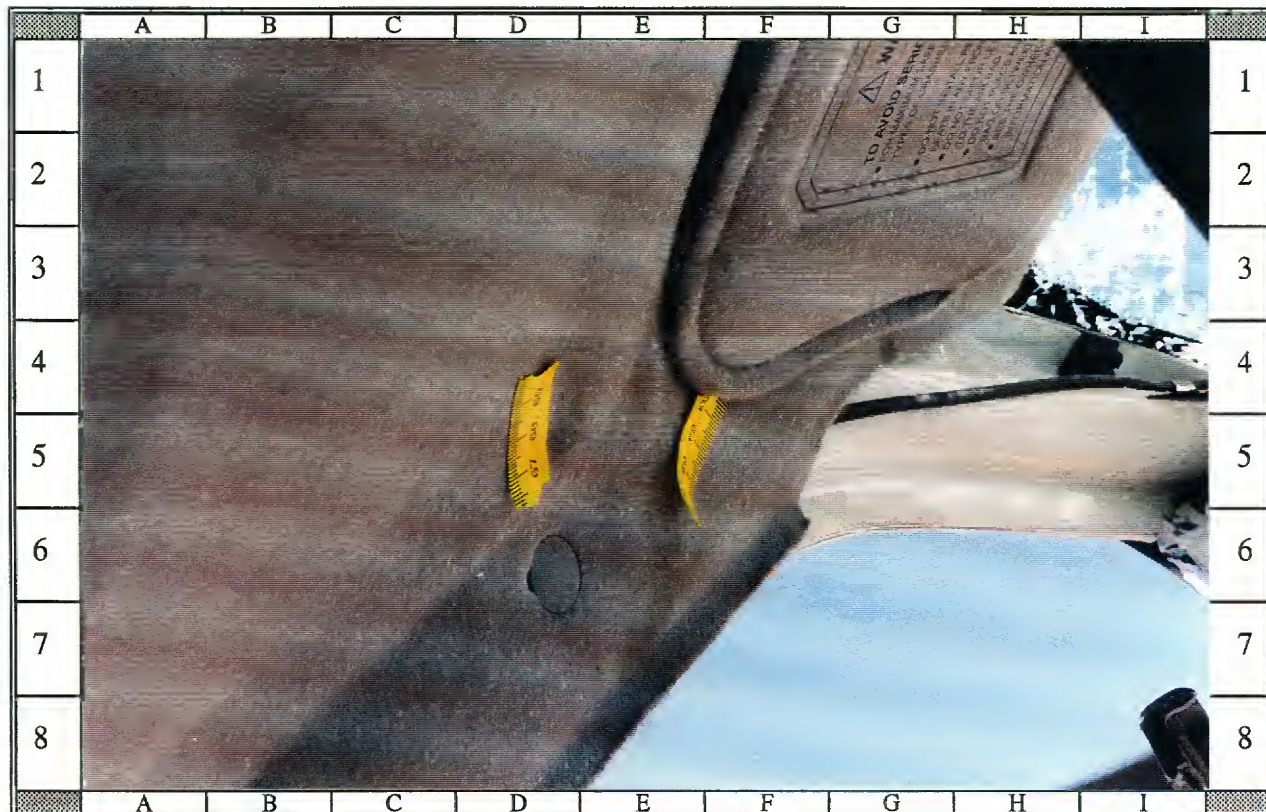

52: Close-up of Case Vehicle's left front roof corner and left sunvisor showing probable occupant contact points

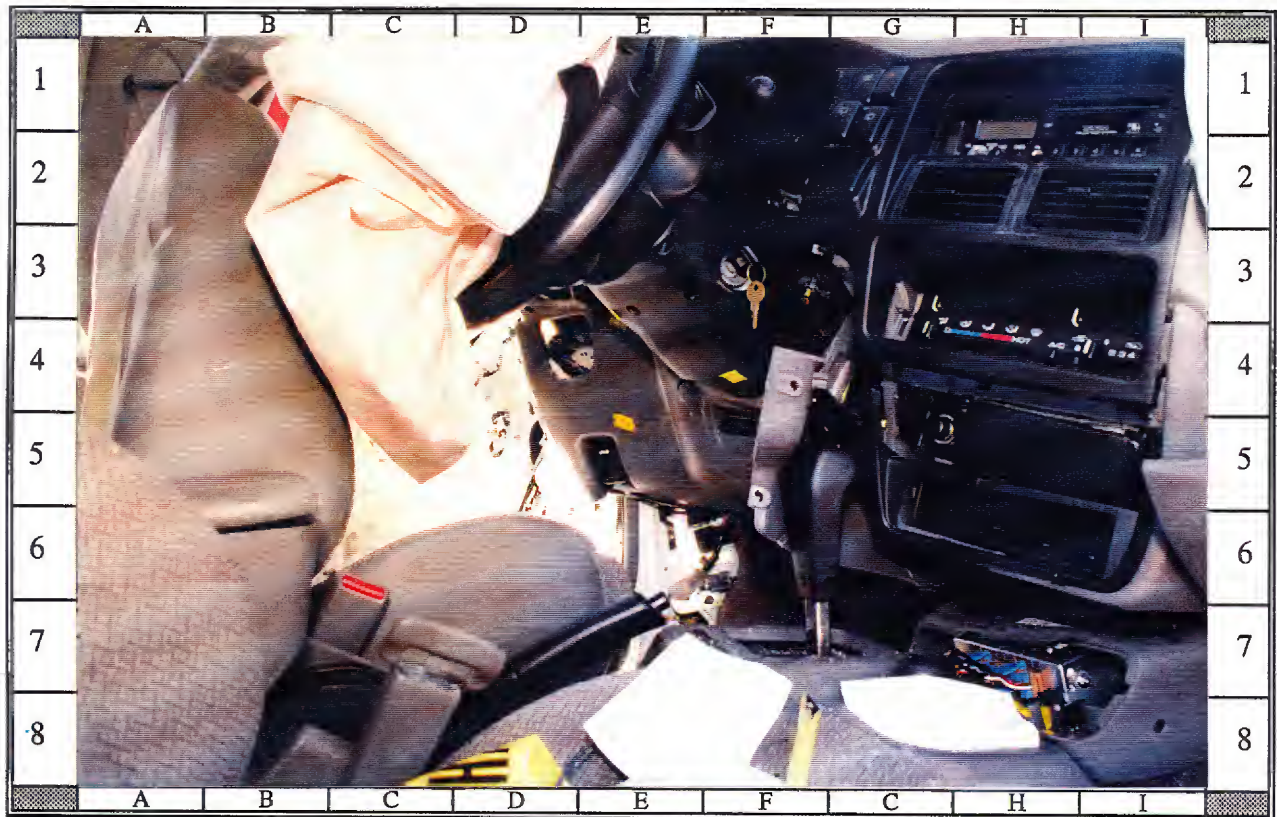

53: Close-up of Case Vehicle's lower left and center dash showing intrusion, deployed driver's air bag, and right front passenger's seat belt latch assembly

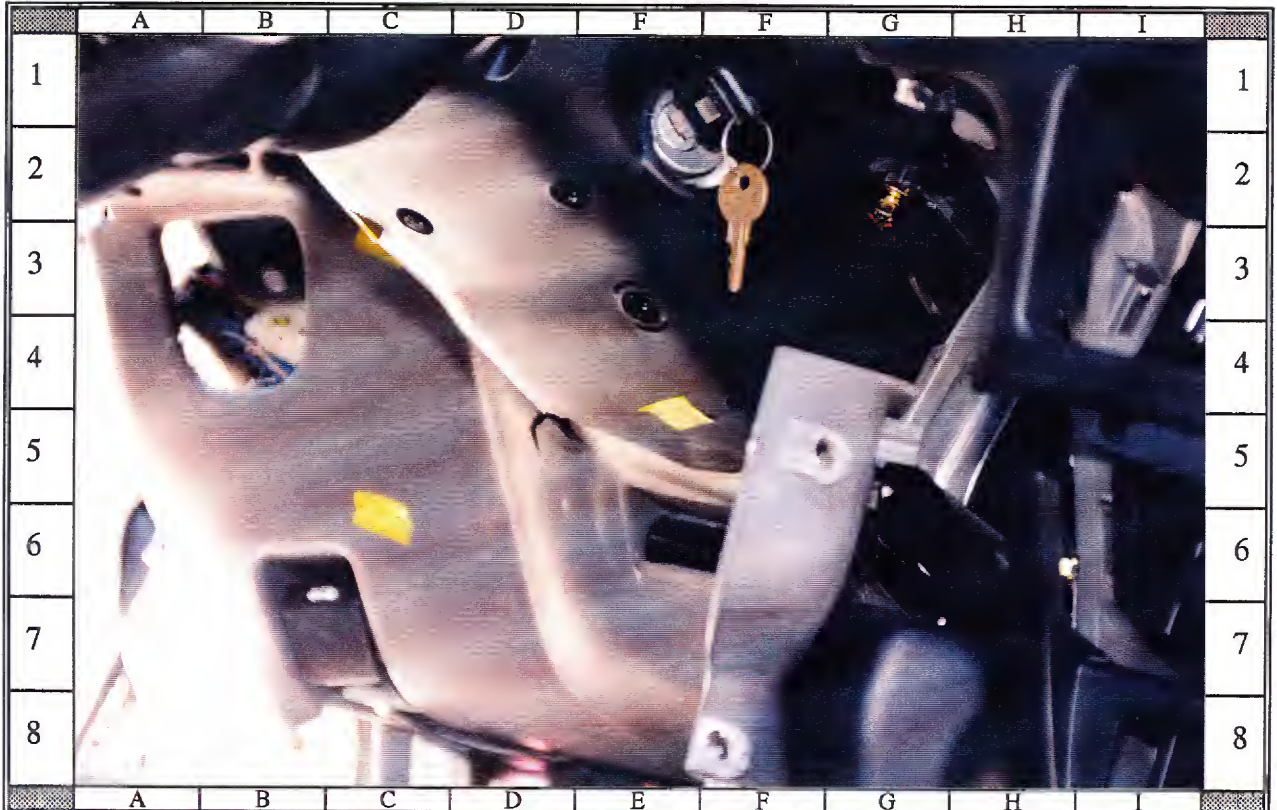

54: Close-up of Case Vehicle's left lower dash and bottom of steering column showing dash intrusion and probable occupant contacts



55: Case Vehicle's driver seating area viewed from the right rear; NOTE: front out-board 3-point safety belts, adjustable head restraints, and leftward tilted seatback



56: Case Vehicle's deployed driver air bag showing possible occupant contact point in lower center of air bag; NOTE: leftward tilting driver's seat



57: Close-up of Case Vehicle's deployed driver air bag showing a possible occupant contact point (i.e., unknown substance) in lower center of air bag



58: Case Vehicle's driver seating area viewed from right showing deployed driver side air bag; NOTE: unknown substance on air bag near right seam



59: Close-up of Case Vehicle's deployed driver side air bag showing unknown substance near right seam




60: Case Vehicle's driver seating area viewed from right showing deployed driver side air bag; NOTE: unknown substance on right backside of air bag




61: Close-up of Case Vehicle's deployed driver air bag showing an unknown substance on lower right backside of deployed air bag




62: Case Vehicle's right front seating area viewed from left rear showing deployed air bags; NOTE: no contact evidence to right header, sunvisor, or side rail areas

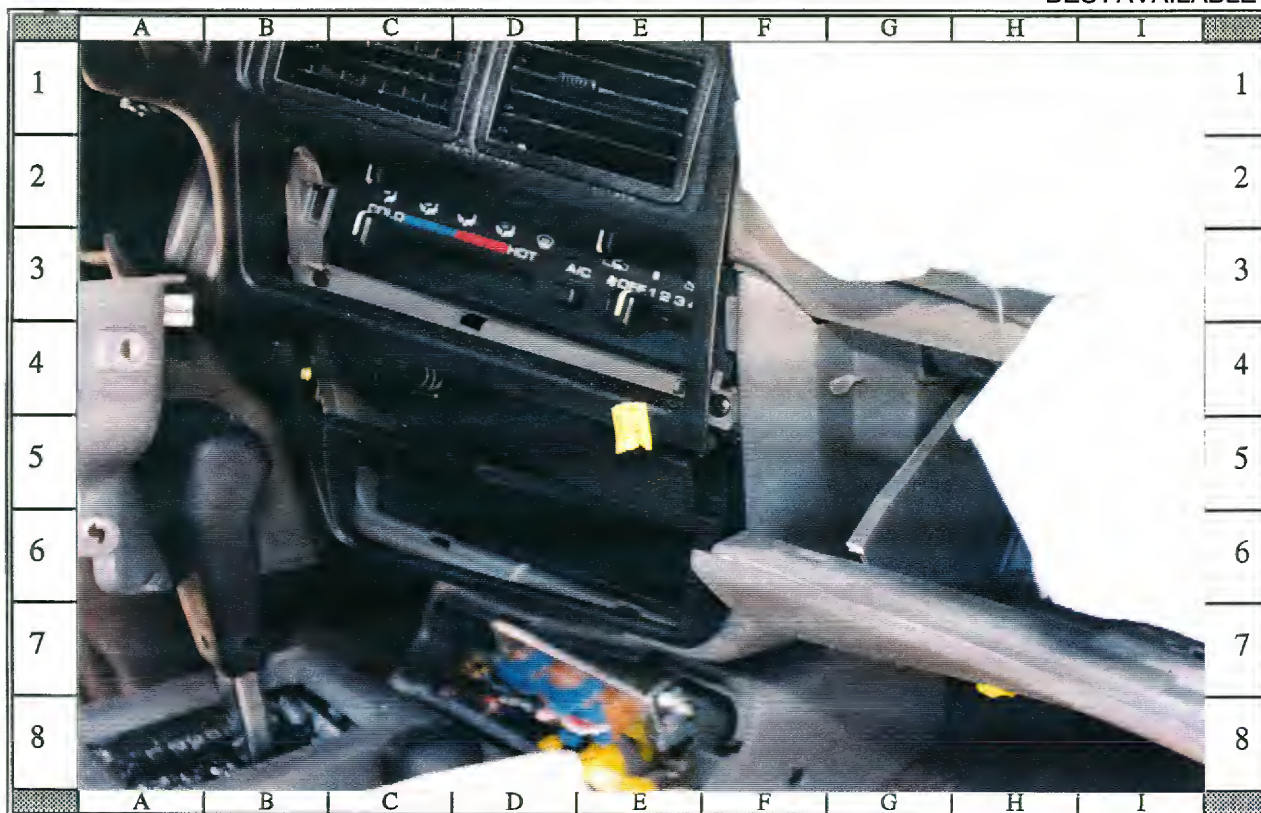

63: Close-up of Case Vehicle's center dash area showing displaced plastic covering, broken radio face, possible center contact, and deployed right front air bag

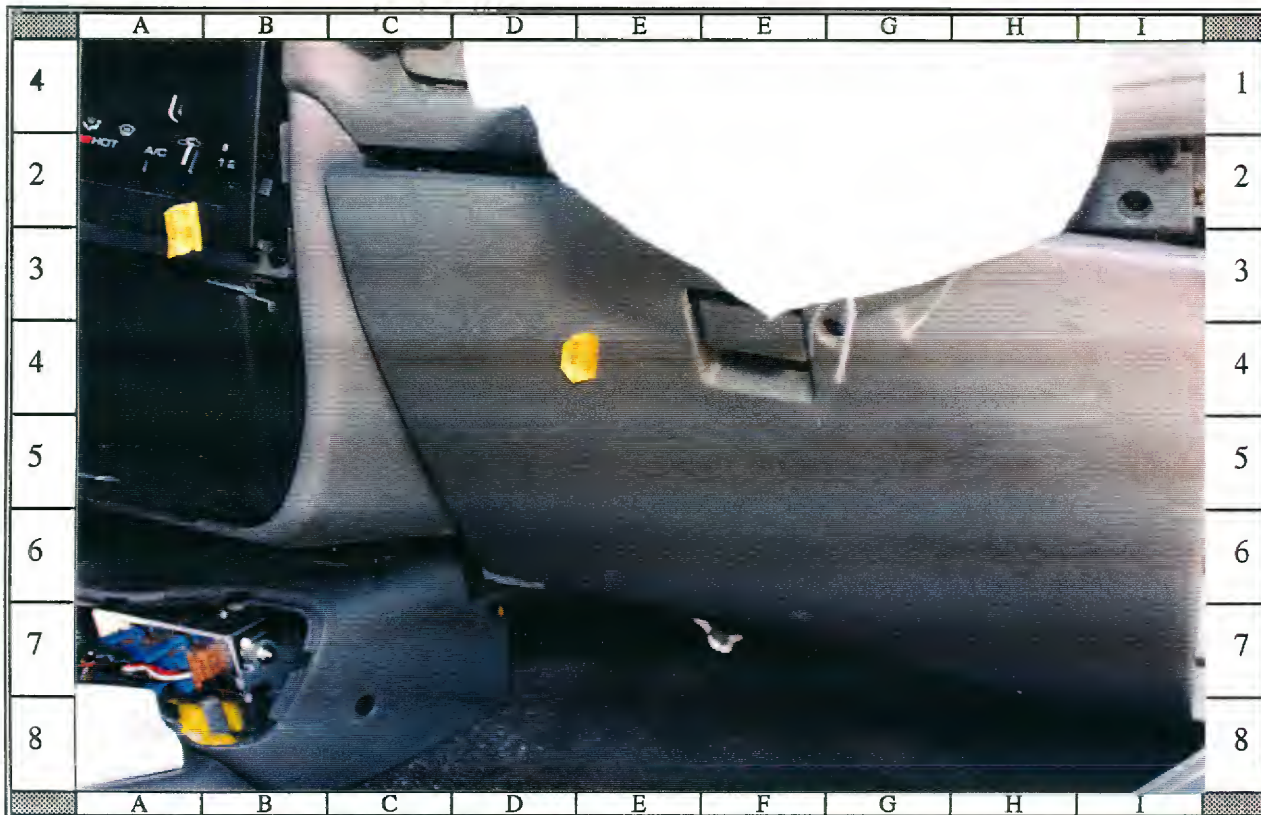

64: Close-up of Case Vehicle's glove compartment door showing possible contact point and deployed right front passenger air bag

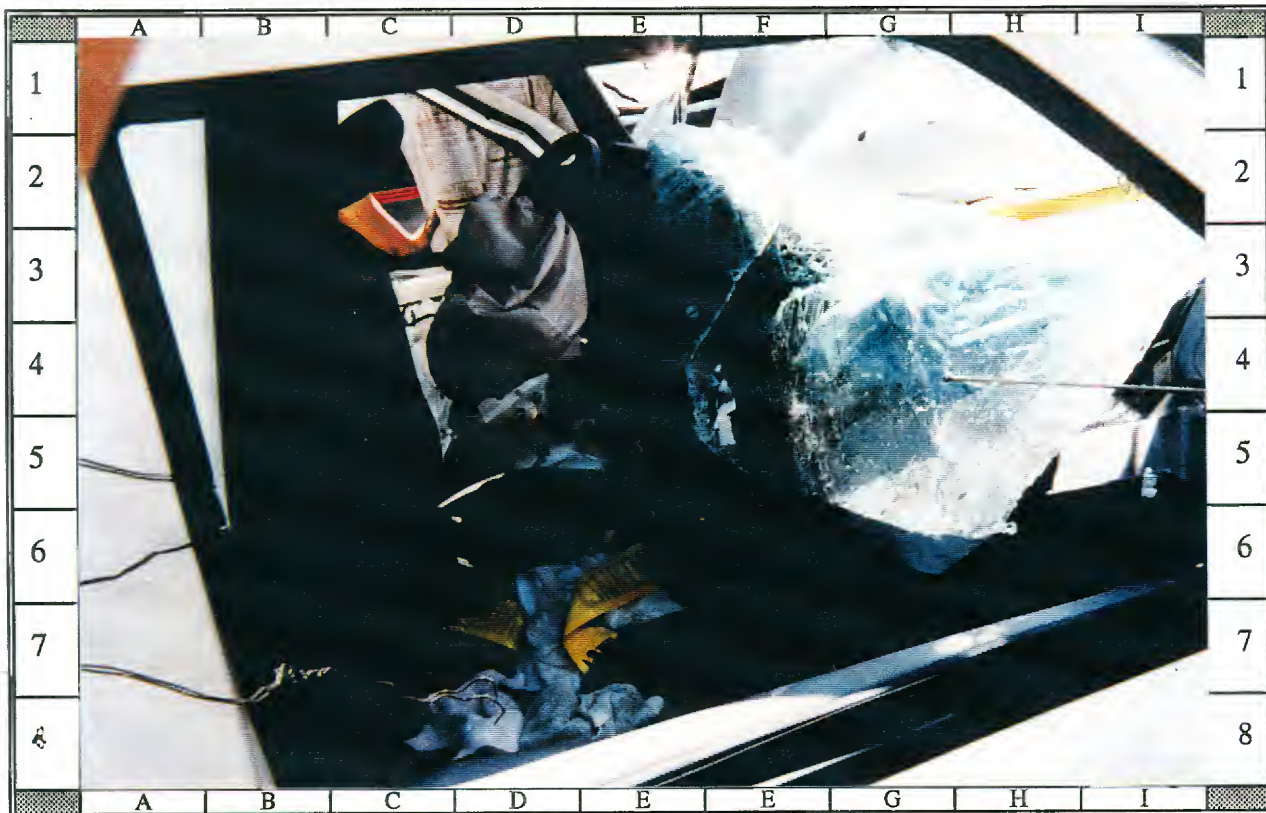

65: Case Vehicle's front seating area viewed through disintegrated right front glazing;
NOTE: windshield collapsed over passenger's air bag after extrication



66: Case Vehicle's front seating area viewed through right front door showing extensive intrusion into driver's area and damage to right front dash and kick panel



67: Close-up of Case Vehicle's right kick panel showing possible right front passenger contact



68: Interior surface of Case Vehicle's right front door showing no contacts; NOTE: deployed passenger air bag, cut "A"-pillar, and windshield folded onto hood



69: Case Vehicle's right front seating area viewed from ~ 60 degrees back of right showing deployed air bag and dash damage; NOTE: extrication damage



70: Close-up of Case Vehicle's deployed right front passenger air bag showing possible occupant contact on air bag's lower left quadrant



71: Close-up of Case Vehicle's deployed right front passenger air bag showing possible occupant contact (i.e., between fingers) on air bag's lower right quadrant



72: Close-up of top cover flap from Case Vehicle's right front air bag module;
NOTE: no contact evidence on cover flap and tear to right dash (cells H2--I5)



73: Close-up of Case Vehicle's right front "D"-ring on right "B"-pillar; NOTE: "D"-ring shows evidence of loading from right front passenger's safety belt



74: Underneath side of Case Vehicle's right front safety belt showing occupant load-ing stretch marks; NOTE: belt cut (cells I4--I5) by EMTs to enable extrication



75: Top (cells B4--B5) side of Case Vehicle's right front safety belt showing occupant loading stretch marks; NOTE: extrication cut to right roof side rail



76: Close-up of top side of Case Vehicle's right front safety belt showing occupant loading crease from "D"-ring



77: Close-up of underneath side of Case Vehicle's right front safety belt showing occupant loading crease from "D"-ring



78: Close-up of Case Vehicle's right front safety belt latch assembly (i.e., connection of male and female ends) viewed from right; NOTE: belt cut for extrication




79: Case Vehicle's second seating area viewed through disintegrated left rear glazing showing outboard 3-point safety belts and adjustable head restraints



80: 1986 GMC pickup's (Vehicle #2's) damaged front viewed from left; NOTE: extent of crush and indirect damage to left "A"-pillar



81: Close-up of Vehicle #2's damaged front viewed from approximate 30 degrees left of front; NOTE: orange metal at left of photo is wrecker's tow bar

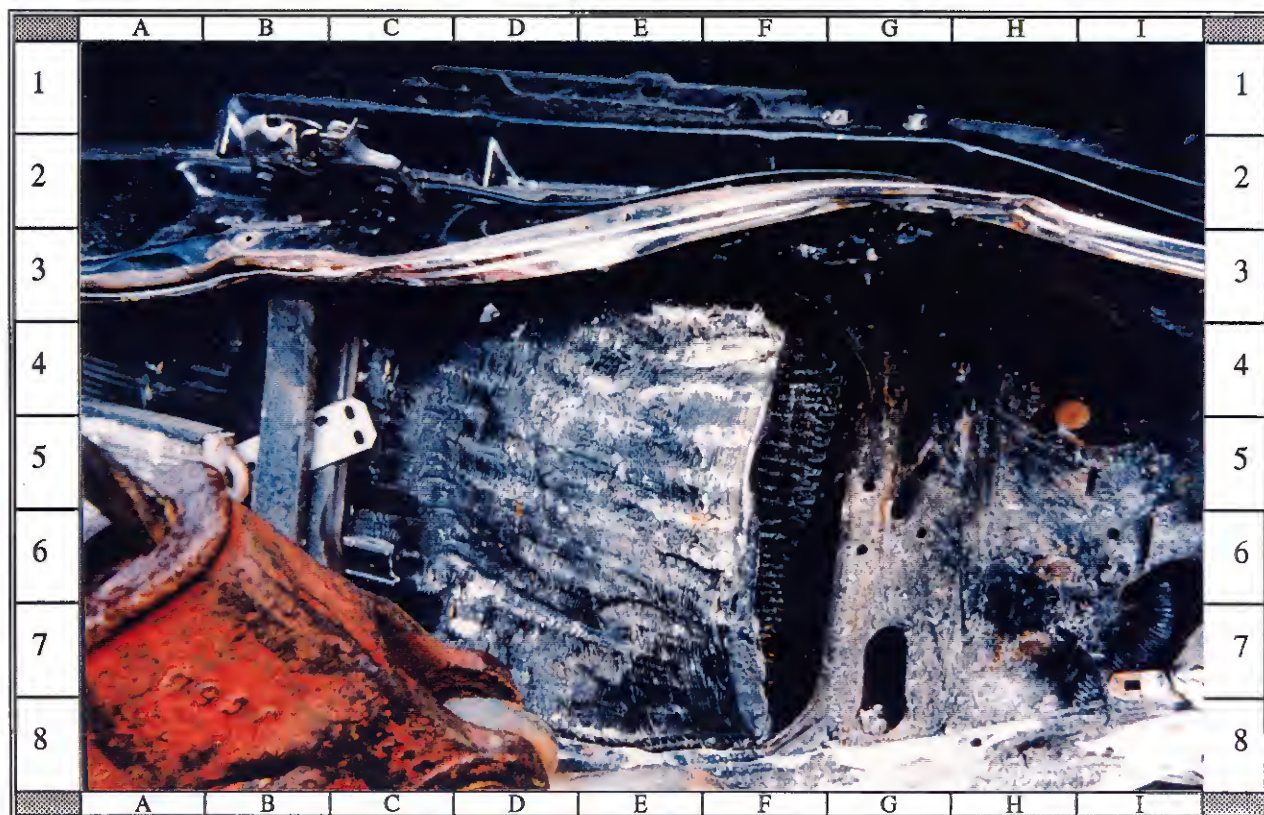

82: Close-up view of Vehicle #2's damage front center viewed from approximate 30 degrees left of front; NOTE: damage to hood latch and radiator




83: Vehicle #2's undamaged back showing attached half-shell camper top



84: Reference line view of Vehicle #2's right side from rear showing extensive shifting of cab



85: Close-up of Vehicle #2's left-to-right cab shift viewed from back; NOTE: extensive offset between cab and cargo bed

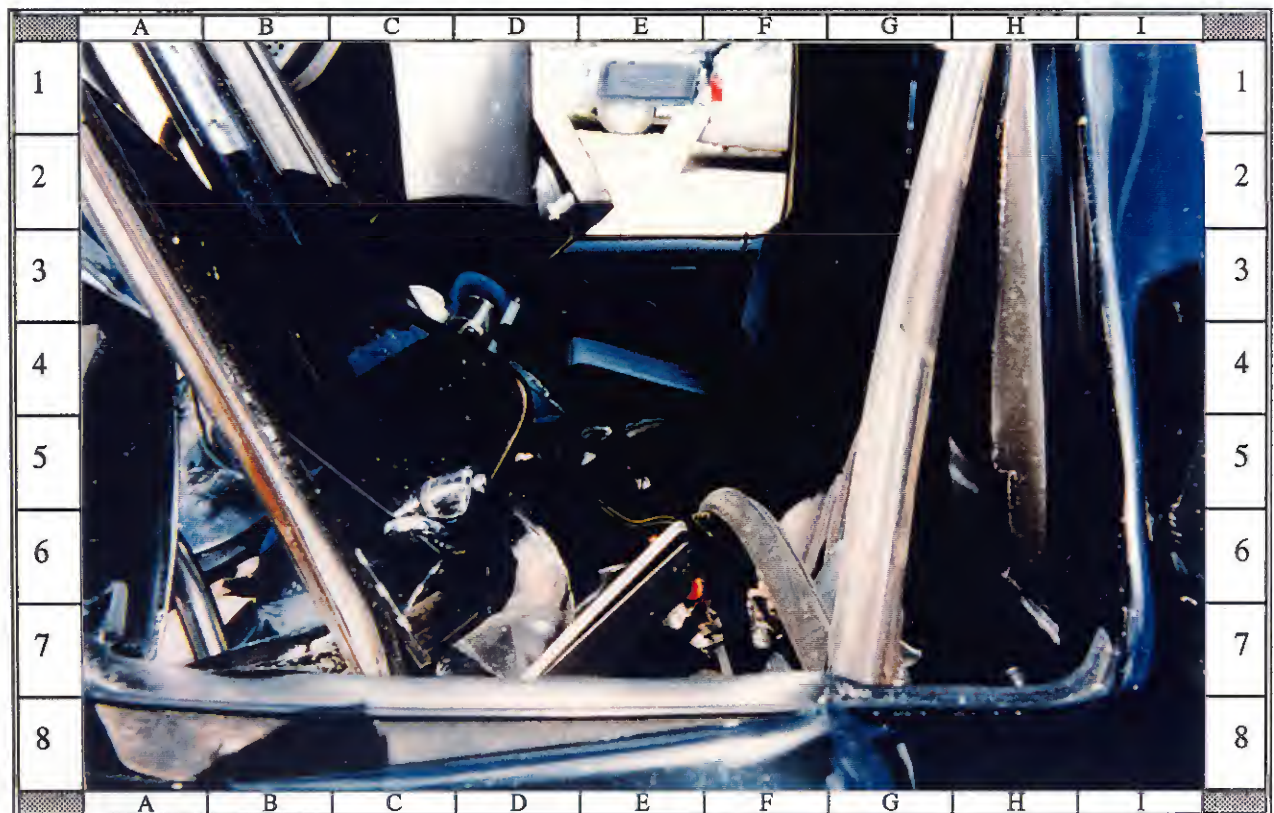

86: Vehicle #2's driver seating area viewed through the driver's disintegrated door glazing; NOTE: extensive intrusion into driver's space



87: Vehicle #2's front bench seat viewed through right front passenger's disintegrated door glazing; NOTE: position of steering wheel and column and bent seatback



88: On-scene view of Vehicle #2's steering wheel, instrument panel, and dash area viewed through right side of backlight; NOTE: intrusion to driver seating area

Vehicle #2: 1986 GMC C-1500, 2-Door, 4x2, Regular Cab Pickup, 6.5-Foot Bed, 5.0 L (305 in³) V-8 4BBL

POLICE CRASH REPORT

OFFICER'S STANDARD CRASH REPORT

State Form 23558(R3.7-91) Stock 302

Mail to:

Crash Records Section

OFFICE USE ONLY

Crash I.D. No.

Date of Crash MONTH DAY YEAR 96		Day of Week	Actual Local Time 9:37	<input checked="" type="checkbox"/> AM <input checked="" type="checkbox"/> PM	No Motor Vehicles 2	No Injured 1	No Dead 2	No Trailers 0
County		Township		City/Town or Nearest City/Town				
Inside Corporate Limits? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		Property? <input type="checkbox"/> Private <input checked="" type="checkbox"/> Other		Distance and Direction From Corporate Limits Miles North Miles South Miles East 6 Miles West				
Road Crash Occurred On		Intersecting Road/Mile Marker/Interchange						
If not at intersection number of feet from		Direction		Nearest Intersecting Road/Mile Marker/Interchange				
758 ft		W						

Driver's Name (Last, First, MI)			
Address (Street, City, State, Zip)			
Apparent Phys. Stat. (enter no.) 2	Sex M	Date of Birth YEAR 70	Arrested? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Driver's License No. 26		Lic. Type OP	Lic. St. Restr.
Color BLK/GRA	Veh. Yr. 86	Make GMC	Model Name P/U
Veh. Type (enter no.) 2	Lic. Yr. 96	License No.	
Veh. Use (enter no.) 1	Speed Limit 45	Fuel Tax No.	
Direction of Travel W	No Occupants 1	Fire? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	No Axles 2
Towed To		Towed By	
Registered Owner's Name (Last, First, MI)			
Address (Street, City, State, Zip)			
Registered Owner's Name (Last, First, MI)			
Address (Street, City, State, Zip)			
License No.	Make	Year	Lic. St. Lic. Yr.

Driver's Name (Last, First, MI)			
Address (Street, City, State, Zip)			
Apparent Phys. Stat. (enter no.) 1	Sex M	Date of Birth YEAR 56	Arrested? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Driver's License No. 39		Lic. Type OP	Lic. St. Restr.
Color WHITE	Veh. Yr. 96	Make ISUZU	Model Name RODEO 4DR
Veh. Type (enter no.) 1	Lic. Yr. 95	License No.	
Veh. Use (enter no.) 1	Speed Limit 45	Fuel Tax No.	
Direction of Travel E	No Occupants 2	Fire? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	No Axles 2
Towed To		Towed By	
Registered Owner's Name (Last, First, MI)			
Address (Street, City, State, Zip)			
Registered Owner's Name (Last, First, MI)			
Address (Street, City, State, Zip)			
License No.	Make	Year	Lic. St. Lic. Yr.

INITIAL IMPACT		Areas Damaged (Multiples)	
V1 1	V2 2		
DAMAGE EST.		10 - Undercarriage 11 - Trailer 12 - None	
OTHER PROPERTY (INCLUDE CARGO)			
Name of Object	OWNER'S NAME AND ADDRESS		Damage Est. (use chart)

Direction	Street/Highway	Arrested? <input type="checkbox"/> Yes <input type="checkbox"/> No	Apparent Phys. Stat. (enter no.)
What was pedestrian doing before crash? Enter No.			
1. Not in roadway 2. Standing in roadway 3. Playing in roadway 4. Pushing or working on vehicle 5. Other working in roadway 6. Walking in roadway with traffic 7. Walking in roadway against traffic 8. Getting on or off vehicle 9. Crossing or entering not at intersection 10. Crossing or entering at intersection 11. Other			
Pedestrian Traffic Control? <input type="checkbox"/> Yes <input type="checkbox"/> No			

16	17	18	19	20	21	22	23	24	25	26	27	28	29
1 2 1				DRIVER OF VEHICLE 1 (as listed above)	8	11	1	20	2	1	246		
3 1 1				DRIVER OF VEHICLE 2 (as listed above)	6	U		2	1	PENDING			
2	3	3	1	1	2	2	6	U	49	F	1		

Diagram


 Indicate NORTH
arrow

SEE ATTACHED DIAGRAM

NARRATIVE (Refer to Vehicle by Number)

ON 96 AT 9:53PM I WAS SENT TO ASSIST THE COUNTY SHERIFFS DEPT WITH A FATAL CRASH WHEN I ARRIVED DEPUTY ASKED ME TO WORK THE CRASH. MY INITIAL OBSERVATION I OBSERVED TWO VEHICLES. VEHICLE #1 WAS A 1986 GMC TRUCK WITH A CAMPER TOP. THIS VEHICLE WAS IN THE WESTBOUND LANE FACING SOUTH. VEHICLE #2 A 1996 ISUZU RODEO WAS OFF OF THE SOUTH SIDE OF THE ROADWAY IN A GRASSEY AREA FACING NORTHWEST. I WAS ADVISED THAT THERE WAS ONE FEMALE PASSENGER IN VEHICLE #2 THAT WAS DEAD. A FEW MINUTES LATER I WAS ADVISED THAT THE DRIVER OF VEHICLE #2 HAD DIED. THE DRIVER OF VEHICLE #1 WAS TAKEN TO THE HOSPITAL. WHILE EXAMINING THE SCENE I OBSERVED GOUGE MARKS, SCRAPE MARKS AND VEHICLE DEBRIS ON THE SOUTH EDGE OF THE EASTBOUND LANE. THIS INDICATED TO ME THAT VEHICLE #1 WAS LEFT OF CENTER AT THE TIME OF THE ACCIDENT. I THEN CALLED FOR MASTER TROOPER (ACCIDENT RECONSTRUCTIONIST) EXAMINED THE SCENE, TOOK MEASUREMENTS AND TOOK THE HEADLIGHTS FOR EXAMINATION. FROM THE WITNESS STATEMENTS AND THE FINAL REST OF THE VEHICLES,

D1 Insured By				Insured By UNKNOWN			
Other Participant(s) Name, Address (etc.)							
Name of Witness No. 1				Address		Location at Time of Crash BEHIND V-1	
Name of Witness No. 2				Address		Location at Time of Crash BEHIND V-1	
Name of Person Arrested				Name of Person Arrested		I.C. Code(s)	
INVESTIGATION	Time Notified 9:53	AM PM <input checked="" type="checkbox"/> PM	Time Arrived 10:01	AM PM <input checked="" type="checkbox"/> PM	Other Location of Investigation HOSPITAL		Investigation Complete Yes <input checked="" type="checkbox"/> No
	Assisting Officer				ID. No.	Agency SHERIFFS DEPT	Photos Taken <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
	Assisting Officer				ID. No.	Agency STATE POLICE	Driver Report Form Furnished <input checked="" type="checkbox"/> D1 D2
	Investigator				ID. No.	Agency STATE POLICE	

OFFICE USE ONLY

State Form 23558(R3/7-91) Stock 302

Mail to State Police, Crash Records Section

Crash ID No

1	10 ^{Prim}
v1	10
v1	1
v2	
v2	
2	
v1	1
v2	1
3	
v1	1
v1	
v1	
v2	1
v2	
v2	
4	
y0	
v1	
y0	
v2	
5	
v1	
v2	
6	
2	

LOCATION	Date of Crash MONTH <u>11</u> DAY <u>11</u> YEAR <u>96</u>		Day of Week STAURDAY		Actual Local Time <u>9:37</u>		<input checked="" type="checkbox"/> AM <input type="checkbox"/> PM		No Motor Vehicles <u>2</u>		No Injured <u>1</u>		No Dead <u>2</u>		No Trailers <u>0</u>	
	County				Township				City/Town or Nearest City/Town							
	Inside Corporate Limits? Property? <input type="checkbox"/> DNR Distance and Direction From Corporate Limits <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Private <input checked="" type="checkbox"/> Other: _____ Miles North _____ Miles South _____ Miles East <u>6</u> Miles West															
	Road Crash Occurred On				Intersecting Road/Mile Marker/Interchange											
	If not at Intersection number of feet from <u>758ft</u>				Direction <u>E</u>		Nearest Intersecting Road/Mile Marker/Interchange									

DRIVER 1	Driver's Name (Last, First MI) ROBERT L.									
	Address (Street, City, State, Zip)									
	Apparent Phys Stat (enter no.) 2		Sex M	Date of Birth MON, MIN, DAY 70			Arrested? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No			
VEHICLE 1	Driver's License No						Lic Type OP	Lic St	Restr ---	
	Color		Veh Yr	Make		Model Name				
	Veh Type (enter no.)		Lic Yr	License No				Lic State		
TRAILER 1	Veh Use (enter no.)		Speed Limit		Fuel Tax No					
	Direction of Travel		No Occupants		Fire? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	No Axes		Transporting Hazardous Mat <input type="checkbox"/> Yes <input type="checkbox"/> No		
	Towed To				Towed By					
DRIVER 2	Registered Owner's Name (Last, First MI)									
	Address (Street, City, State, Zip)									
	Registered Owner's Name (Last, First MI)									
VEHICLE 2	Address (Street, City, State, Zip)									
	License No		Make		Year		Lic St		Lic Yr	


Driver's Name (Last First MI)									
Address (Street City State Zip)									
DRIVER 2	Apparent Phys Stat (enter no.)		Sex	Date of Birth MONTH DAY		YEAR	Arrested?		
	1		M			56	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		
	Driver's License No						Lic Type	Lic St	Restr
							OP		---
VEHICLE 2	Color		Veh Yr	Make		Model Name			
	Veh Type (enter no.)		Lic Yr	License No				Lic State	
	Veh Use (enter no.)		Speed Limit	Fuel Tax No					
TRAILER 2	Direction of Travel		No Occupants	Fire?	No Axes	Transporting Hazardous Mat			
				<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		<input type="checkbox"/> Yes <input type="checkbox"/> No			
	Towed To			Towed By					
Registered Owner's Name (Last, First, MI)									
Address (Street City State Zip)									
Registered Owner's Name (Last, First, MI)									
Address (Street City State Zip)									
License No			Make		Year		Lic St		Lic Yr

[illegible]

Direction	Street/Highway	Arrested?	Apparent Phys Stat (enter no)
		<input type="checkbox"/> Yes <input type="checkbox"/> No	
What was pedestrian doing before crash?			Enter No
1 Not in roadway 2 Standing in roadway 3 Playing in roadway 4 Pushing or working on vehicle 5 Other working in roadway 6 Walking in roadway with traffic 7 Walking in roadway against traffic 8 Getting on or off vehicle 9 Getting on or off school bus 10 Crossing or entering not at intersection 11 Crossing or entering at intersection 12 Other			
Pedestrian Traffic Control?		<input type="checkbox"/> Yes	<input type="checkbox"/> No

[illegible]

Diagram


 Indicate NORTH
by an arrow

NARRATIVE (Refer to Vehicle by Number)

AND DRIVER #1 STATEMENT, I DETERMINED THAT VEHICLE #1 WAS TRAVELING WEST ON SR.
 ALL FOUR WITNESSES ADVISED THAT VEHICLE #1 PASSED THEM AT A HIGH RATE OF SPEED IN NO PASSING
 ZONES. VEHICLE #1 WAS LEFT OF CENTER AND IN THE EASTBOUND LANE OF SR. GOING AROUND A
 CURVE WHEN IT COLLIDED WITH VEHICLE #2 WHICH WAS EASTBOUND ON SR. VEHICLE #2 WAS ...
 IN THE EASTBOUND LANE WHEN THIS CRASH OCCURED.

D1 Insured By

D2 Insured By
UNKNOWN

Other Participant(s) Name Address (etc.)

Name of Witness No. 1

Address

Location at Time of Crash
BEHIND V-1

Name of Witness No. 2

Address

Location at Time of Crash
BEHIND V-1

Name of Person Arrested

Name of Person Arrested

I.C. Code(s)

Time Notified
9:53AM
☒ PMTime Arrived
10:01AM
☒ PM

Other Location of Investigation

HOSPITAL

Investigation Complete
☒ Yes ☐ NoPhotos Taken
☒ Yes ☐ No

Assisting Officer

I.D. No.

Agency

Date of Report

Assisting Officer

I.D. No.

Agency
STATE POLICEDriver Report
Form Furnished ☒ D1
☐ D2

Investigating Officer's Signature

I.D. No.

Agency
STATE POLICE

INVESTIGATION

DATE: _____ TIME: 2250 LOCATION: SR46 E OF TC
 REFERENCE POINT: FOG LINE 89 FT E. + 39 FT N OF U.P.
 INVESTIGATING: 5365 ASSISTING: 3848, 5889,
 ADDITIONAL: FIRE DET. 10-51

ITEM	NORTH	SOUTH	EAST	WEST	DESCRIPTION
A		5 ⁰		8 ⁴	HEADST ASSEMBLY 1/2 (R) HERE *MELTON ADVISED ME WAS MOVED
B				8 ¹⁰	SKID MARK ON FOG LINE (SHADOW FINE FROM TRK LID)
C				13 ⁴	SMALL GLASS LENS PIECE
D				16 ²¹	SKID FROM "B" MOVES E W
E				14 ⁰	2ND SKID VISIBLE
F	1 ⁷			21 ³¹	SKIDS "B" + "E" CROSS
G	2 ⁹			24 ²¹	1/2 MOON SCAL N TO S 0 ¹¹ LONG
H	2 ⁹			26	SCRATCH STARTS
I	2 ²			27	SCRATCH ENDS
J				31 ⁵¹	SKID MARKS CROSS FOG LINE 1/2
K	4 ⁰			36 ⁴	SCRATCH STARTS
L	4 ³			37 ⁵¹	PARALLEL SCRATCH STARTS
M	4 ⁴			40 ⁰	SCRATCH "L" ENDS
N	4 ⁷			40 ⁰	SCRATCH "K" ENDS

ITEM	NORTH	SOUTH	EAST	WEST	DESCRIPTION
O		10 ⁷		36 ⁴	RF #2
P		20 ¹		31 ¹⁰	RR #2
Q	4 ⁶			48 ⁷	SCRATCH SPARKS
R	6 ⁴			63	SCRATCH CONT. + BEADS TO V-1 (middle)
S	23 ⁹			69 ⁶	LR #1
T	16 ⁵			70 ⁴	LF #1
U		8		28	G. RAIL ENDS
V		3 ⁸		29 ⁵	FURROW V-2
W		9 ⁶		31 ⁴	FURROW V-2 UNDER CAR
X		2 ¹¹		25 ³	"HORN?" EXH. PIECE V-1
Y		5 ¹⁰		40 ⁷	WHEEL RIM V-2
Z		5 ¹⁰		27 ⁶	" " " "
AA		8 ⁷		54	TIRE JACK V-1
BB				58	GEAR SHIFT LEVER
CC				20	WHITE FRECKLES

S.R. EAST OF
CAUSING DEATH
TWP.

-96

○ ALUMINUM
WHEEL RING V-2

ISUZU
2

FURROWS
V-2

○ ALUMINUM
WHEEL RING V-2

TIRE JACK
V-1

○ RIGHT HLT ASSMOLEY
V-2

○ HORN V-1

GEAR SHIFT
LEVER V1

SKID ↑ GLASS
PIECE
LENS

GMC
1

0 5 10
FEET

INVESTIGATED BY:
TRP. 5362
MEASURED BY:
TRP. 5889
M/TRP. 38YE

TRANSPORTATION RESEARCH CENTER

**Indiana University
Bloomington, Indiana 47403-1599**

ON-SITE AIR BAG INVESTIGATION

NASS CDS FORMS AND MEDICAL RECORDS

**CASE NO. - 96-16
FLEET - PRIVATE VEHICLE
LOCATION -
ACCIDENT DATE 1996**

Submitted By:

**Research Scientist
and**

Associate Scientist

1996

Revised Submission:

2000

Contract Number:

Prepared for:

**U.S. Department of Transportation
National Highway Traffic Safety Administration
National Center for Statistics and Analysis
Washington, D.C. 20590-0003**



ACCIDENT FORM

1. Primary Sampling Unit Number 10

2. Case Number - Stratum 9616

IDENTIFICATION

3. Number of General Vehicle
Forms Submitted 02

4. Date of Accident
(Month, Day, Year) 196

5. Time of Accident 2137

Code reported military time of accident.

NOTE: Midnight = 2400
Unknown = 9999

SPECIAL STUDIES - INDICATORS

Check (✓) each special study (SS15-SS18 below) that has been completed; code 1 for the checked special studies and 0 for the special studies not checked.

6. 0 SS15 Administrative Use

7. 0 SS16 Pedestrian Crash Data Study
(Data for this special study available
in a separate file.)

8. 0 SS17 Impact Fires

9. 0 SS18 Unsafe Driver Actions

10. 0 SS19 Run Off Road

NUMBER OF EVENTS

11. Number of Recorded Events
in This Accident 01

Code the number of events which occurred
in this accident.

ACCIDENT EVENTS

For each event that occurred in the accident, code the lowest numbered vehicle in the left columns and the other involved vehicle or object in the right columns.

Accident Event Sequence Number	Vehicle Number	Class Of Vehicle	General Area of Damage	Vehicle Number or Object Contacted	Class Of Vehicle	General Area of Damage
12. <u>01</u>	13. <u>01</u>	14. <u>14</u>	15. <u>F</u>	16. <u>02</u>	17. <u>31</u>	18. <u>F</u>
19. <u>02</u>	20. <u> </u>	21. <u> </u>	22. <u> </u>	23. <u> </u>	24. <u> </u>	25. <u> </u>
26. <u>03</u>	27. <u> </u>	28. <u> </u>	29. <u> </u>	30. <u> </u>	31. <u> </u>	32. <u> </u>
33. <u>04</u>	34. <u> </u>	35. <u> </u>	36. <u> </u>	37. <u> </u>	38. <u> </u>	39. <u> </u>
40. <u>05</u>	41. <u> </u>	42. <u> </u>	43. <u> </u>	44. <u> </u>	45. <u> </u>	46. <u> </u>

IF GREATER THAN FIVE EVENTS, CONTINUE CODING ON THE ACCIDENT EVENT SUPPLEMENT

CODES FOR CLASS OF VEHICLE

- | | |
|--|---|
| <ul style="list-style-type: none"> (00) Not a motor vehicle (01) Subcompact/mini (wheelbase < 254 cm) (02) Compact (wheelbase ≥ 254 but < 265 cm) (03) Intermediate (wheelbase ≥ 265 but < 278 cm) (04) Full size (wheelbase ≥ 278 but < 291 cm) (05) Largest (wheelbase ≥ 291 cm) (09) Unknown passenger car size (14) Compact utility vehicle (15) Large utility vehicle (≤ 4,536 kgs GVWR) (16) Utility station wagon (≤ 4,536 kgs GVWR) (19) Unknown utility type (20) Minivan (≤ 4,536 kgs GVWR) (21) Large van (≤ 4,536 kgs GVWR) (24) Van Based school bus (≤ 4,536 kgs GVWR) (28) Other van type (≤ 4,536 kgs GVWR) (29) Unknown van type (≤ 4,536 kgs GVWR) (30) Compact pickup truck (≤ 4,536 kgs GVWR) | <ul style="list-style-type: none"> (31) Large pickup truck (≤ 4,536 kgs GVWR) (38) Other pickup truck (≤ 4,536 kgs GVWR) (39) Unknown pickup truck type (≤ 4,536 kgs GVWR) (45) Other light truck (≤ 4,536 kgs GVWR) (48) Unknown light truck type (≤ 4,536 kgs GVWR) (49) Unknown light vehicle type (50) School bus (excludes van based)(>4,536 kgs GVWR) (58) Other bus (> 4,536 kgs GVWR) (59) Unknown bus type (60) Truck (> 4,536 kgs GVWR) (67) Tractor without trailer (68) Tractor-trailer(s) (78) Unknown medium/heavy truck type (79) Unknown light/medium/heavy truck type (80) Motored cycle (90) Other vehicle (99) Unknown |
|--|---|

CODES FOR GENERAL AREA OF DAMAGE (GAD)

- | | | | |
|--|--|---|---|
| CDS APPLICABLE
AND OTHER
VEHICLES | <ul style="list-style-type: none"> (O) Not a motor vehicle (N) Noncollision (F) Front | <ul style="list-style-type: none"> (R) Right side (L) Left side (B) Back | <ul style="list-style-type: none"> (T) Top (U) Undercarriage (9) Unknown |
|--|--|---|---|
-
- | | | | |
|--|--|---|---|
| TDC
APPLICABLE
VEHICLES | <ul style="list-style-type: none"> (O) Not a motor vehicle (N) Noncollision (F) Front (R) Right side | <ul style="list-style-type: none"> (L) Left side (B) Back of unit with cargo area
(rear of trailer or straight truck) (D) Back (rear of tractor) | <ul style="list-style-type: none"> (C) Rear of cab (V) Front of cargo area (T) Top (U) Undercarriage (9) Unknown |
|--|--|---|---|

CODES FOR VEHICLE NUMBER OR OBJECT CONTACTED

- | | |
|---|--|
| <p>(01-30) — Vehicle Number</p> <p>Noncollision</p> <ul style="list-style-type: none"> (31) Overturn — rollover (excludes end-over-end) (32) Rollover — end-over-end (33) Fire or explosion (34) Jackknife (35) Other intraunit damage (specify): _____ (36) Noncollision injury (38) Other noncollision (specify): _____ (39) Noncollision — details unknown <p>Collision With Fixed Object</p> <ul style="list-style-type: none"> (41) Tree (≤ 10 cm in diameter) (42) Tree (> 10 cm in diameter) (43) Shrubbery or bush (44) Embankment (45) Breakaway pole or post (any diameter) <p>Nonbreakaway Pole or Post</p> <ul style="list-style-type: none"> (50) Pole or post (≤ 10 cm in diameter) (51) Pole or post (> 10 cm but ≤ 30 cm in diameter) (52) Pole or post (> 30 cm in diameter) (53) Pole or post (diameter unknown) (54) Concrete traffic barrier (55) Impact attenuator (56) Other traffic barrier (includes guardrail)
(specify): _____ | <ul style="list-style-type: none"> (57) Fence (58) Wall (59) Building (60) Ditch or culvert (61) Ground (62) Fire hydrant (63) Curb (64) Bridge (68) Other fixed object (specify): _____ (69) Unknown fixed object <p>Collision with Nonfixed Object</p> <ul style="list-style-type: none"> (70) Passenger car, light truck, van, or other vehicle
not in-transport (71) Medium/heavy truck or bus not in-transport (72) Pedestrian (73) Cyclist or cycle (74) Other nonmotorist or conveyance (75) Vehicle occupant (76) Animal (77) Train (78) Trailer, disconnected in transport (79) Object fell from vehicle in-transport (88) Other nonfixed object (specify): _____ (89) Unknown nonfixed object (98) Other event (specify): _____ (99) Unknown event or object |
|---|--|



U.S. Department of Transportation
National Highway Traffic Safety
Administration

ACCIDENT COLLISION MEASUREMENT TABLE

BEST AVAILABLE

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

Primary Sampling Unit Number 10

Case Number—Stratum 9616

ACCIDENT COLLISION DIAGRAM

Document the physical plant:

- all road/roadway delineation (e.g., curbs/edge lines, lane markings, median markings, pavement markings, parked vehicles, poles, signs, etc.)
- all traffic controls (e.g., signs/signals, etc.)
- north arrow placed on diagram
- roadway surface type and condition of applicable roadways
- grade measurements for all applicable roadways and at location of rollover initiation
- roadway curvature (include measurement of precrash superelevation for each vehicle if applicable)

Document vehicle dynamics including:

- reference point and reference line relative to physical features present at the scene
- scaled documentation of all accident induced physical evidence
- scaled documentation of all roadside objects contacted
- scaled representations of the vehicle(s) at pre-impact, impact, and final rest based upon either:
 - a) physical evidence, or
 - b) reconstructed accident dynamics

CRASH DATA


	VEH. #1	VEH. #2	VEH. #3
Heading Angle	<u>090</u>	<u>245</u>	___
Surface Type	<u>ASPHALT</u>	<u>ASPHALT</u>	___
Surface Condition	<u>TRAVELED</u>	<u>TRAVELED</u>	___
Coefficient of Friction	<u>0.75</u>	<u>0.75</u>	___
Grade (v/h) Measurement (between impact and final rest)	<u>-2.9%</u>	<u>+2.9%</u>	___
Grade (v/h) Measurement (at location of rollover initiation)	___	___	___
Grade (v/h) Measurement (at pre-crash location)	___	___	___


Reference Point: FIRST VISIBLE

Reference line: RL1 SOUTH FOG LINE
RL2 NORTH FOG LINE

Item	Distance and Direction from Reference Point	Distance and Direction from Reference Line
<u>ICP</u>	<u>00</u>	<u>3.35M S OF RL1</u>
<u>SOUTH SHOULDER AT ICP - PAVED</u>	<u>00</u>	<u>0.7M S OF RL1</u>
<u>GRAVEL</u>	<u>00</u>	<u>1.35M S OF RL1</u>
<u>ROAD WIDTH AT ICP TO CENTERLINE</u>	<u>00</u>	<u>3.8M N OF RL1</u>
<u>TO N FOG LINE</u>	<u>00</u>	<u>7.4M N OF RL1</u>
<u>PAVED SHOULDER</u>	<u>00</u>	<u>0.8M N OF RL2</u>
<u>GRAVEL SHOULDER</u>	<u>00</u>	<u>1.3M N OF RL2</u>

[illegible]

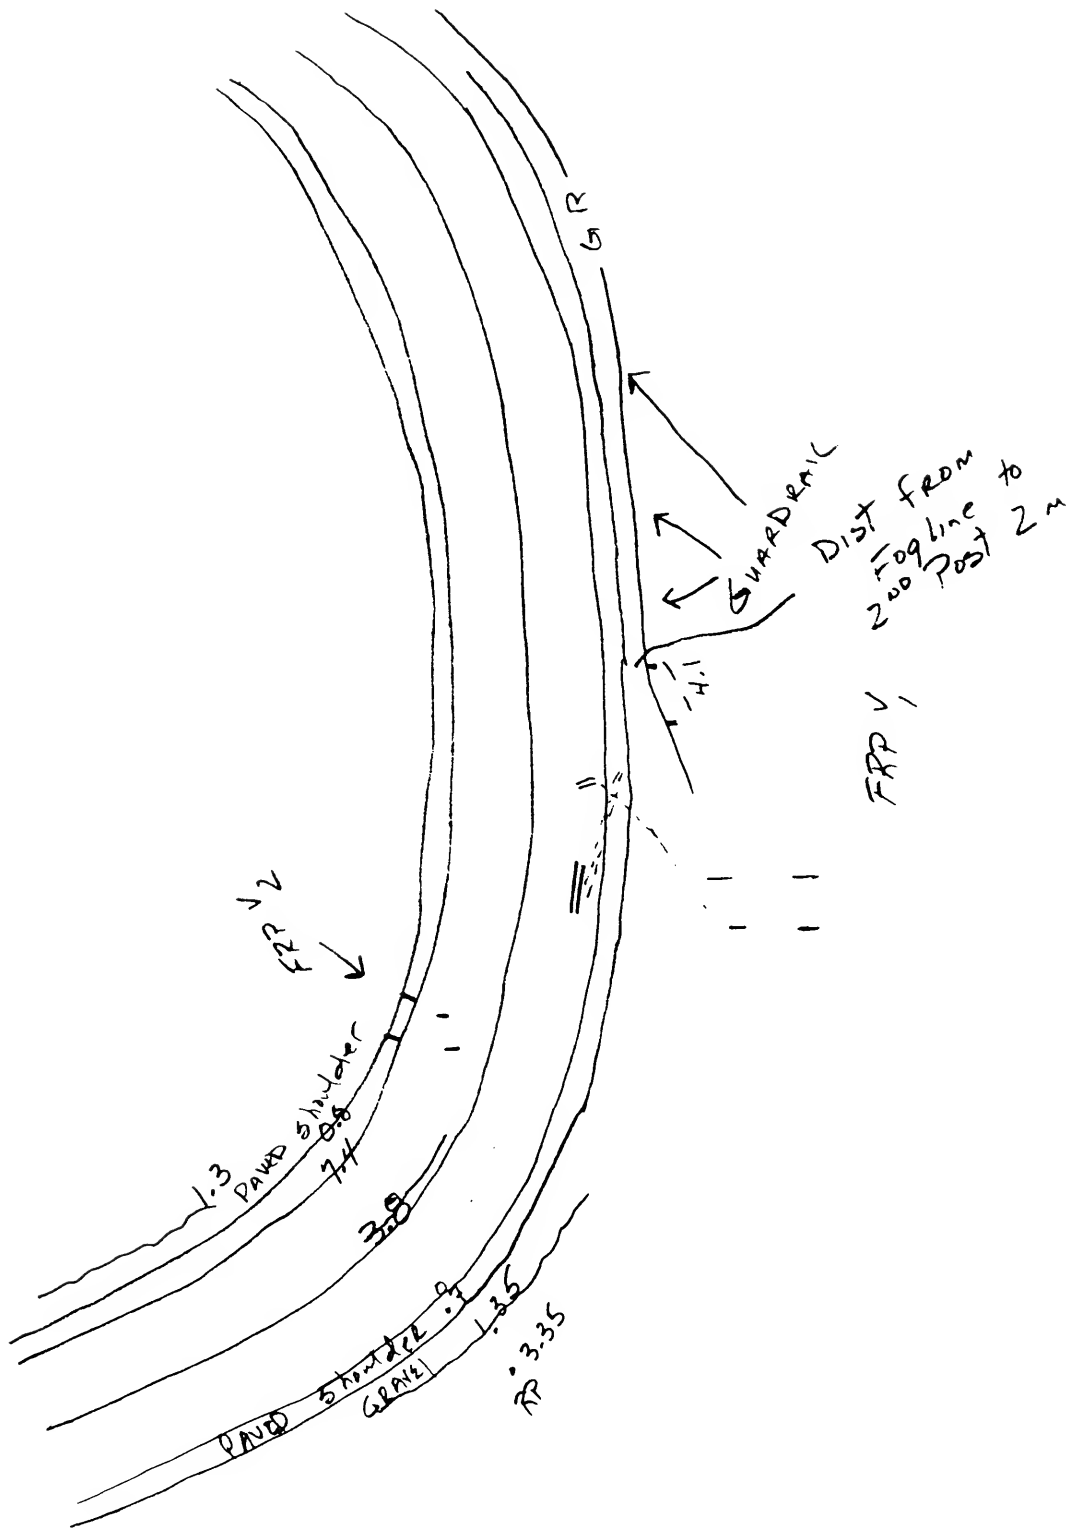

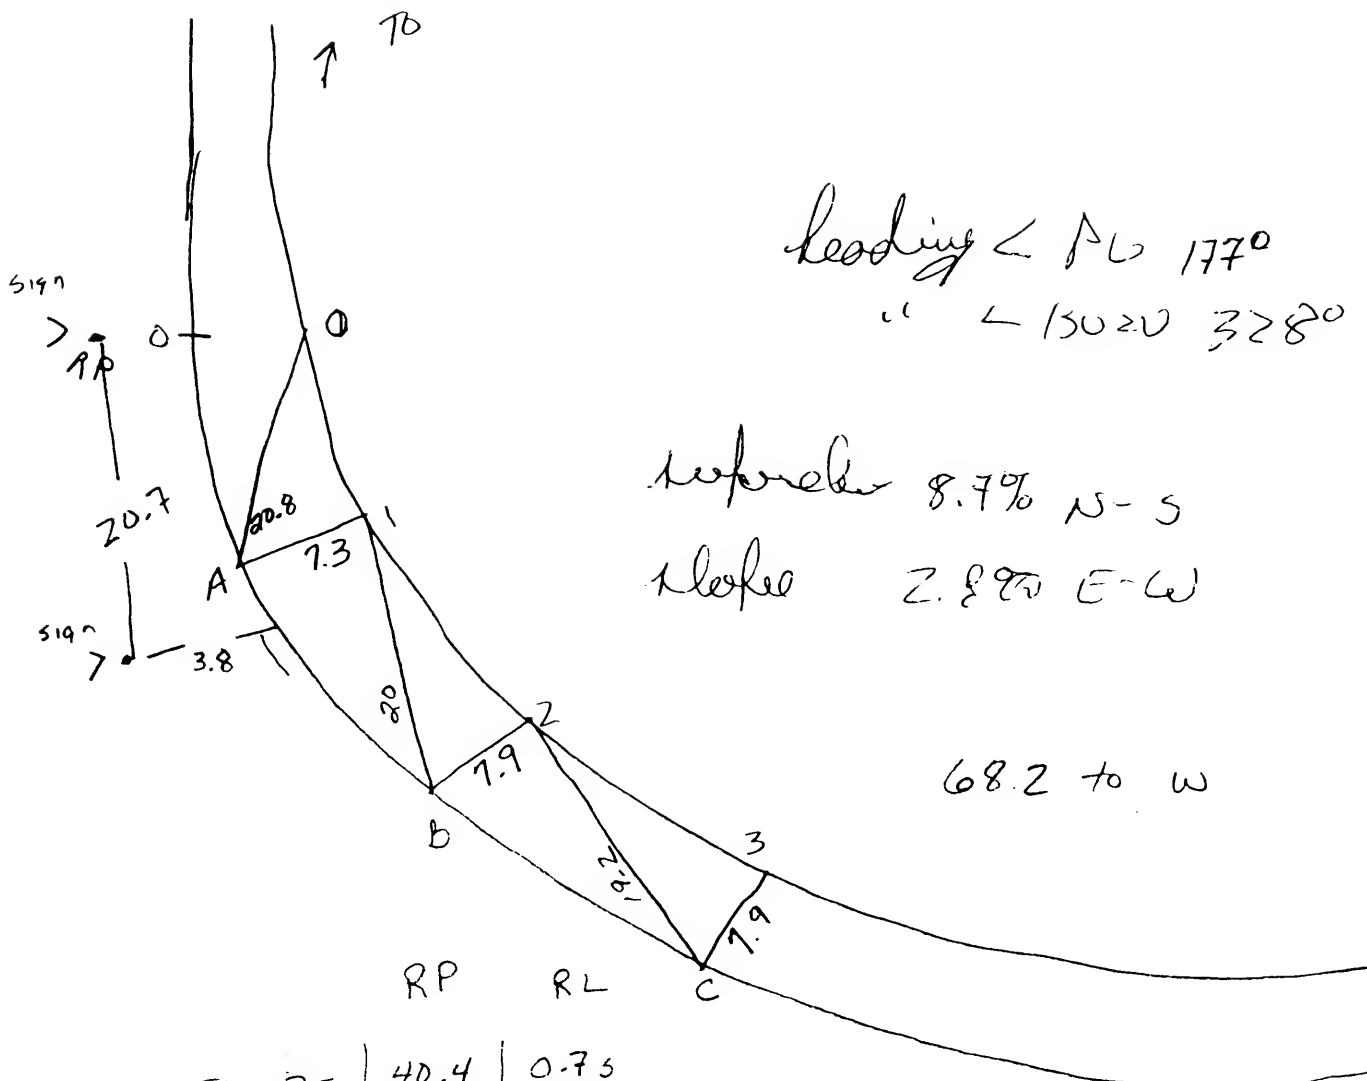

END RF	40.4	0.75
Deviation	39.5	0.45
E Gauge	39.1573	0.3 - 0.6 N
START LF	SAME	SAME
BEG GR	37.9E	2.45
START RF	35.7E	2.10
FRP LR	34.8E	6.75
RR	36.4	6.15
LF	34.5E	4.25
RF		
Gauge	34.3-35.3	1.3 .1 apart
FRP LR	24.3	.3 N
RR	22.7	.4 N
LF	23.6	2.1
RF		

1st GR I BEAM RP 378

END LF (MID) 363

@ RR FRP PRE RF .15
POST LF 1.95

PRF 0.35
bst LF 0.85

CV

WV

NASS CDS VEHICLE FORMS: CASE VEHICLE



GENERAL VEHICLE FORM

1. Primary Sampling Unit Number 10
2. Case Number - Stratum 9616
3. Vehicle Number 01

VEHICLE IDENTIFICATION

4. Vehicle Model Year 95
Code the last two digits of the model year
(99) Unknown
5. Vehicle Make (specify): 38
ISUZU
Applicable codes are found in your
NASS Data Collection, Coding and
Editing Manual.
(99) Unknown
6. Vehicle Model (specify): 402
COLEO LWB
Applicable codes are found in your
NASS Data Collection, Coding and
Editing Manual.
(999) Unknown
7. Body Type 14
Note: Applicable codes may be found on
the back of this page.
8. Vehicle Identification Number 4SZCM58V8S4
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17
Left justify; Slash zeros and letter Z (0 and Z)
No VIN—Code all zeros
Unknown—Code all nines
9. Vehicle Special Use (This Trip) 0
(0) No special use
(1) Taxi
(2) Vehicle used as school bus
(3) Vehicle used as other bus
(4) Military
(5) Police
(6) Ambulance
(7) Fire truck or car
(8) Other (specify): _____
(9) Unknown

OFFICIAL RECORDS

10. Police Reported Vehicle Disposition 1
(0) Not towed due to vehicle damage
(1) Towed due to vehicle damage
(9) Unknown
11. Police Reported Travel Speed 999
Code to the nearest kmph (NOTE: 000 means
less than 0.5 kmph)
(160) 159.5 kmph and above
(999) Unknown

___ mph X 1.6093 = ___ kmph

12. Speed Limit 072
(000) No statutory limit
Code posted or statutory speed limit in kmph
(999) Unknown

45 mph X 1.6093 = 072 kmph

13. Police Reported Alcohol Presence For Driver 9
(0) No alcohol present
(1) Yes alcohol present
(7) Not reported
(8) No driver present
(9) Unknown
14. Alcohol Test Result For Driver 03
Code actual value (decimal implied
before first digit—0.xx) 0.034
(95) Test refused
(96) None given
(97) AC test performed, results unknown
(98) No driver present
(99) Unknown

Source: _____

15. Police Reported Other Drug Presence For Driver 1
(0) No other drug(s) present
(1) Yes other drug(s) present
(7) Not reported
(8) No driver present
(9) Unknown
16. Other Drug Specimen Test Result For Driver 2
(0) No specimen test given
(1) Drug(s) not found in specimen
(2) Drug(s) found in specimen, (specify):
CAFFEINE
(3) Specimen test given, results unknown or not
obtained
(8) No driver present
(9) Unknown if specimen test given

17. Driver's Zip Code _____
(00001) Driver not a resident of U.S. or territories
47401 Code actual 5-digit zip code
(99998) No driver present
(99999) Unknown

18. Driver's Race/Ethnic Origin 1
(1) White (non-Hispanic)
(2) Black (non-Hispanic)
(3) White (Hispanic)
(4) Black (Hispanic)
(5) American Indian, Eskimo or Aleut
(6) Asian or Pacific Islander
(7) Other (specify): _____
(8) No driver present
(9) Unknown

CODES FOR BODY TYPE

CDS APPLICABLE VEHICLES

Automobiles

- (01) Convertible (excludes sun-roof, t-bar)
- (02) 2-door sedan, hardtop, coupe
- (03) 3-door/2-door hatchback
- (04) 4-door sedan, hardtop
- (05) 5-door/4-door hatchback
- (06) Station wagon (excluding van and truck based)
- (07) Hatchback, number of doors unknown
- (08) Other automobile type (specify): _____

- (09) Unknown automobile type

Automobile Derivatives

- (10) Auto based pickup (includes El Camino, Caballero, Ranchero, Brat, and Rabbit pickup)
- (11) Auto based panel (cargo station wagon, auto based ambulance/hearse)
- (12) Large limousine - more than four side doors or stretched chassis
- (13) Three-wheel automobile or automobile derivative

Utility Vehicles ($\leq 4,536$ kgs GVWR)

- (14) Compact utility (Jeep CJ-2 - CJ-7, Scrambler, Golden Eagle, Renegade, Laredo, Wrangler, Cherokee [84 and after], Dispatcher, Raider, Bronco II, Bronco [76 and before], Explorer, S-10 Blazer, Geo Tracker, Bravada, S-15 Jimmy, Thing, Pathfinder, Trooper, Trooper II, Rodeo, Amigo, Navajo, 4-Runner, Montero, Passport, Samurai, Sidekick, Rocky)
- (15) Large utility (includes Jeep Cherokee [83 and before], Ramcharger, Trailduster, Bronco-fullsize [78 and after], fullsize Blazer, fullsize Jimmy, Hummer, Landcruiser, Rover, Scout, Yukon)
- (16) Utility station wagon (Chevy Suburban, GMC Suburban, Travelall, Grand Wagoneer, includes suburban limousine)
- (19) Utility, unknown body type

Van Based Light Trucks ($\leq 4,536$ kgs GVWR)

- (20) Minivan (Town and Country, Caravan, Grand Caravan, Voyager, Grand Voyager, Mini-Ram, Vista, Aerostar, Windstar, Villager, Lumina APV, Trans Sport, Silhouette, Astro, Safari, Toyota Van, Toyota Minivan, Previa, Nissan Minivan, Quest, Mitsubishi Minivan, Expo Wagon, Vanagon/Camper.)
- (21) Large van (B150-B350, Sportsman, Royal, Maxiwagon, Ram, Tradesman, Voyager [83 and before], E150-E350, Econoline, Clubwagon, Chateau, G10-G30, Chevy Van, Beauville, Sport Van, G15-G35, Rally Van, Vandura.)
- (22) Step van or walk-in van ($\leq 4,536$ kgs GVWR)
- (23) Van based motorhome ($\leq 4,536$ kgs GVWR)
- (24) Van based school bus ($\leq 4,536$ kgs GVWR)
- (25) Van based other bus ($\leq 4,536$ kgs GVWR)
- (28) Other van type (Hi-Cube Van, Kary) (specify): _____

- (29) Unknown van type

Light Conventional Trucks (Pickup style cab, $\leq 4,536$ kgs GVWR)

- (30) Compact pickup (D50, Colt P/U, Ram 50, Dakota, Arrow Pickup [foreign], Ranger, Courier, S-10, T-10, LUV, S-15, T-15, Sonoma, Datsun/Nissan Pickup, P'up, Mazda Pickup, Toyota Pickup, Mitsubishi Pickup)
- (31) Large Pickup (Jeep Pickup, Comanche, Ram Pickup, D100-D350, W100-W350, F100-F350, C10-C35, K10-K35, R10-R35, V10-V35, Silverado, Sierra, R100-R500, T100)
- (32) Pickup with slide-in camper
- (33) Convertible pickup
- (39) Unknown pickup style light conventional truck type

Other Light Trucks ($\leq 4,536$ kgs GVWR)

- (40) Cab chassis based (includes rescue vehicles, light stake, dump, and tow truck)
- (41) Truck based panel
- (42) Light truck based motorhome (chassis mounted)
- (45) Other light conventional truck type
- (48) Unknown light truck type
- (49) Unknown light vehicle type (automobile, utility, van, or light truck)

OTHER VEHICLES

Buses (Excludes Van Based)

- (50) School bus (designed to carry students, not cross country or transit)
- (58) Other bus type (e.g., transit, intercity, bus based motorhome) (specify): _____
- (59) Unknown bus type

Medium/Heavy Trucks ($> 4,536$ kgs GVWR)

- (60) Step van ($> 4,536$ kgs GVWR)
- (61) Single unit straight truck ($4,536$ kgs $<$ GVWR $\leq 8,845$ kgs)
- (62) Single unit straight truck ($8,845$ kgs $<$ GVWR $\leq 11,793$ kgs)
- (63) Single unit straight truck ($> 11,793$ kgs GVWR)
- (64) Single unit straight truck, GVWR unknown
- (65) Medium/heavy truck based motorhome
- (67) Truck-tractor with no cargo trailer
- (68) Truck-tractor pulling one trailer
- (69) Truck-tractor pulling two or more trailers
- (70) Truck-tractor (unknown if pulling trailer)
- (78) Unknown medium/heavy truck type
- (79) Unknown truck type (light/medium/heavy)

Motored Cycles (Does Not Include All-Terrain Vehicles/Cycles)

- (80) Motorcycle
- (81) Moped (motorized bicycle)
- (82) Three-wheel motorcycle or moped
- (88) Other motored cycle (minibike, motorscooter) (specify): _____
- (89) Unknown motored cycle type

Other Vehicles

- (90) ATV (All-Terrain Vehicle) and ATC (All-Terrain Cycle)
- (91) Snowmobile
- (92) Farm equipment other than trucks
- (93) Construction equipment other than trucks
- (97) Other vehicle type
- (99) Unknown body type

PRECRAASH ENVIRONMENTAL DATA

19. Relation To Interchange Or Junction 0
 (0) Non-interchange area and non-junction
 (1) Interchange area related

Non-Interchange junctions

- (2) Intersection related
 (3) Driveway, alley access related
 (4) Other junction (specify) _____

(5) Unknown type of junction _____

(9) Unknown

20. Trafficway Flow 0
 (0) Not physically divided (two way traffic)
 (1) Divided trafficway-median strip without positive barrier
 (2) Divided trafficway-median strip with positive barrier
 (3) One way traffic
 (9) Unknown

21. Number Of Travel Lanes 2
 (1) One
 (2) Two
 (3) Three
 (4) Four
 (5) Five
 (6) Six
 (7) Seven or more
 (9) Unknown

22. Roadway Alignment 3
 (1) Straight
 (2) Curve right
 (3) Curve left
 (9) Unknown

23. Roadway Profile 4
 (1) Level
 (2) Uphill grade (> 2%)
 (3) Hill crest
 (4) Downhill grade (> 2%)
 (5) Sag
 (9) Unknown

24. Roadway Surface Type 2
 (1) Concrete
 (2) Bituminous (asphalt)
 (3) Brick or block
 (4) Slag, gravel, or stone
 (5) Dirt
 (8) Other (specify): _____
 (9) Unknown

25. Roadway Surface Condition 2

- (1) Dry
 (2) Wet
 (3) Snow or slush
 (4) Ice
 (5) Sand, dirt, or oil
 (8) Other (specify): _____
 (9) Unknown

26. Light Conditions 2

- (1) Daylight
 (2) Dark
 (3) Dark, but lighted
 (4) Dawn
 (5) Dusk
 (9) Unknown

27. Atmospheric Conditions 0

- (0) No adverse atmospheric-related driving conditions
 (1) Rain
 (2) Sleet/hail
 (3) Snow
 (4) Fog
 (5) Rain and fog
 (6) Sleet and fog
 (7) Other (e.g., smog, smoke, blowing sand or dust, etc.) (specify): _____
 (9) Unknown

28. Traffic Control Device 6

- (0) No traffic control(s)
 (1) Traffic control signal (not RR crossing)

Regulatory

- (2) Stop sign
 (3) Yield sign
 (4) School zone sign
 (5) Other regulatory sign (specify): _____

- (6) Warning sign (not RR crossing)
 (7) Unknown sign
 (8) Miscellaneous/other controls including RR controls (specify): _____

(9) Unknown

29. Traffic Control Device Functioning 2

- (0) No traffic control device
 (1) Traffic control device not functioning (specify): _____
 (2) Traffic control device functioning properly
 (9) Unknown

PRECRASH DRIVER RELATED DATA

30. Driver's Distraction/Inattention To Driving 9 9
 (Prior To Recognition Of Critical Event)
 (00) No driver present
 (01) Attentive or not distracted
 (02) Looked but did not see
Distractions
 (03) By other occupant(s), (specify): _____
 (04) By moving object in vehicle (specify): _____
 (05) While talking or listening to cellular phone (specify location and type of phone): _____
 (06) While dialing cellular phone (specify location and type of phone): _____
 (07) While adjusting climate controls
 (08) While adjusting radio, cassette, CD (specify): _____
 (09) While using other device/controls integral to vehicle (specify): _____
 (10) While using or reaching for device/object brought into vehicle (specify): _____
 (11) Sleepy or fell asleep
 (12) Distracted by outside person, object, or event (specify): _____
 (13) Eating or drinking
 (14) Smoking related
 (97) Distracted/inattentive, details unknown
 (98) Other, distraction (specify): _____
 (99) Unknown

31. Pre-Event Movement (Prior to Recognition of Critical Event) 1 4
 (00) No driver present
 (01) Going straight
 (02) Decelerating in traffic lane
 (03) Accelerating in traffic lane
 (04) Starting in traffic lane
 (05) Stopped in traffic lane
 (06) Passing or overtaking another vehicle
 (07) Disabled or parked in travel lane
 (08) Leaving a parking position
 (09) Entering a parking position
 (10) Turning right
 (11) Turning left
 (12) Making a U-turn
 (13) Backing up (other than for parking position)
 (14) Negotiating a curve
 (15) Changing lanes
 (16) Merging
 (17) Successful avoidance maneuver to a previous critical event
 (97) Other (specify): _____
 (99) Unknown

32. Critical Precrash Event 5 4
THIS VEHICLE LOSS OF CONTROL DUE TO:
 (01) Blow out or flat tire
 (02) Stalled engine
 (03) Disabling vehicle failure (e.g., wheel fell off) (specify): _____
 (04) Non-disabling vehicle problem (e.g., hood flew up) (specify): _____
 (05) Poor road conditions (puddle, pot hole, ice, etc.) (specify): _____
 (06) Traveling too fast for conditions
 (08) Other cause of control loss (specify): _____
 (09) Unknown cause of control loss

THIS VEHICLE TRAVELLING

- (10) Over the lane line on left side of travel lane
 (11) Over the lane line on right side of travel lane
 (12) Off the edge of the road on the left side
 (13) Off the edge of the road on the right side
 (14) End departure
 (15) Turning left at intersection
 (16) Turning right at intersection
 (17) Crossing over (passing through) intersection
 (18) This vehicle decelerating
 (19) Unknown travel direction

OTHER MOTOR VEHICLE IN LANE

- (50) Other vehicle stopped
 (51) Traveling in same direction with lower steady speed
 (52) Traveling in same direction while decelerating
 (53) Traveling in same direction with higher speed
 (54) Traveling in opposite direction
 (55) In crossover
 (56) Backing
 (59) Unknown travel direction of other motor vehicle in lane

OTHER MOTOR VEHICLE ENCROACHING INTO LANE

- (60) From adjacent lane (same direction)—over left lane line
 (61) From adjacent lane (same direction)—over right lane line
 (62) From opposite direction—over left lane line
 (63) From opposite direction—over right lane line
 (64) From parking lane
 (65) From crossing street, turning into same direction
 (66) From crossing street, across path
 (67) From crossing street, turning into opposite direction
 (68) From crossing street, intended path not known
 (70) From driveway, turning into same direction
 (71) From driveway, across path
 (72) From driveway, turning into opposite direction
 (73) From driveway, intended path not known
 (74) From entrance to limited access highway
 (78) Encroachment by other vehicle—details unknown

PEDESTRIAN, PEDALCYCLIST, OR OTHER NONMOTORIST

- (80) Pedestrian in roadway
 (81) Pedestrian approaching roadway
 (82) Pedestrian—unknown location
 (83) Pedalcyclist or other nonmotorist in roadway (specify): _____
 (84) Pedalcyclist or other nonmotorist approaching roadway, (specify): _____
 (85) Pedalcyclist or other nonmotorist—unknown location (specify): _____

OBJECT OR ANIMAL

- (87) Animal in roadway
 (88) Animal approaching roadway
 (89) Animal—unknown location
 (90) Object in roadway
 (91) Object approaching roadway
 (92) Object—unknown location
 (98) Other critical precrash event (specify): _____
 (99) Unknown

33. Attempted Avoidance Maneuver 09

- (00) No driver present
- (01) No avoidance maneuver
- (02) Braking (no lockup)
- (03) Braking (lockup)
- (04) Braking (lockup unknown)
- (05) Releasing brakes
- (06) Steering left
- (07) Steering right
- (08) Braking and steering left
- (09) Braking and steering right
- (10) Accelerating
- (11) Accelerating and steering left
- (12) Accelerating and steering right
- (98) Other action (specify): _____

(99) Unknown

34. Pre-Impact Stability 2

- (0) No driver present
- (1) Tracking
- (2) Skidding longitudinally—rotation less than 30 degrees
- (3) Skidding laterally—clockwise rotation
- (4) Skidding laterally—counterclockwise rotation
- (7) Other vehicle loss-of-control (specify): _____

(9) Precrash stability unknown

35. Pre-Impact Location 4

- (0) No driver present
- (1) Stayed in original travel lane
- (2) Stayed on roadway but left original travel lane
- (3) Stayed on roadway, not known if left original travel lane
- (4) Departed roadway
- (5) Remained off roadway
- (6) Returned to roadway
- (7) Entered roadway
- (9) Unknown








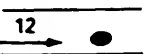

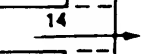













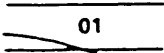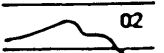





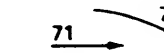
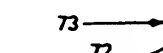
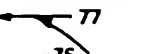
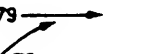
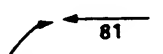
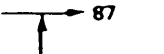

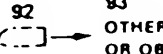

36. Accident Type 51

(Note: Applicable codes on back of this page)

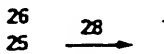- (00) No impact
Code the number of the diagram that best describes the accident circumstance
- (98) Other accident type (specify): _____

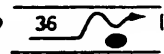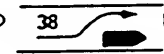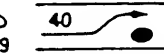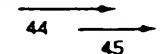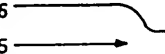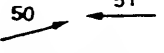(99) Unknown

STOP HERE IF GV07 DOES NOT EQUAL 01 - 49

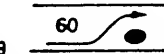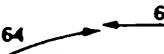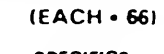Category	Configuration	ACCIDENT TYPES (Includes Intent)				
I Single Driver	A Right Roadside Departure	 01 DRIVE OFF ROAD	 02 CONTROL/ TRACTION LOSS	 03 AVOID COLLISION WITH VEH., PED., ANIM.	04 SPECIFICS OTHER	05 SPECIFICS UNKNOWN
	B Left Roadside Departure	 06 DRIVE OFF ROAD	 07 CONTROL/ TRACTION LOSS	 08 AVOID COLLISION WITH VEH., PED., ANIM.	09 SPECIFICS OTHER	10 SPECIFICS UNKNOWN
	C Forward Impact	 11 PARKED VEH.	 12 STA. OBJECT	 13 PEDESTRIAN/ ANIMAL	 14 END DEPARTURE	15 SPECIFICS OTHER 16 SPECIFICS UNKNOWN
II Same Trafficway Same Direction	D Rear-End	 20 STOPPED 21, 22, 23	 22 SLOWER 25, 26, 27	 24 DECEL. 29, 30, 31	 26 AVOID COLLISION WITH VEH.	(EACH • 32) SPECIFICS OTHER (EACH • 33) SPECIFICS UNKNOWN
	E Forward Impact	 34 CONTROL/ TRACTION LOSS	 36 CONTROL/ TRACTION LOSS	 38 AVOID COLLISION WITH VEH.	 40 AVOID COLLISION WITH OBJECT	(EACH • 42) SPECIFICS OTHER (EACH • 43) SPECIFICS UNKNOWN
	F Sideswipe Angle	 44 45	 46 45 47	(EACH • 48) SPECIFICS OTHER	(EACH • 49) SPECIFICS UNKNOWN	
III Same Trafficway Opposite Direction	G Head-On	 50 LATERAL MOVE	 51 (EACH • 52) SPECIFICS OTHER	(EACH • 53) SPECIFICS UNKNOWN		
	H Forward Impact	 54 CONTROL/ TRACTION LOSS	 56 CONTROL/ TRACTION LOSS	 58 AVOID COLLISION WITH VEH.	 60 AVOID COLLISION WITH OBJECT	(EACH • 62) SPECIFICS OTHER (EACH • 63) SPECIFICS UNKNOWN
	I Sideswipe Angle	 64 LATERAL MOVE	 65 (EACH • 66) SPECIFICS OTHER	(EACH • 67) SPECIFICS UNKNOWN		
IV Change Trafficway Vehicle Turning	J Turn Across Path	 68 INITIAL OPPOSITE DIRECTIONS	 69 INITIAL SAME DIRECTIONS	 71 70 72 73	(EACH • 74) SPECIFICS OTHER (EACH • 75) SPECIFICS UNKNOWN	
	K Turn Into Path	 76 77 78	 79 78	 80 81 82	(EACH • 84) SPECIFICS OTHER (EACH • 85) SPECIFICS UNKNOWN	
V Intersecting Paths (Vehicle Damage)	L Straight Paths	 86 87	 88 89	(EACH • 90) SPECIFICS OTHER	(EACH • 91) SPECIFICS UNKNOWN	
VI Miscellaneous	M Backing Etc	 92 BACKING VEH.	 93 OTHER VEH OR OBJECT	98 Other Accident Type 99 Unknown Accident Type 00 No Impact		

OCCUPANT RELATED

37. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
38. Number of Occupants This Vehicle 02
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
39. Number of Occupant Forms Submitted 02

AIR BAG RELATED

40. Is this an AOPS Vehicle? 1
 (0) No (includes unknown)
 (1) Yes - researcher determined
 (2) VIN determined air bag system
 (3) VIN determined automatic (passive) belts
 (4) VIN determined air bag and automatic (passive) belts
41. Air Bag(s) Deployment, First Seat Frontal 6
 (0) Not equipped or not available
 (1) No air bags deployed
Single Air Bag Vehicle
 (2) Driver air bag deployed
 (3) Driver air bag, unknown if deployed
Multiple Air Bag Vehicle
 (4) Driver side only deployed
 (5) Passenger side only deployed
 (6) Driver and passenger side deployed
 (7) Driver and passenger side unknown if deployed
 (8) Air bag(s) deployed, details unknown
 (9) Unknown
42. Air Bag(s) Deployment, Other Than First Seat Frontal 0
 (0) Not equipped with an "other" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

Specify type of "other" air bag present: _____

VEHICLE WEIGHT ITEMS

43. Vehicle Curb Weight 1830
 _____ Code weight to nearest 10 kilograms
 (045) Less than 454 kilograms
 (612) 6,124 kilograms or more
 (999) Unknown
4030 lbs X 4536 = 1828 kgs

Source: _____

44. Vehicle Cargo Weight 000
 _____ Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (454) 4,536 kilograms or more
 (999) Unknown
 _____ lbs X .4536 = _____ kgs

Source: _____

ROLLOVER DATA

45. Rollover 00
 (00) No rollover (no overturning)
Rollover (primarily about the longitudinal axis)
 (01-16) Code the number of quarter turns Rollover, 17 or more quarter turns (specify): _____
 (98) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (99) Rollover (overturn), details unknown
46. Rollover Initiation Type 00
 (00) No rollover
 (01) Trip-over
 (02) Flip-over
 (03) Turn-over
 (04) Climb-over
 (05) Fall-over
 (06) Bounce-over
 (07) Collision with another vehicle
 (08) Other rollover initiation type specify: _____
 (98) Rollover--end-over-end
 (99) Unknown rollover initiation type
47. Location of Rollover Initiation 0
 (0) No rollover
 (1) On roadway
 (2) On shoulder--paved
 (3) On shoulder--unpaved
 (4) On roadside or divided trafficway median
 (8) Rollover--end-over-end
 (9) Unknown
48. Rollover Initiation Object Contacted 00
 (Note: Applicable codes on back of page)
49. Location on Vehicle Where Initial Principal Tripping Force Is Applied 0
 (0) No rollover
 (1) Wheels/tires
 (2) Side plane
 (3) End plane
 (4) Undercarriage
 (5) Other location on vehicle (specify): _____
 (6) Non-contact rollover forces (specify): _____
 (8) Rollover--end-over-end
 (9) Unknown
50. Direction of Initial Roll 0
 (0) No rollover
 (1) Roll right - primarily about the longitudinal axis
 (2) Roll left - primarily about the longitudinal axis
 (8) Rollover--end-over-end
 (9) Unknown roll direction

VERRIDE/UNDERRIDE (THIS VEHICLE)

51. Front Override/Underride (this Vehicle) 0
52. Rear Override/Underride (this Vehicle) 0
- (0) No override/underride, or not an end-to-end impact between two CDS applicable vehicles, and no medium/heavy truck or bus underride
- Override (see specific CDC)*
[Between 2 CDS applicable vehicles (Bodytype, GV07 = 1-49)]
- (1) 1st CDC
 (2) 2nd CDC
 (3) Other not automated CDC (specify): _____
- Underride (see specific CDC)*
[Between 2 CDS applicable vehicles (Bodytype, GV07 = 1-49)]
- (4) 1st CDC
 (5) 2nd CDC
 (6) Other not automated CDC (specify): _____
- (7) Medium/heavy truck or bus override (of any configuration)
 (9) Unknown

HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V

Values: (000)-(359) Code actual value
 (996) Non-horizontal impact
 (997) Noncollision
 (998) Impact with object
 (999) Unknown

53. Heading Angle For This Vehicle 0 9 0
54. Heading Angle For Other Vehicle 2 4 5

RECONSTRUCTION DATA

55. Towed Trailing Unit 0
- (0) No towed unit
 (1) Yes—towed trailing unit
 (9) Unknown
56. Documentation of Trajectory Data for This Vehicle 1
- (0) No
 (1) Yes
57. Post Collision Condition of Tree or Pole (For Highest Delta V) 0
- (0) Not collision (for highest delta V) with tree or pole
 (1) Not damaged
 (2) Cracked/sheared
 (3) Tilted < 45 degrees
 (4) Tilted ≥ 45 degrees
 (5) Uprooted tree
 (6) Separated pole from base
 (7) Pole replaced
 (8) Other (specify): _____
- (9) Unknown

ACCIDENT RECONSTRUCTION PROGRAMS HIGHEST DELTA V

58. Basis for Total (Resultant) Delta V (highest) 0 3

(00) No vehicle inspection

Delta V Calculated

- (01) Reconstruction program-damage only routine
 (02) Reconstruction program-damage and trajectory routine
 (03) Missing vehicle algorithm

Delta V Not Calculated

- (04) At least one vehicle (which may be this vehicle) is beyond the scope of an acceptable reconstruction program, regardless of collision conditions.

All vehicles within scope (CDC applicable) of reconstruction program but one of the collision conditions is beyond the scope of the reconstruction program or other acceptable reconstruction technique, regardless of adequacy of damage data.

- (05) Rollover
 (06) Other non-horizontal forces
 (07) Sideswipe type damage
 (08) Severe override
 (09) Yielding object
 (10) Overlapping damage
 (11) All vehicle and collision conditions are within scope of one of the acceptable reconstruction programs, but there is insufficient data available, (specify): _____

(98) Other, (specify): _____

COMPUTER GENERATED CRASH SEVERITY

59. Total Delta V

Highest

04444 Nearest kmph (highest)

____ Nearest kmph (secondary)

(NOTE: 000 means less than 0.5 kmph)

(160) 159.5 kmph and above

(999) Unknown

60. Longitudinal Component of
Delta V

Highest

+ 041-41 Nearest kmph (highest)

____ Nearest kmph (secondary)

(NOTE: _000 means greater than

-0.5 kmph and less than +0.5 kmph)

(+160) ± 159.5 kmph and above

(_999) Unknown

61. Lateral Component of Delta V

Highest

+ 015+15 Nearest kmph (highest)

____ Nearest kmph (secondary)

(NOTE: _000 means greater than -0.5 kmph and
less than +0.5 kmph)

(+160) ± 159.5 kmph and above

(_999) Unknown

62. Energy Absorption

Highest

168.900168,912 Nearest 100 joules (highest)

____ Nearest 100 joules (secondary)

(NOTE: 0000 means less than 50 joules)

(9997) 999,650 joules or more

(9999) Unknown

63. Impact Speed

Highest

998

____ Nearest kmph (highest)

____ Nearest kmph (secondary)

(NOTE: 000 means

less than 0.5 kmph)

(160) 159.5 kmph and above

(998) Trajectory algorithm not run

(999) Unknown

DELTA V CONFIDENCE LEVEL64. Confidence In Reconstruction Program
Results (For Highest Delta V)3

(0) No reconstruction

(1) Collision fits model — results appear
reasonable

(2) Collision fits model — results appear high

(3) Collision fits model — results appear low

(4) Borderline reconstruction — results appear
reasonable**OTHER SPEED ESTIMATE**

65. Barrier Equivalent Speed

Highest

04746.6 Nearest kmph (highest)

____ Nearest kmph (secondary)

(NOTE: 000 means

less than 0.5 kmph)

(160) 159.5 kmph and above

(999) Unknown

ESTIMATED DELTA V	INSPECTION TYPE
<p>66. Estimated Highest Delta V (Researcher Determined) <u>0</u></p> <p>(0) Reconstruction Delta V coded</p> <p><i>Estimated Delta V</i></p> <p>(1) Less than 10 kmph</p> <p>(2) ≥ 10 kmph but < 25 kmph</p> <p>(3) ≥ 25 kmph but < 40 kmph</p> <p>(4) ≥ 40 kmph but < 55 kmph</p> <p>(5) ≥ 55 kmph</p> <p><i>Other estimates of damage severity</i></p> <p>(6) Minor</p> <p>(7) Moderate</p> <p>(8) Severe</p> <p>(9) Unknown</p>	<p>67. Type of Vehicle Inspection <u>3</u></p> <p>(0) No inspection</p> <p>(1) Vehicle fully repaired-no damage evident</p> <p>(2) Partial inspection (specify): _____</p> <p>(3) Complete inspection</p>
	<p>DELTA V EVENT NUMBER</p> <p>68. Delta V Event Number <u>1</u></p> <p>_____ Code the accident event sequence number that resulted in the Delta V that has been coded above for this vehicle</p> <p>(99) Unknown</p>
<p>*** IF THE CDS APPLICABLE VEHICLE WAS NOT INSPECTED (I.E., GV67 = 0), ***</p> <p>DO NOT COMPLETE THE EXTERIOR AND INTERIOR VEHICLE FORMS</p> <p>*** IF GV07 DOES NOT EQUAL 01-49, DO NOT COMPLETE ***</p> <p>THE EXTERIOR VEHICLE, INTERIOR VEHICLE, OCCUPANT ASSESSMENT, AND OCCUPANT INJURY FORMS.</p>	

EXTERIOR VEHICLE FORM

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number	<u>10</u>	3. Vehicle Number	<u>01</u>
2. Case Number - Stratum	<u>9616</u>		

VEHICLE IDENTIFICATION

VIN 4S2CM58V8S4 Model Year 95
Vehicle Make (specify): ISUZU Vehicle Model (specify): ROBEC 4WD

LOCATOR

Locate the end of the damage with respect to the vehicle's damaged center point or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L	Location of Max Crush
01	49CM IN FRCM (E) BC	ACROSS FRONT BUMPER	C1

CRUSH PROFILE IN CENTIMETERS

NOTES: Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.

Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.

Use as many lines/columns as necessary to describe each damage profile.

[illegible]

ORIGINAL SPECIFICATIONS WORK SHEET

BEST AVAILABLE

Wheelbase 108.7 inches x 2.54 = 276.1 cm
 without Tire 176.5
 Overall Length 184.6 inches x 2.54 = 468.9 cm
 With Tire 168.5
 Maximum Width 68.5 inches x 2.54 = 174.0 cm
 Curb Weight 4030 pounds x 0.4536 = 1828.0 kg
 Average Track 56.7 inches x 2.54 = 144.5 cm
 57.1
 Front Overhang 28.7 inches x 2.54 = 73 cm
 Rear Overhang 40.0 inches x 2.54 = 101 cm
 Undeformed End Width 59.1 inches x 2.54 = 150 cm
 Engine Size: cyl/disl. cc x 0.001 = 3.2 L
193 CID x 0.0164 = 3.2 L

Branham's Shipping 3,930
 Weight 100
4,030

SPECIAL CRASH INVESTIGATION ADDENDUM

Submodel Designation: {specify} Color: {specify} white Repair Cost: \$
 Transmission: {circle} Automatic Manual Speed: 3-speed | 4-speed | 5-speed | Other:
 Steering: {circle} Power-assisted | Manual Type: rack-and-pinion | worm-and-gear | Other
 {please describe}:
 Brakes: {circle} Power-assisted | Manual Type: 4-wheel disc | 4-wheel drum | 4-wheel hydraulic
 | front disc, rear drum | Other:
 Observed Defects: {specify}
 Fleet Type: {circle} Private vehicle | Rental vehicle | Leased vehicle | Commercial vehicle | Other
 {please describe}:

VEHICLE DAMAGE SKETCH

TIRE—WHEEL DAMAGE

a. Rotation physically restricted b. Tire deflated

RF 1
LF 1
RR 2
LR 2RF 2
LF 1
RR 2
LR 2

(1) Yes (2) No (8) NA (9) Unk.

TYPE OF TRANSMISSION

☐ Manual ☒ AutomaticEND SHIFT \geq 10 CM☒ Yes ☐ No

ORIGINAL SPECIFICATIONS

Wheelbase 276 cm
 Overall Length 46 cm
 Maximum Width 174.0 cm
 Curb Weight 1828 kg
 Average Track 145 cm
 Front Overhang 73 cm
 Rear Overhang 101 cm
 Undeformed End Width 150 cm
 Engine Size: cyl./displ. V-6 504C 3.2 L

WHEEL STEER ANGLES
(For locked front wheels or displaced rear axles only)RF \pm _____ °LF \pm _____ °RR \pm _____ °LR \pm _____ °Within \pm 5 degrees


DRIVE WHEELS

☐ FWD ☐ RWD ☒ 4WD

Approximate

Cargo Weight 0 kg

MEASUREMENTS IN CENTIMETERS

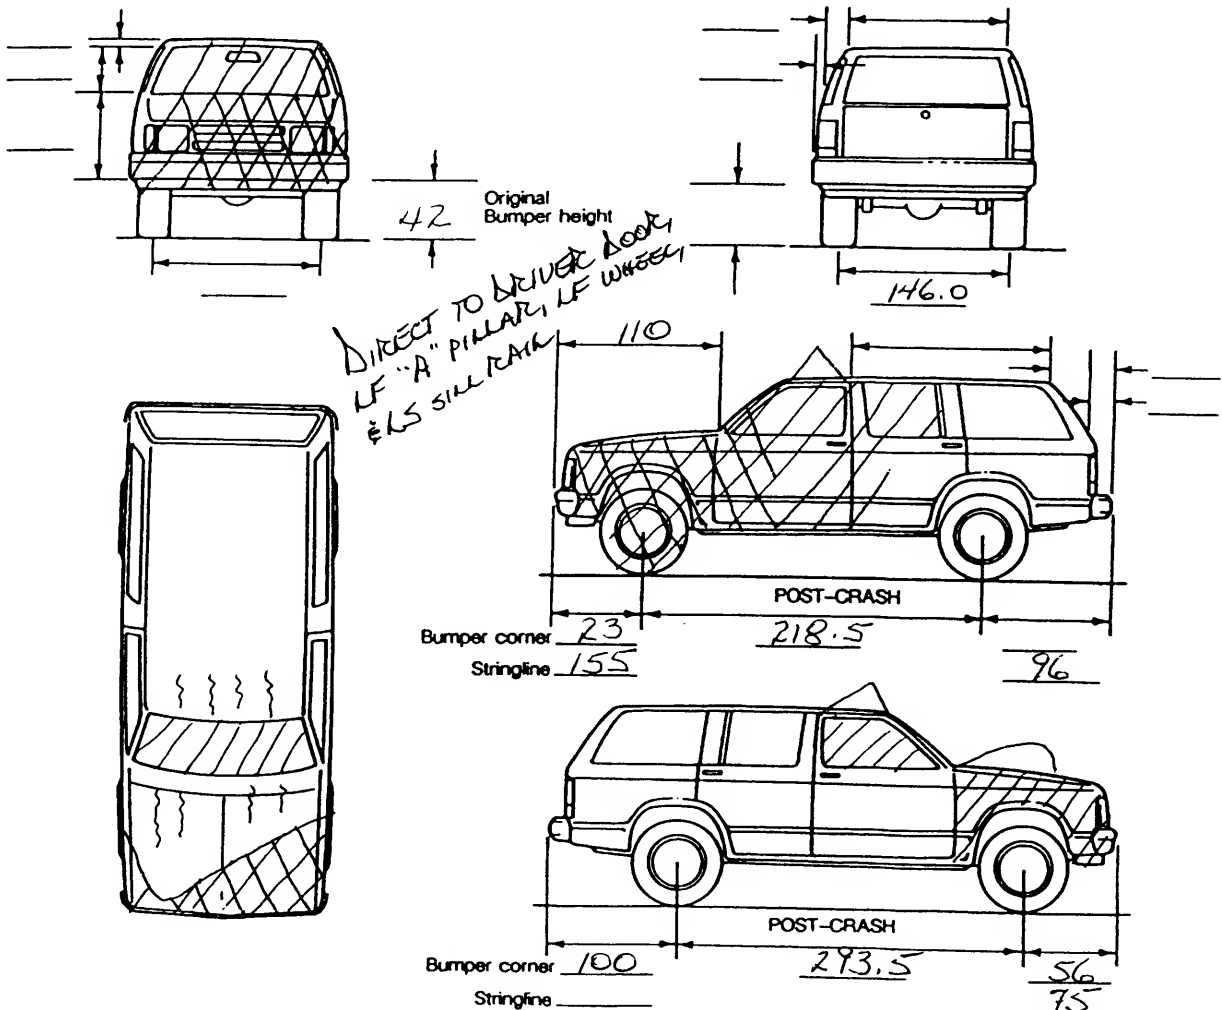

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

BRANHAM AUTOMOBILE REFERENCE BOOK-FOREIGN CAR SECTION

Isuzu American Isuzu Motors Inc.,

Type of Body Pass. Cap.	Model	Wheel Base	Dimensions Inches Lt. x Wt. x Ht.	Ship. Wt. lb.	Tax H.P.	P.O.E. West Coast	P.O.E. East Coast
Bore & Stroke 3.68x3.03; Tax H.P. 32.5; SAE H.P. 175@5200; Torque 188@4000; 193 cu.in., 3.2 liter							
Man. Trans. 5-speed; EPA Mileage Estimate 16/18							
5-PS 4-dr Utility	S	108.7"	183.5" x 72.4" x 72.2"	4135	32.5	22,450	22,450
5-PS 4-dr Utility	LS	108.7"	183.5" x 72.4" x 72.2"	4135	32.5	28,830	28,830
Auto. Trans. 4-speed; EPA Mileage Estimate 15/18							
5-PS 4-dr Utility	S	108.7"	183.5" x 72.4" x 72.2"	4175	32.5	24,950	24,950
5-PS 4-dr Utility	LS	108.7"	183.5" x 72.4" x 72.2"	4175	32.5	29,980	29,980

1995 Trooper 4WD V6 cyl 3.2 liter DOHC MPFI Gas Engine(24 valve)

Bore & Stroke 3.68x3.03; Tax H.P. 32.5; SAE H.P. 190@5600; Torque 195@3800; 193 cu.in., 3.2 liter

Man. Trans. 5-speed; EPA Mileage Estimate 16/18

5-PS 4-dr Utility S 108.7" 183.5" x 72.4" x 72.2" 4135 32.5 23,800 23,800

Auto. Trans. 4-speed; EPA Mileage Estimate 14/17

5-PS 4-dr Utility Limited 108.7" 183.5" x 72.4" x 72.2" 4370 32.5 36,800 36,800

Options Trooper: Destination Charges-\$420; Air Conditioner-\$900; Calif/NY Emissions SOHC-\$150 DOHC-\$250; Over Fenders-\$550; Split Rear Seat-\$250; Limited Slip Differential-\$260; 3 Channel ABS-\$1100; Preferred Equipment PKG-\$2760; CD Player-\$550 Changer-\$650; Keyless Entry System-\$250

1995 Rodeo 4L cyl 2.6 liter SOHC MPFI Gas Engine

Bore & Stroke 3.65x3.74; Tax H.P. 21.32; SAE H.P. 120@4600; Torque 150@2600; 156 cu.in., 2.6 liter

Man. Trans. 5-speed; EPA Mileage Estimate 16/20

5-PS 4-dr Utility 2WD S 108.7" 176.5" x 66.5" x 65.4" 3425 21.32 15,840 15,840

1995 Rodeo V6 cyl 3.2 liter SOHC MPFI Gas Engine(24 valve)

Bore & Stroke 3.68x3.03; Tax H.P. 32.5; SAE H.P. 175@5200; Torque 188@4000; 193 cu.in., 3.2 liter

Man. Trans. 5-speed; EPA Mileage Estimate 16/19

5-PS 4-dr Utility 2WD S 108.7" 176.5" x 66.5" x 65.4" 3635 32.5 18,500 18,500

5-PS 4-dr Utility 4WD S 108.7" 176.5" x 66.5" x 65.4" 3875 32.5 20,340 20,340

5-PS 4-dr Utility 4WD LS 108.7" 176.5" x 66.5" x 65.4" 3875 32.5 25,110 25,110

5-PS 4-dr Utility 4WD w/P245 S 108.7" 176.5" x 68.5" x 66.3" 3850 32.5

Auto. Trans. 4-speed; EPA Mileage Estimate 2WD 16/19 4WD 15/18

5-PS 4-dr Utility 2WD S 108.7" 176.5" x 66.5" x 65.4" 3690 32.5 19,420 19,420

5-PS 4-dr Utility 2WD LS 108.7" 176.5" x 66.5" x 65.4" 3690 32.5 23,990 23,990

5-PS 4-dr Utility 4WD S 108.7" 176.5" x 66.5" x 65.4" 3930 32.5 21,490 21,490

5-PS 4-dr Utility 4WD LS 108.7" 176.5" x 66.5" x 65.4" 3930 32.5 26,260 26,260

5-PS 4-dr Utility 4WD w/P245 S 108.7" 176.5" x 68.5" x 66.3" 3905 32.5

Options Rodeo: Destination Charges-\$410; Air Conditioner-\$850; Calif/NY Emissions-\$150; Bright Pkg 2WD-\$950

4WD-\$1510; Rear Wiper/Washer(2.6 L)-\$185; Sunroof-\$300; Limited Slip Differential(4WD LS)-\$260; w/16" AL

Wheels(4WD S)-\$990; Preferred Equipment PKG-\$2350; Outside Spare Tire Carrier(2.6L)-\$275; Sport Side Step 4WD-

\$345; AM/FM Stereo w/cassette-\$585; CD-\$550; Brush/Grille Guard-\$305; Aero Roof Rack-\$195; Floor Mats-\$55;

Keyless Security System-\$350; Running Board-\$270; Exterior Appearance Pkg (2.6L)-\$349

1995 Pickup 4 cyl 2.3 liter SOHC MPFI Gas Engine

Bore & Stroke 3.52x3.54; Tax H.P. 19.83; SAE H.P. 100@4600; Torque 123@2600; 138 cu.in., 2.3 liter

Man. Trans. 5-speed; EPA Mileage Estimate 22/24

2-PS 2-dr Std Bed 2WD S 105.6" 177.3" x 66.6" x 64.2" 2785 19.83 9,999 9,999

2-PS 2-dr Long Bed 2WD S 119.2" 193.8" x 66.6" x 64.2" 2860 19.83 11,409 11,409

1995 Pickup 4 cyl 2.6 liter SOHC MPFI Gas Engine

Bore & Stroke 3.65x3.74; Tax H.P. 21.32; SAE H.P. 120@4600; Torque 150@2600; 156 cu.in., 2.6 liter

Man. Trans. 5-speed; EPA Mileage Estimate (4WD) 17/20

2-PS 2-dr Std Bed 4WD S 105.6" 177.3" x 66.6" x 68.5" 3285 21.32 14,119 14,119

2-PS 2-dr Std Bed 4WD w/10.5R S 105.6" 177.3" x 68.5" x 69.7" 3285 21.32 15,264 15,264

Options Pickup: Destination Charges-\$400; Calif/NY Emissions-\$250; Power Steering (2.3L)-\$325; 10.5 R Tire/ AL

Wheel Pkg (4WD)-\$1145; Air Conditioning-\$830; AM/FM Stereo w/cassette-\$405; Brush/Grille Guard-\$305; Black Step

Bumper-\$165

Isuzu American Isuzu Motors Inc.,**1996 Oasis 2.2 liter 4 cyl SOHC FI Gas Engine(16 valve)**

Bore & Stroke 3.346x3.74; Tax H.P. 17.92; SAE H.P. 140@5600; Torque 145@4600; 132 cu.in., 2156cc

Auto. Trans. 4-speed; EPA Mileage Estimate 15/18

7-PS 4-dr MiniVan S 111.4" 187.2" x 70.6" x 64.6" 3473 17.92 23,495 23,495

7-PS 4-dr MiniVan LS 111.4" 187.2" x 70.6" x 64.6" 3483 17.92 25,990 25,990

Options Oasis: Destination Charges-\$445; Cruise Control-\$235; CD Player-\$470; Roof Rack-\$230

1996 Trooper 4WD V6 cyl 3.2 liter SOHC SFI Gas Engine(24 valve)

Bore & Stroke 3.677x3.031"; Tax H.P. 32.45; SAE H.P. 190@5600; Torque 188@4000; 193 cu.in., 3165cc

Man. Trans. 5-speed; EPA Mileage Estimate 16/18

5-PS 4-dr Utility S 108.7" 183.5" x 72.2" x 72.2" 4135 32.45 25,360 25,360

Auto. Trans. 4-speed; EPA Mileage Estimate 15/18

CDC WORKSHEET

CODES FOR OBJECT CONTACTED

(01-30) – Vehicle Number

Noncollision

- (31) Overturn — rollover (excludes end-over-end)
(32) Rollover—end-over-end
(33) Fire or explosion
(34) Jackknife
(35) Other intraunit damage (specify):

- (36) Noncollision injury
(38) Other noncollision (specify):

- (39) Noncollision — details unknown

Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
(42) Tree (> 10 cm in diameter)
(43) Shrubbery or bush
(44) Embankment

- (45) Breakaway pole or post (any diameter)**

Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
(51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
(52) Pole or post (> 30 cm in diameter)
(53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
(55) Impact attenuator
(56) Other traffic barrier (includes guardrail)
(specify):

- (57) Fence
(58) Wall
(59) Building
(60) Ditch or culvert
(61) Ground
(62) Fire hydrant
(63) Curb
(64) Bridge
(68) Other fixed object (specify):

- (69) Unknown fixed object

Collision with Nonfixed Object

- (70) Passenger car, light truck, van, or other vehicle not in-transport
(71) Medium/heavy truck or bus not in-transport
(72) Pedestrian
(73) Cyclist or cycle
(74) Other nonmotorist or conveyance

- (75) Vehicle occupant
(76) Animal

- (77) Train
(78) Trailer, disconnected in transport
(79) Object fell from vehicle in-transport
(88) Other nonfixed object (specify):

- (89) Unknown nonfixed object

- (98) Other event (specify):

- (99) Unknown event or object

DEFORMATION CLASSIFICATION BY EVENT NUMBER

[illegible]

COLLISION DEFORMATION CLASSIFICATION**HIGHEST DELTA "V"**

Accident Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>02</u>	6. <u>11</u>	7. <u>F</u>	8. <u>Y</u>	9. <u>E</u>	10. <u>W</u>	11. <u>05</u>

Second Highest Delta "V"

12. _____	13. _____	14. _____	15. _____	16. _____	17. _____	18. _____	19. _____
-----------	-----------	-----------	-----------	-----------	-----------	-----------	-----------

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. <u>L</u>	21. <u>C₁</u>	<u>C₂</u>	<u>C₃</u>	<u>C₄</u>	<u>C₅</u>	<u>C₆</u>	22. <u>±D</u>
--------------	--------------------------	----------------------	----------------------	----------------------	----------------------	----------------------	---------------

150 104 065 045 022 007 000 0029

Second Highest Delta "V"

23. <u>L</u>	24. <u>C₁</u>	<u>C₂</u>	<u>C₃</u>	<u>C₄</u>	<u>C₅</u>	<u>C₆</u>	25. <u>±D</u>
--------------	--------------------------	----------------------	----------------------	----------------------	----------------------	----------------------	---------------

_____ + _____
= _____

26. Undeformed End Width

(Coded when highest severity impact is an end plane impact.)

150 Code to the nearest centimeter

(250) 250 centimeters or more

(998) No highest severity end plane impact

(999) Unknown

27. Direct Damage Width

(For highest severity impact)

92 Code to the nearest centimeter

(250) 250 centimeters or more

(999) Unknown

28. Original Wheelbase

276.09

Code to the nearest centimeter

(650) 650 centimeters or more

(999) Unknown

108.7 inches X 2.54 = 276 centimeters

29. Original Average Track Width

144.52

Code to the nearest centimeter

(185) 185 centimeters or more

(999) Unknown

56.9 inches X 2.54 = 145 centimeters

276

145

FT 56.7
IN 57-1

<p>30. Are CDCs Documented but Not Coded on The Automated File? <u>0</u></p> <p>(0) No (1) Yes</p> <p>31. Researcher's Assessment of Vehicle Disposition <u>1</u></p> <p>(0) Not towed due to vehicle damage (1) Towed due to vehicle damage (9) Unknown</p> <p>32. Is This A Multi-Stage Manufactured Vehicle And/Or A Certified Altered Vehicle? <u>0</u></p> <p>(0) No post manufacturer modifications (1) Yes - post manufacturer modifications (specify): _____ _____ _____ (Include photograph of CERTIFICATION PLACARD in case report) (9) Unknown if vehicle is modified</p>	<p style="text-align: center;">FUEL SYSTEM</p> <p>35. Location of Fuel Tank-1 Filler Cap <u>3</u></p> <p>36. Location of Fuel Tank-2 Filler Cap <u>C</u></p> <p>(0) No fuel tank (1) On back plane (2) Aft of center of the rear wheels (rear axle) on left side plane (3) Aft of center of the rear wheels (rear axle) on right side plane (4) Forward of center of the rear wheels (rear axle) on left side plane (5) Forward of center of the rear wheels (rear axle) on right side plane (6) Over the center of the rear wheels (rear axle) on left side plane (7) Over the center of the rear wheels (rear axle) on right side plane (8) Other (specify): _____ (9) Unknown</p> <p>37. Type of Fuel Tank-1 <u>1</u></p> <p>38. Type of Fuel Tank-2 <u>C</u></p> <p>(0) No fuel tank (electrical vehicle) (1) Metallic (2) Non-metallic (9) Unknown</p>
<p style="text-align: center;">FIRE OCCURRENCE</p> <p>33. Fire Occurrence <u>C</u></p> <p>(0) No fire</p> <p>Yes, fire occurred (1) Minor (2) Major (9) Unknown</p> <p>34. Origin of Fire <u>C</u></p> <p>(0) No fire (1) Vehicle exterior (front, side, back, top) (2) Exhaust system (3) Fuel tank (and other fuel retention system parts) (4) Engine compartment (5) Cargo/trunk compartment (6) Instrument panel (7) Passenger compartment area (8) Other location (specify): _____ (9) Unknown</p>	<p>39. Location of Fuel Tank-1 <u>1</u></p> <p>40. Location of Fuel Tank-2 <u>C</u></p> <p>(0) No fuel tank (1) Aft of center of the rear wheels (rear axle) centered (2) Aft of center of the rear wheels (rear axle) left side (3) Aft of center of the rear wheels (rear axle) right side (4) Forward of center of the rear wheels (rear axle) centered (5) Forward of center of the rear wheels (rear axle) left side (6) Forward of center of the rear wheels (rear axle) right side (7) Over center of the rear wheels (rear axle) (8) Other (specify): _____ (9) Unknown</p> <p>41. Damage to Fuel Tank-1 <u>1</u></p> <p>42. Damage to Fuel Tank-2 <u>C</u></p> <p>(0) No fuel tank (1) No damage to fuel tank (2) Deformed, no seam failure (3) Deformed, with a seam failure (4) Punctured (5) Lacerated (ripped) (6) Abraded (scraped) (7) Filler neck separation from the fuel tank (8) Other damage (specify): _____ (9) Unknown</p>

[illegible]



INTERIOR VEHICLE FORM

1. Primary Sampling Unit Number 10

2. Case Number - Stratum 96 16

3. Vehicle Number 01

INTEGRITY

4. Passenger Compartment Integrity 98
(00) No integrity loss

Yes, Integrity Was Lost Through

- (01) Windshield
- (02) Door (side)
- (03) Door/hatch (back door)
- (04) Roof
- (05) Roof glass
- (06) Side window
- (07) Rear window (backlight)
- (08) Roof and roof glass
- (09) Windshield and door (side)
- (10) Windshield and roof
- (11) Side and rear window (side window and backlight)
- (12) Windshield and side window
- (13) Door and side window
- (98) Other combination of above (specify):
WINDSHIELD, LF DOOR, SIDE WINDOWS
- (99) Unknown

Door, Tailgate or Hatch Opening

5. LF 2 6. RF 3 7. LR 1 8. RR 1 9. TG/H 1

- (0) No door/gate/hatch
- (1) Door/gate/hatch remained closed and operational
- (2) Door/gate/hatch came open during collision
- (3) Door/gate/hatch jammed shut
- (8) Other (specify):
- (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0

10. LF 4 11. RF 0 12. LR 1 13. RR 1 14. TG/H 1

- (0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

- (1) Door operational (no damage)
- (2) Latch/striker failure due to damage
- (3) Hinge failure due to damage
- (4) Door structure failure due to damage
- (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
- (6) Latch/striker and hinge failure due to damage
- (8) Other failure (specify):
- (9) Unknown

GLAZING

Type of Window/Windshield Glazing

15. WS 1 16. LF 2 17. RF 2 18. LR 2 19. RR 2

20. BL 2 21. Roof 0 22. Other 0

- (0) No glazing
- (1) AS-1 - Laminated
- (2) AS-2 - Tempered
- (3) AS-3 - Tempered-tinted (original)
- (4) AS-2 - Tempered-with after market tint
- (5) AS-3 - Tempered-tinted (with additional after market tint)
- (6) AS-14 - Glass/Plastic
- (7) Glazing removed prior to accident
- (8) Other (specify):
- (9) Unknown

Window Precrash Glazing Status

23. WS 1 24. LF 9 25. RF 9 26. LR 2 27. RR 2

28. BL 1 29. Roof 0 30. Other 0

- (0) No glazing
- (1) Fixed
- (2) Closed
- (3) Partially opened
- (4) Fully opened
- (7) Glazing removed prior to accident
- (9) Unknown

Glazing Damage from Impact Forces

31. WS 5 32. LF 6 33. RF 6 34. LR 6 35. RR 1

36. BL 1 37. Roof 0 38. Other 1

- (0) No glazing
- (1) No glazing damage from impact forces
- (2) Glazing in place and cracked from impact forces
- (3) Glazing in place and holed from impact forces
- (4) Glazing out-of-place (cracked or not) and not holed from impact forces
- (5) Glazing out-of-place and holed from impact forces
- (6) Glazing disintegrated from impact forces
- (7) Glazing removed prior to accident
- (9) Unknown if damaged

Glazing Damage from Occupant Contact

39. WS 9 40. LF 9 41. RF 1 42. LR 1 43. RR 1

44. BL 1 45. Roof 0 46. Other 0

- (0) No glazing
- (1) No occupant contact to glazing
- (2) Glazing contacted by occupant but no glazing damage
- (3) Glazing in place and cracked by occupant contact
- (4) Glazing in place and holed by occupant contact
- (5) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
- (6) Glazing out-of-place by occupant contact and holed by occupant contact
- (7) Glazing removed prior to accident
- (8) Glazing disintegrated by occupant contact
- (9) Unknown if contacted by occupant

STEERING RIM/SPOKE DEFORMATION

(All Measurements Are in Centimeters)

COMPARISON VALUE — DAMAGE VALUE = DEFORMATION

— =

— =

— =

— =

NO CONTACT/NO DEFORMATION

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. <u>1 1</u>	48. <u>1 5</u>	49. <u>4</u>	50. <u>2</u>
2nd	51. <u>1 1</u>	52. <u>1 0</u>	53. <u>4</u>	54. <u>3</u>
3rd	55. <u>1 1</u>	56. <u>1 1</u>	57. <u>4</u>	58. <u>3</u>
4th	59. <u>1 1</u>	60. <u>0 2</u>	61. <u>4</u>	62. <u>2</u>
5th	63. <u>1 1</u>	64. <u>0 5</u>	65. <u>4</u>	66. <u>2</u>
6th	67. <u>1 2</u>	68. <u>1 5</u>	69. <u>3</u>	70. <u>2</u>
7th	71. <u>1 1</u>	72. <u>0 1</u>	73. <u>3</u>	74. <u>2</u>
8th	75. <u>1 1</u>	76. <u>0 6</u>	77. <u>3</u>	78. <u>2</u>
9th	79. <u>1 2</u>	80. <u>0 3</u>	81. <u>3</u>	82. <u>2</u>
10th	83. <u>1 1</u>	84. <u>1 8</u>	85. <u>3</u>	86. <u>1</u>

LOCATION OF INTRUSION

Front Seat
 (11) Left
 (12) Middle
 (13) Right

Second Seat
 (21) Left
 (22) Middle
 (23) Right

Third Seat
 (31) Left
 (32) Middle
 (33) Right

Fourth Seat
 (41) Left
 (42) Middle
 (43) Right

(97) Catastrophic
 (98) Other enclosed area (specify)

(99) Unknown

INTRUDING COMPONENT*Interior Components*

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- (07) B-pillar
- (08) C-pillar
- (09) D-pillar
- (10) Side panel - forward of the A1/A2-pillar
- (11) Door panel (side)
- (12) Side panel - rear of the B-pillar
- (13) Roof (or convertible top)
- (14) Roof side rail
- (15) Windshield
- (16) Windshield header
- (17) Window frame
- (18) Floor pan (includes sill)
- (19) Backlight header
- (20) Front seat back
- (21) Second seat back
- (22) Third seat back
- (23) Fourth seat back
- (24) Fifth seat back
- (25) Seat cushion
- (26) Back door/panel (e.g., tailgate)
- (27) Other interior component (specify):

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify):
- (32) Other exterior object in the environment (specify):
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify): 13
- (99) Unknown

MAGNITUDE OF INTRUSION


- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION

- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

INTRUSION WORKSHEET

NOTE: SKETCH INTRUDED AREAS

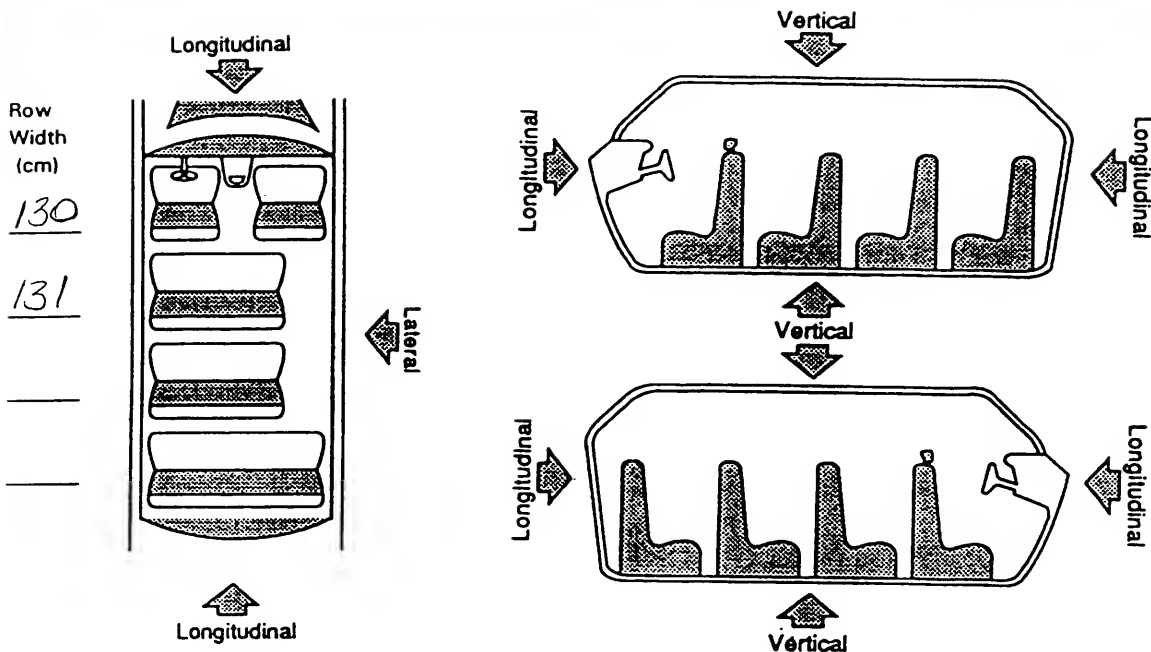

LOCATION OF INTRUSION	INTRUDED COMPONENT	(All Measurements Are In Centimeters)				DOMINANT CRUSH DIRECTION	
		COMPARISON VALUE	-	INTRUDED VALUE	=		INTRUSION
11	STEERING ASSEMBLY	153	-	128	=	25	LONG.
11	LEFT INSTRUMENT PANEL	170	-	135	=	35	LONG.
12	CENTER INSTRUMENT PANEL	169	-	152	=	17	LONG.
11	TOE PAN	220	-	188	=	32	LONG.
13	TOE PAN	220	-	216	=	4	LONG.
11	LEFT "A" PILLAR	172	-	148	=	24	LONG.
11	SIDE PANEL LOWER "A" PANEL	167	-	126	=	41	LATERAL
11	LEFT-FRONT DOOR PANEL	171	-	131	=	40	LATERAL
11	ROOF	85	-	88	=	+ 3	VERTICAL
11	ROOF SIDERAIL	116	-	118	=	+ 2	LATERAL
11	WINDSHIELD	213	-	168	=	45	LONG.
12	WINDSHIELD	208	-	179	=	29	LONG.
11	FLOOR PAN	50	-	35	=	15	VERTICAL
13	FLOOR PAN	26	-	13	=	13	LONG.
21	FLOOR PAN	50	-	49	=	1	VERTICAL

Document no more than the 15 most severe intrusions

STEERING COLUMN**INSTRUMENT PANEL**87. Steering Column Type 1

- (1) Fixed column
 (2) Tilt column
 (3) Telescoping column
 (4) Tilt and telescoping column
 (8) Other column type (specify): _____

(9) Unknown

88. Tilt Steering Column Adjustment 0

- (0) No tilt steering column
 (1) Full up
 (2) Between full up and center
 (3) Center
 (4) Between center and full down
 (5) Full down
 (9) Unknown

89. Telescoping Steering Column Adjustment 0

- (0) No telescoping steering column
 (1) Full back
 (2) Between full back and midpoint
 (3) Midpoint
 (4) Between midpoint and full forward
 (5) Full forward
 (9) Unknown

90. Steering Rim/Spoke Deformation 0 0

- Code actual measured deformation to the nearest centimeter
 (00) No steering rim deformation
 (01-14) Actual measured value in centimeters
 (15) 15 centimeters or more
 (98) Observed deformation cannot be measured
 (99) Unknown

91. Location of Steering Rim/Spoke Deformation 0 0



- (00) No steering rim deformation

Quarter Sections

- (01) Section A
 (02) Section B
 (03) Section C
 (04) Section D

**Half Sections**

- (05) Upper half of rim/spoke
 (06) Lower half of rim/spoke
 (07) Left half of rim/spoke
 (08) Right half of rim/spoke



- (09) Complete steering wheel collapse
 (10) Undetermined location
 (99) Unknown

92. Odometer Reading 9,009 kilometers9,009 kilometers

Code to the nearest 1,000 kilometers

- (000) No odometer
 (001) Less than 1,500 kilometers
 (500) 499,500 kilometers or more
 (999) Unknown

5,598 miles X 1.6093 = 9,009 kilometers

Source: _____

93. Instrument Panel Damage from Occupant Contact? 1

- (0) No
 (1) Yes
 (9) Unknown

94. Type of Knee Bolster Covering 2

- (0) No knee bolster
 (1) Padded
 (2) Rigid plastic
 (8) Other (specify): _____
 (9) Unknown

95. Knee Bolsters Deformed from Occupant Contact? 2

- (0) No knee bolster
 (1) No deformation
 (2) Yes - deformation
 (9) Unknown

96. Did Glove Compartment Door Open During Collision(s)? 2

- (0) No glove compartment door
 (1) No - door did not open
 (2) Yes - door opened
 (9) Unknown

97. Adaptive (Assistive) Driving Equipment 0

- (0) No adaptive driving equipment
 (1) Adaptive driving equipment installed (Check all that apply.)
☐ Hand controls for braking/acceleration
☐ Steering control devices (attached to OEM steering wheel)
☐ Steering knob attached to steering wheel
☐ Low effort power steering (unit or device)
☐ Replacement steering wheel (i.e., reduced diameter)
☐ Joy-stick steering controls
☐ Wheelchair tie-downs
☐ Modification to seat belts (specify): _____
☐ Additional or relocated switches (specify): _____
☐ Raised roof
☐ Wall-mounted head rest (used behind wheelchair)
☐ Other adaptive device (specify): _____

(9) Unknown

FIRST SEAT FRONTAL AIR BAGS

NOTES: Encode the applicable data *for the driver and first seat passenger* in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

	Driver	Passenger
A-Type of air bag?	1	1
B-Flaps open at tear points?	2	2
C-Flaps damaged?	1	1
D-Air bag damaged?	01	01
E-Source of air bag damage	01	01
F-Air bag tethered?	2	2
G-Air bag have vent ports?	2	2
H-Other occupant contact air bag?	3	1
I-Occupant wearing eyewear?	9	9

A-Type of Air Bag

- (0) Not equipped/not available
- (1) Original manufacturer installed system
- (2) Retrofitted air bag
- (3) Replacement air bag
- (8) Unknown type of air bag
- (9) Unknown

B-Did Air Bag Module Cover Flap(s) Open At Designated Tear Points?

- (0) Not equipped/not available
- (1) No
- (2) Yes
- (3) Deployed, unknown if flap(s) opened at designated tear points
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

C-Were Air Bag Module Cover Flap(s) Damaged?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):
- (3) Deployed, unknown if air bag module cover flap(s) damaged
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

D-Was There Damage To The Air Bag?

- (00) Not equipped/not available
- (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
- (03) Cut
- (04) Torn
- (05) Holed
- (06) Burned
- (07) Abraded
- (88) Other damage (specify):

- (95) Damaged, details unknown
- (96) Deployed, unknown if damaged
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

E-Source of Air Bag Damage

- (00) Not equipped/not available
- (01) Not damaged
- (02) Object worn by occupant, (specify):
- (03) Object carried by occupant, (specify):
- (04) Adaptive/assistive controls, (specify):
- (05) Fire in vehicle
- (06) Thermal burns
- (07) Rescue or emergency efforts
- (88) Other damage source (specify):

- (95) Damaged, unknown source
- (96) Deployed, unknown if damaged
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

F-Was The Air Bag Tethered?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify number of tether straps): 2
- (3) Deployed, unknown if tethered
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

G-Did The Air Bag Have Vent Ports?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify number of vent ports): 2
- (3) Deployed, unknown if vent ports present
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

H-Was the Air Bag in this Occupant's Position Contacted by Another Occupant?





- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):
- (3) Deployed, unknown if other occupant contact to air bag
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

I-Was This Occupant Wearing Eye-wear?

- (0) Not equipped/not available
- (1) No
- (2) Eyeglasses/sunglasses
- (3) Contact lenses
- (4) Deployed, unknown if eyewear worn
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

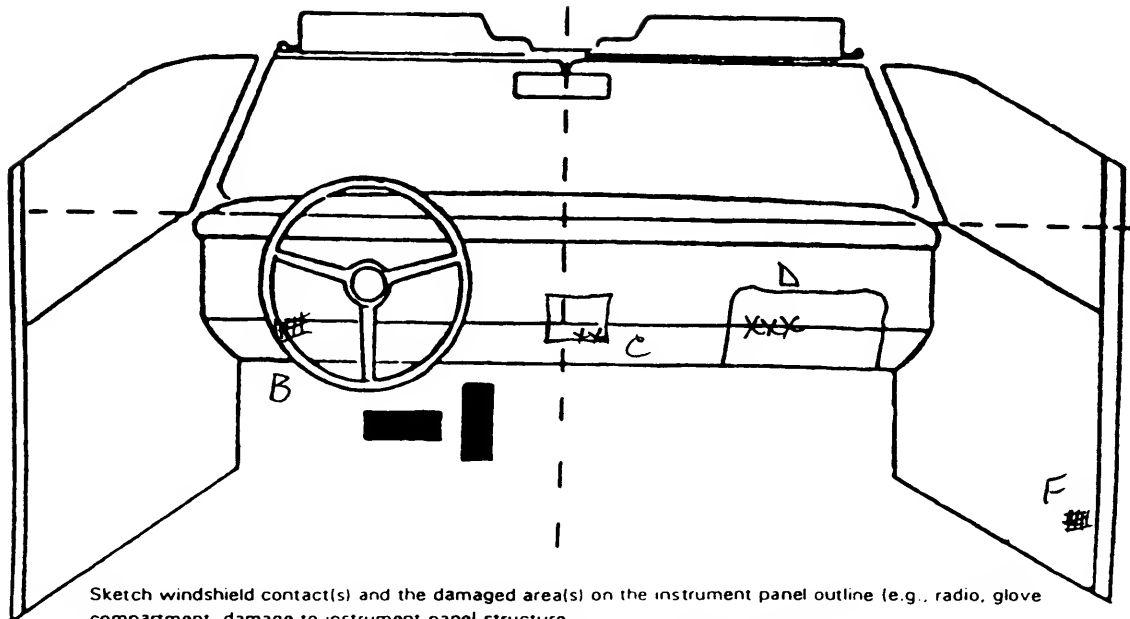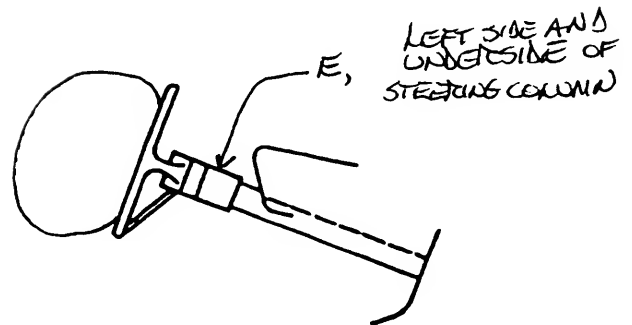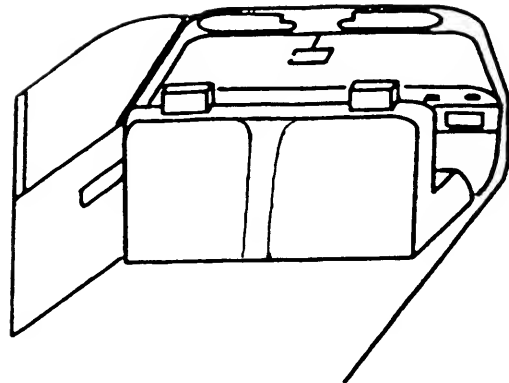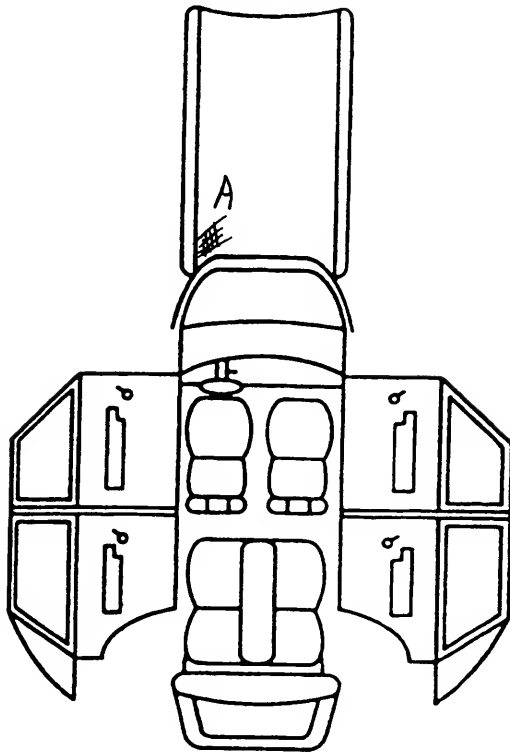

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure).

Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.

Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page

POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	205/003	01	HEAD	SKIN/FACIAL OIL TRANSFERS	1
B	010	01	① KNEE	CLOTH SCRATCHING	1
C	011	02	HAND	SCRATCH	3
D	013	02	① KNEE	SCRATCH/DEPRESSION	1
E	007	01	① KNEE	CLOTH SCRATCHING	1
F	110	02	① LOWER LEG	BLOOD SMUDGE	3
G					
H					
I					
J					
K					
L					
M					
N					

FRONT

- (001) Windshield
 (002) Mirror
 (003) Sunvisor
 (004) Steering wheel rim
 (005) Steering wheel hub/spoke
 (006) Steering wheel (combination of codes 004 and 005)
 (007) Steering column, transmission selector lever, other attachment
 (008) Cellular telephone or CB radio
 (009) Add on equipment (e.g., tape deck, air conditioner)
 (010) Left instrument panel and below
 (011) Center instrument panel and below
 (012) Right instrument panel and below
 (013) Glove compartment door
 (014) Knee bolster
 (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
 (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
 (017) Windshield reinforced by exterior object, (specify):
 (019) Other front object (specify):

CODES FOR INTERIOR COMPONENTS

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
 (052) Left side hardware or armrest
 (053) Left A (A1/A2)-pillar
 (054) Left B-pillar
 (055) Other left pillar (specify):
 (056) Left side window glass
 (057) Left side window frame
 (058) Left side window sill
 (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
 (060) Other left side object (specify):

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests
 (102) Right side hardware or armrest
 (103) Right A (A1/A2)-pillar
 (104) Right B-pillar
 (105) Other right pillar (specify):
 (106) Right side window glass
 (107) Right side window frame
 (108) Right side window sill
 (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
 (110) Other right side object (specify): KICK PANEL

INTERIOR

- (151) Seat, back support
 (152) Belt restraint webbing/buckle
 (153) Belt restraint B-pillar or door frame attachment point
 (154) Other restraint system component (specify):
 (155) Head restraint system
 (160) Other occupants (specify):
 (161) Interior loose objects
 (162) Child safety seat (specify):
 (163) Other interior object (specify):

AIR BAG

- (170) Air bag-driver side
 (175) Air bag compartment cover-driver side
 (180) Air bag-passenger side
 (185) Air bag compartment cover-passenger side
 (190) Other air bag (specify):
 (195) Other air bag compartment cover (specify):

ROOF

- (201) Front header
 (202) Rear header
 (203) Roof left side rail
 (204) Roof right side rail
 (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
 (252) Floor or console mounted transmission lever, including console
 (253) Parking brake handle
 (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
 (302) Backlight storage rack, door, etc.
 (303) Other rear object (specify):

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
 (402) Steering control devices (attached to OEM steering wheel)
 (403) Steering knob attached to steering wheel
 (405) Replacement steering wheel (i.e., reduced diameter)
 (406) Joy stick steering controls
 (407) Wheelchair tie-downs
 (408) Modification to seat belts, (specify):
 (409) Additional or relocated switches, (specify):
 (410) Raised roof
 (411) Wall mounted head rest (used behind wheel chair)
 (412) Other adaptive device (specify):

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
 (2) Probable
 (3) Possible
 (9) Unknown

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Frontal Air Bags--Left Front	Frontal Air Bags--Right Front	Other Air Bag
F I R S T	Availability/Function	/	/	
	Deployment	/	/	
	Failure	/	/	

Air Bag System Availability/Function
(0) Not equipped/not available
(1) Air bag

Non-functional

(2) Air bag disconnected (specify): _____

(3) Air bag not reinstalled

(9) Unknown

**Air Bag System Deployment
(This Occupant Position)**
(0) Not equipped/not available
(1) Deployed during accident (as a result of impact)
(2) Deployed inadvertently just prior to accident
(3) Deployed, accident sequence undetermined
(4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
(5) Unknown if deployed
(7) Nondeployed
(9) Unknown

Are There Indications of Air Bag System Failure? (This Occupant Position)
(0) Not equipped/not available
(1) No
(2) Yes (specify): _____
(9) Unknown

AUTOMATIC BELTS

		Left	Right
F I R S T	A-Availability/Function	○	○
	B-Use		
	C-Type		
	D-Proper Use		
	E-Failure Modes		

A-Automatic (Passive) Belt System Availability/Function

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

B-Automatic (Passive) Belt System Use

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative)
- (3) Automatic belt use unknown
- (9) Unknown

C-Automatic (Passive) Belt System Type

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

D-Proper Use of Automatic (Passive) Belt System

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____

- (8) Other improper use of automatic belt system (specify): _____

(9) Unknown

E-Automatic (Passive) Belt Failure Modes During Accident

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____
- (9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

If a child safety seat is present, encode the data on the back of this page 11.

If the vehicle has automatic restraints available, encode the appropriate data on page 6.

		Left	Center	Right
F I R S T	A-Availability	4	0	4
	B-Evidence of usage	04		04
	C-Used in this crash?	00		04
	D-Proper Use	0		9
	E-Failure Modes	0		1
	F-Anchorage Adjustment	1		1
S E C O N D	A-Availability	4	3	4
	B-Evidence of usage	04	03	04
	C-Used in this crash?	00	00	00
	D-Proper Use	0	0	0
	E-Failure Modes	0	0	0
	F-Anchorage Adjustment	1	0	1
O T H E R	A-Availability			
	B-Evidence of usage			
	C-Used in this crash?			
	D-Proper Use			
	E-Failure Modes			
	F-Anchorage Adjustment			

A-Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____
- (9) Unknown

B/C-Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used - type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

D-Proper Use of Manual (Active) Belts

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of manual belt system (specify): _____
- (9) Unknown

E-Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other manual belt failure (specify): _____
- (9) Unknown

F-Shoulder Belt Upper Anchorage Adjustment

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt


Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment


DRIVER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Front)

MEASURED AS IF
WHEEL TURNED UPWARDS

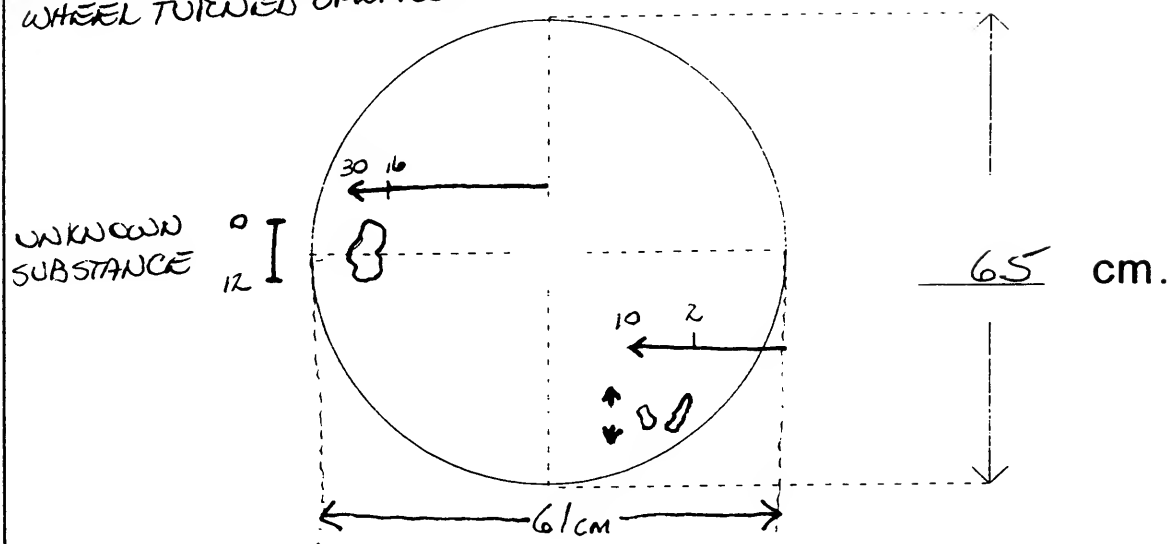

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Back)

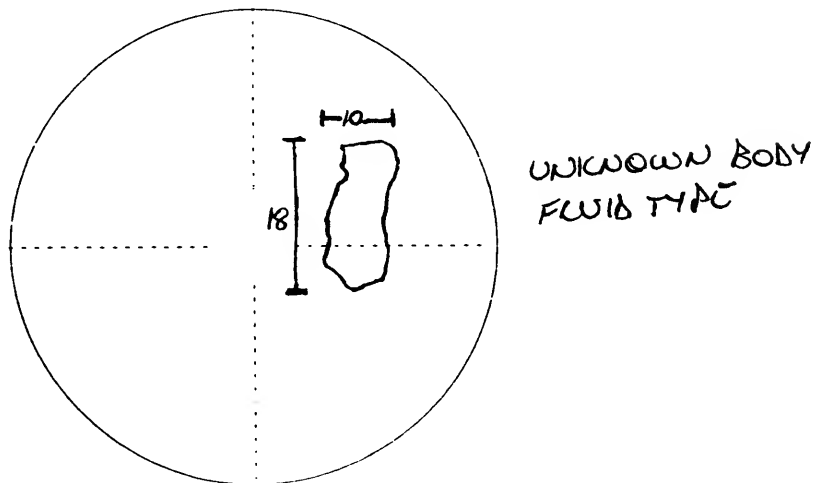


DRIVER AIR BAG SKETCHES (Cont'd)

3. DRIVER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

width (W_U) _____ width (W_L) _____


height (H) _____

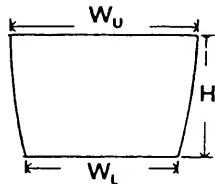

4. DRIVER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap

b. Lower Flap

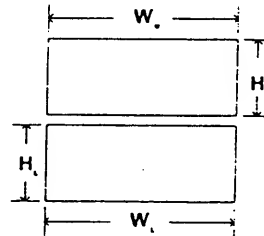
width (W_U) 13.5 width (W_L) 13.5height (H_U) 8.0 height (H_L) 8.0

5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE

6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

STEERING WHEEL
TURNED 90° LEFT


7. SKETCH LOCATION OF CIRCULAR AIR BAG VENT PORTS

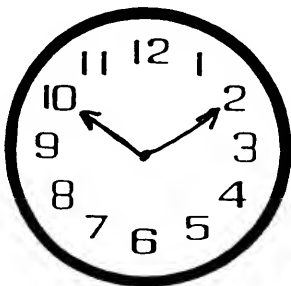


BOTH VENTS
5cm in DIAMETER

PASSENGER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Front)

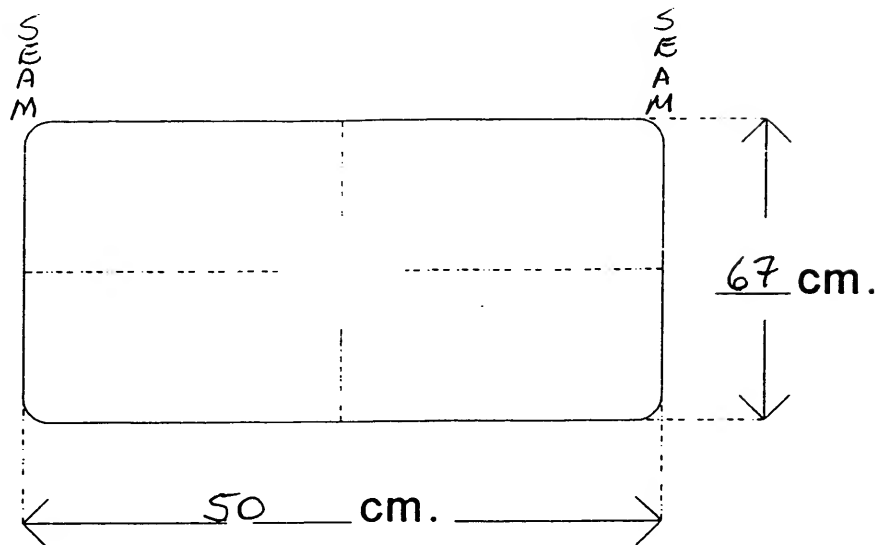


2. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Back)

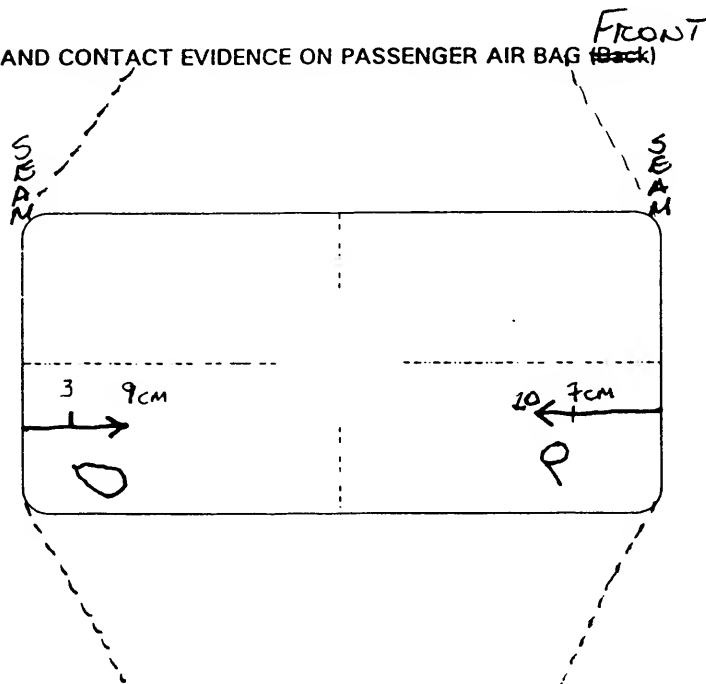

PASSENGER AIR BAG SKETCHES (Cont'd)


3. PASSENGER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

width (W) 27
 height (H) 8.0

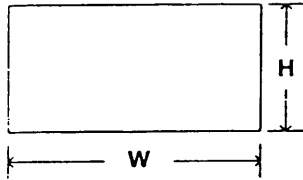

4. PASSENGER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap b. Lower Flap
 width (W_U) _____ width (W_L) _____
 height (H_U) _____ height (H_L) _____

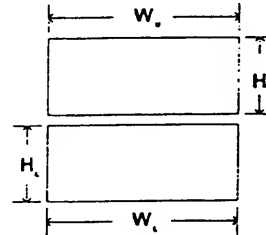


5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE

6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

BOTH VENTS
 6 CM IN DIAMETER

7. SKETCH LOCATION OF RECTANGULAR AIR BAG VENT PORTS

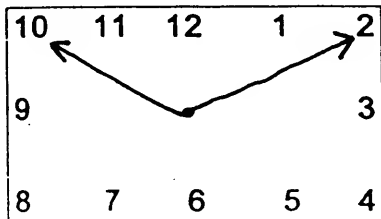

"OTHER" AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Front)

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Back)

"OTHER" AIR BAG SKETCHES (Cont'd)

3. SKETCH AIR BAG MODULE FLAP AND SIZE OR OPENING FOR AIRBAG

4. SKETCH AIR BAG VENT PORTS

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
F I R S T	A-Head Restraint Type/Damage	3		3
	B-Seat Type	02		02
	C-Seat Orientation	1		1
	D-Seat Track Position	9		6
	E-Seat Back Incline Pre/Post Impact	99		23
	F-Seat Performance	1		1
S E C O N D	A-Head Restraint Type/Damage	3		3
	B-Seat Type	05	05	05
	C-Seat Orientation	1	1	1
	D-Seat Track Position	1	1	1
	E-Seat Back Incline Pre/Post Impact	01	01	01
	F-Seat Performance	0	0	0
T H I R D	A-Head Restraint Type/Damage			
	B-Seat Type			
	C-Seat Orientation			
	D-Seat Track Position			
	E-Seat Back Incline Pre/Post Impact			
	F-Seat Performance			
O T H E R	A-Head Restraint Type/Damage			
	B-Seat Type			
	C-Seat Orientation			
	D-Seat Track Position			
	E-Seat Back Incline Pre/Post Impact			
	F-Seat Performance			

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

ACCORDING TO AMBULANCE CREW, NO SEAT TRACKS
WERE MOVED DURING TREATMENT OR EXTRICATION

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number		NO CHILD SAFETY SEATS				
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

<p>1. Type of Child Safety Seat</p> <p>(0) No child safety seat</p> <p>(1) Infant seat</p> <p>(2) Toddler seat</p> <p>(3) Convertible seat</p> <p>(4) Booster seat</p> <p>(7) Other type child safety seat (specify): _____</p> <p>(8) Unknown child safety seat type</p> <p>(9) Unknown if child safety seat used</p> <p>2. Child Safety Seat Orientation</p> <p>(00) No child safety seat</p> <p>Designed for Rear Facing for This Age/Weight</p> <p>(01) Rear facing</p> <p>(02) Forward facing</p> <p>(08) Other orientation (specify): _____</p> <p>(09) Unknown orientation</p> <p>Designed for Forward Facing for This Age/Weight</p> <p>(11) Rear facing</p> <p>(12) Forward facing</p> <p>(18) Other orientation (specify): _____</p> <p>(19) Unknown orientation</p> <p>Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight</p> <p>(21) Rear facing</p> <p>(22) Forward facing</p> <p>(28) Other orientation (specify): _____</p> <p>(29) Unknown orientation</p> <p>(99) Unknown if child safety seat used</p>	<p>3. Child Safety Seat Harness Usage</p> <p>4. Child Safety Seat Shield Usage</p> <p>5. Child Safety Seat Tether Usage</p> <p>Note: Options Below Are Used for Variables 3-5.</p> <p>(00) No child safety seat</p> <p>Not Designed with Harness/Shield/Tether</p> <p>(01) After market harness/shield/tether added, not used</p> <p>(02) After market harness/shield/tether used</p> <p>(03) Child safety seat used, but no after market harness/shield/tether added</p> <p>(09) Unknown if harness/shield/tether added or used</p> <p>Designed With Harness/Shield/Tether</p> <p>(11) Harness/shield/tether not used</p> <p>(12) Harness/shield/tether used</p> <p>(19) Unknown if harness/shield/tether used</p> <p>Unknown If Designed With Harness/Shield/Tether</p> <p>(21) Harness/shield/tether not used</p> <p>(22) Harness/shield/tether used</p> <p>(29) Unknown if harness/shield/tether used</p> <p>(99) Unknown if child safety seat used</p> <p>6. Child Safety Seat Make/Model</p> <p>(Specify make/model and occupant number)</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p>
--	--

HEAD RESTRAINTS/SEAT EVALUATION**A-Head Restraint Type/Damage by Occupant at This Occupant Position**

- (0) No head restraints
- (1) Integral — no damage
- (2) Integral — damaged during accident
- (3) Adjustable — no damage
- (4) Adjustable — damaged during accident
- (5) Add-on — no damage
- (6) Add-on — damaged during accident
- (8) Other
- Specify: _____
- (9) Unknown

B-Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Box mounted seat (i.e., van type)
- (10) Other seat type (specify): _____
- (99) Unknown

C-Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

D-Seat Track Adjusted Position Prior To Impact

- (0) Occupant not seated or no seat
- (1) Non-adjustable seat track

Adjustable Seat Track

- (2) Seat at forward most track position
- (3) Seat between forward most and middle track positions
- (4) Seat at middle track position
- (5) Seat between middle and rear most track positions
- (6) Seat at rear most track position
- (9) Unknown

E-Seat Back Incline Prior and Post Impact

- (00) Occupant not seated or no seat
- (01) Not adjustable

Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position

- (99) Unknown

F-Seat Performance (this Occupant Position)




- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____

- (4) Seat tracks/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____

- (7) Combination of above (specify): _____

- (8) Other (specify): _____

- (9) Unknown

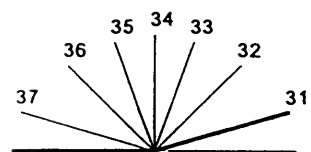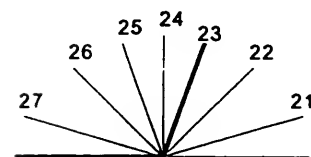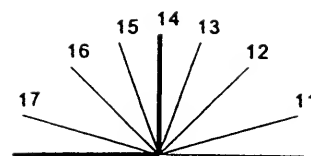Coding diagrams for *Seat Back Incline Position Prior and Post Impact*

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No ☒ Yes []

Describe indications of ejection and body parts involved in partial ejection(s):

Occupant Number						
Ejection						
(Note on Vehicle Interior Sketch) Ejection Area						
Ejection Medium						
Medium Status						

Ejection

- (1) Complete ejection
(2) Partial ejection
(3) Ejection, Unknown degree
(9) Unknown

Ejection Area

- (1) Windshield
(2) Left front
(3) Right front
(4) Left rear
(5) Right rear
(6) Rear

(7) Roof

- (8) Other area (e.g., back of pickup, etc.) (specify):

(9) Unknown**Ejection Medium**

- (1) Door/hatch/tailgate
(2) Nonfixed roof structure
(3) Fixed glazing
(4) Nonfixed glazing (specify):

(5) Integral structure

- (8) Other medium (specify):

(9) Unknown**Medium Status (Immediately Prior to Impact)**

- (1) Open
(2) Closed
(3) Integral structure
(9) Unknown

ENTRAPMENT No [☒] Yes [☒]

Describe entrapment mechanism:

DRIVER WAS MOST LIKELY ENTRAPPED AT THE LOWER EXTREMITIES BY THE LOWER INSTRUMENT PANEL. THE RIGHT-FRONT PASSENGER WAS NOT ENTRAPPED. BOTH FRONT DOORS WERE JAMMED (NOTE EVIDENCE OF EXTRICATION TOOL AT BOTH "B"-PILLARS' LEADING EDGE.

Component(s): LEFT LOWER INSTRUMENT PANEL AND STEERING COLUMN AND WHEEL

(Note on vehicle interior sketch)



GENERAL VEHICLE FORM

1. Primary Sampling Unit Number

2. Case Number - Stratum

3. Vehicle Number

96 10
16
02

12. Speed Limit

(000) No statutory limit

Code posted or statutory speed limit in kmph
(999) Unknown

45 mph X 1.6093 = 072 kmph

13. Police Reported Alcohol Presence For Driver

- (0) No alcohol present
(1) Yes alcohol present
(7) Not reported
(8) No driver present
(9) Unknown

14. Alcohol Test Result For Driver

Code actual value (decimal implied
before first digit—0.xx)

- (95) Test refused
(96) None given
(97) AC test performed, results unknown
(98) No driver present
(99) Unknown

Source: _____

15. Police Reported Other Drug Presence For Driver

- (0) No other drug(s) present
(1) Yes other drug(s) present
(7) Not reported
(8) No driver present
(9) Unknown

16. Other Drug Specimen Test Result For Driver

- (0) No specimen test given
(1) Drug(s) not found in specimen
(2) Drug(s) found in specimen, (specify):
(3) Specimen test given, results unknown or not obtained
(8) No driver present
(9) Unknown if specimen test given

17. Driver's Zip Code

(00001) Driver not a resident of U.S. or territories

46221 Code actual 5-digit zip code
(99998) No driver present
(99999) Unknown

18. Driver's Race/Ethnic Origin

- (1) White (non-Hispanic)
(2) Black (non-Hispanic)
(3) White (Hispanic)
(4) Black (Hispanic)
(5) American Indian, Eskimo or Aleut
(6) Asian or Pacific Islander
(7) Other (specify):

- (8) No driver present
(9) Unknown

VEHICLE IDENTIFICATION

4. Vehicle Model Year

Code the last two digits of the model year
(99) Unknown

5. Vehicle Make (specify):

GMC
Applicable codes are found in your
NASS Data Collection, Coding and
Editing Manual.
(99) Unknown

6. Vehicle Model (specify):

SIERRA CLASSIC PICKUP 442
Applicable codes are found in your
NASS Data Collection, Coding and
Editing Manual.
(999) Unknown

7. Body Type

Note: Applicable codes may be found on
the back of this page.

8. Vehicle Identification Number

1GTDCL4H2GJ
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17
Left justify; Slash zeros and letter Z (0 and Z)
No VIN—Code all zeros
Unknown—Code all nines

9. Vehicle Special Use (This Trip)

- (0) No special use
(1) Taxi
(2) Vehicle used as school bus
(3) Vehicle used as other bus
(4) Military
(5) Police
(6) Ambulance
(7) Fire truck or car
(8) Other (specify):
(9) Unknown

OFFICIAL RECORDS

10. Police Reported Vehicle Disposition

- (0) Not towed due to vehicle damage
(1) Towed due to vehicle damage
(9) Unknown

11. Police Reported Travel Speed

Code to the nearest kmph (NOTE: 000 means
less than 0.5 kmph)
(160) 159.5 kmph and above
(999) Unknown

____ mph X 1.6093 = ____ kmph

CODES FOR BODY TYPE

CDS APPLICABLE VEHICLES

Automobiles

- (01) Convertible (excludes sun-roof, t-bar)
- (02) 2-door sedan, hardtop, coupe
- (03) 3-door/2-door hatchback
- (04) 4-door sedan, hardtop
- (05) 5-door/4-door hatchback
- (06) Station wagon (excluding van and truck based)
- (07) Hatchback, number of doors unknown
- (08) Other automobile type (specify): _____

- (09) Unknown automobile type

Automobile Derivatives

- (10) Auto based pickup (includes El Camino, Caballero, Ranchero, Brat, and Rabbit pickup)
- (11) Auto based panel (cargo station wagon, auto based ambulance/hearse)
- (12) Large limousine - more than four side doors or stretched chassis
- (13) Three-wheel automobile or automobile derivative

Utility Vehicles ($\leq 4,536$ kgs GVWR)

- (14) Compact utility (Jeep CJ-2 - CJ-7, Scrambler, Golden Eagle, Renegade, Laredo, Wrangler, Cherokee [84 and after], Dispatcher, Raider, Bronco II, Bronco [76 and before], Explorer, S-10 Blazer, Geo Tracker, Bravada, S-15 Jimmy, Thing, Pathfinder, Trooper, Trooper II, Rodeo, Amigo, Navajo, 4-Runner, Montero, Passport, Samurai, Sidekick, Rocky)
- (15) Large utility (includes Jeep Cherokee [83 and before], Ramcharger, Trailduster, Bronco-fullsize [78 and after], fullsize Blazer, fullsize Jimmy, Hummer, Landcruiser, Rover, Scout, Yukon)
- (16) Utility station wagon (Chevy Suburban, GMC Suburban, Travelall, Grand Wagoneer, includes suburban limousine)
- (19) Utility, unknown body type

Van Based Light Trucks ($\leq 4,536$ kgs GVWR)

- (20) Minivan (Town and Country, Caravan, Grand Caravan, Voyager, Grand Voyager, Mini-Ram, Vista, Aerostar, Windstar, Villager, Lumina APV, Trans Sport, Silhouette, Astro, Safari, Toyota Van, Toyota Minivan, Previa, Nissan Minivan, Quest, Mitsubishi Minivan, Expo Wagon, Vanagon/Camper.)
- (21) Large van (B150-B350, Sportsman, Royal, Maxiwagon, Ram, Tradesman, Voyager [83 and before], E150-E350, Econoline, Clubwagon, Chateau, G10-G30, Chevy Van, Beauville, Sport Van, G15-G35, Rally Van, Vandura.)
- (22) Step van or walk-in van ($\leq 4,536$ kgs GVWR)
- (23) Van based motorhome ($\leq 4,536$ kgs GVWR)
- (24) Van based school bus ($\leq 4,536$ kgs GVWR)
- (25) Van based other bus ($\leq 4,536$ kgs GVWR)
- (28) Other van type (Hi-Cube Van, Kary) (specify): _____
- (29) Unknown van type

Light Conventional Trucks (Pickup style cab, $\leq 4,536$ kgs GVWR)

- (30) Compact pickup (D50, Colt P/U, Ram 50, Dakota, Arrow Pickup [foreign], Ranger, Courier, S-10, T-10, LUV, S-15, T-15, Sonoma, Datsun/Nissan Pickup, P'up, Mazda Pickup, Toyota Pickup, Mitsubishi Pickup)
- (31) Large Pickup (Jeep Pickup, Comanche, Ram Pickup, D100-D350, W100-W350, F100-F350, C10-C35, K10-K35, R10-R35, V10-V35, Silverado, Sierra, R100-R500, T100)
- (32) Pickup with slide-in camper
- (33) Convertible pickup
- (39) Unknown pickup style light conventional truck type

Other Light Trucks ($\leq 4,536$ kgs GVWR)

- (40) Cab chassis based (includes rescue vehicles, light stake, dump, and tow truck)
- (41) Truck based panel
- (42) Light truck based motorhome (chassis mounted)
- (45) Other light conventional truck type
- (48) Unknown light truck type
- (49) Unknown light vehicle type (automobile, utility, van, or light truck)

OTHER VEHICLES

Buses (Excludes Van Based)

- (50) School bus (designed to carry students, not cross country or transit)
- (58) Other bus type (e.g., transit, intercity, bus based motorhome) (specify): _____
- (59) Unknown bus type

Medium/Heavy Trucks ($> 4,536$ kgs GVWR)

- (60) Step van ($> 4,536$ kgs GVWR)
- (61) Single unit straight truck ($4,536$ kgs $<$ GVWR $\leq 8,845$ kgs)
- (62) Single unit straight truck ($8,845$ kgs $<$ GVWR $\leq 11,793$ kgs)
- (63) Single unit straight truck ($> 11,793$ kgs GVWR)
- (64) Single unit straight truck, GVWR unknown
- (65) Medium/heavy truck based motorhome
- (67) Truck-tractor with no cargo trailer
- (68) Truck-tractor pulling one trailer
- (69) Truck-tractor pulling two or more trailers
- (70) Truck-tractor (unknown if pulling trailer)
- (78) Unknown medium/heavy truck type
- (79) Unknown truck type (light/medium/heavy)

Motored Cycles (Does Not Include All-Terrain Vehicles/Cycles)

- (80) Motorcycle
- (81) Moped (motorized bicycle)
- (82) Three-wheel motorcycle or moped
- (88) Other motored cycle (minibike, motorscooter) (specify): _____
- (89) Unknown motored cycle type

Other Vehicles

- (90) ATV (All-Terrain Vehicle) and ATC (All-Terrain Cycle)
- (91) Snowmobile
- (92) Farm equipment other than trucks
- (93) Construction equipment other than trucks
- (97) Other vehicle type
- (99) Unknown body type

PRECRAASH ENVIRONMENTAL DATA

19. Relation To Interchange Or Junction 0
 (0) Non-interchange area and non-junction
 (1) Interchange area related

Non-Interchange junctions

- (2) Intersection related
 (3) Driveway, alley access related
 (4) Other junction (specify): _____

(5) Unknown type of junction _____

(9) Unknown

20. Trafficway Flow 0
 (0) Not physically divided (two way traffic)
 (1) Divided trafficway-median strip without positive barrier
 (2) Divided trafficway-median strip with positive barrier
 (3) One way traffic
 (9) Unknown

21. Number Of Travel Lanes 2
 (1) One
 (2) Two
 (3) Three
 (4) Four
 (5) Five
 (6) Six
 (7) Seven or more
 (9) Unknown

22. Roadway Alignment 2
 (1) Straight
 (2) Curve right
 (3) Curve left
 (9) Unknown

23. Roadway Profile 2
 (1) Level
 (2) Uphill grade (> 2%)
 (3) Hill crest
 (4) Downhill grade (> 2%)
 (5) Sag
 (9) Unknown

24. Roadway Surface Type 2
 (1) Concrete
 (2) Bituminous (asphalt)
 (3) Brick or block
 (4) Slag, gravel, or stone
 (5) Dirt
 (8) Other (specify): _____
 (9) Unknown

25. Roadway Surface Condition 2

- (1) Dry
 (2) Wet
 (3) Snow or slush
 (4) Ice
 (5) Sand, dirt, or oil
 (8) Other (specify): _____
 (9) Unknown

26. Light Conditions 2

- (1) Daylight
 (2) Dark
 (3) Dark, but lighted
 (4) Dawn
 (5) Dusk
 (9) Unknown

27. Atmospheric Conditions 0

- (0) No adverse atmospheric-related driving conditions
 (1) Rain
 (2) Sleet/hail
 (3) Snow
 (4) Fog
 (5) Rain and fog
 (6) Sleet and fog
 (7) Other (e.g., smog, smoke, blowing sand or dust, etc.) (specify): _____
 (9) Unknown

28. Traffic Control Device 6

- (0) No traffic control(s)
 (1) Traffic control signal (not RR crossing)

Regulatory

- (2) Stop sign
 (3) Yield sign
 (4) School zone sign
 (5) Other regulatory sign (specify): _____

- (6) Warning sign (not RR crossing)
 (7) Unknown sign
 (8) Miscellaneous/other controls including RR controls (specify): _____

(9) Unknown

29. Traffic Control Device Functioning 2

- (0) No traffic control device
 (1) Traffic control device not functioning (specify): _____
 (2) Traffic control device functioning properly
 (9) Unknown

PRECRASH DRIVER RELATED DATA

30. Driver's Distraction/Inattention To Driving 9 9
 (Prior To Recognition Of Critical Event)
 (00) No driver present
 (01) Attentive or not distracted
 (02) Looked but did not see
Distractions
 (03) By other occupant(s). (specify): _____
 (04) By moving object in vehicle (specify): _____
 (05) While talking or listening to cellular phone (specify location and type of phone): _____
 (06) While dialing cellular phone (specify location and type of phone): _____
 (07) While adjusting climate controls
 (08) While adjusting radio, cassette, CD (specify): _____
 (09) While using other device/controls integral to vehicle (specify): _____
 (10) While using or reaching for device/object brought into vehicle (specify): _____
 (11) Sleepy or fell asleep
 (12) Distracted by outside person, object, or event (specify): _____
 (13) Eating or drinking
 (14) Smoking related
 (97) Distracted/inattentive, details unknown
 (98) Other, distraction (specify): _____
 (99) Unknown
31. Pre-Event Movement (Prior to Recognition of Critical Event) 1 4
 (00) No driver present
 (01) Going straight
 (02) Decelerating in traffic lane
 (03) Accelerating in traffic lane
 (04) Starting in traffic lane
 (05) Stopped in traffic lane
 (06) Passing or overtaking another vehicle
 (07) Disabled or parked in travel lane
 (08) Leaving a parking position
 (09) Entering a parking position
 (10) Turning right
 (11) Turning left
 (12) Making a U-turn
 (13) Backing up (other than for parking position)
 (14) Negotiating a curve
 (15) Changing lanes
 (16) Merging
 (17) Successful avoidance maneuver to a previous critical event
 (97) Other (specify): _____
 (99) Unknown
32. Critical Precrash Event 1 0
THIS VEHICLE LOSS OF CONTROL DUE TO:
 (01) Blow out or flat tire
 (02) Stalled engine
 (03) Disabling vehicle failure (e.g., wheel fell off) (specify): _____
 (04) Non-disabling vehicle problem (e.g., hood flew up) (specify): _____
 (05) Poor road conditions (puddle, pot hole, ice, etc.) (specify): _____
 (06) Traveling too fast for conditions
 (08) Other cause of control loss (specify): _____
 (09) Unknown cause of control loss

THIS VEHICLE TRAVELLING

- (10) Over the lane line on left side of travel lane
 (11) Over the lane line on right side of travel lane
 (12) Off the edge of the road on the left side
 (13) Off the edge of the road on the right side
 (14) End departure
 (15) Turning left at intersection
 (16) Turning right at intersection
 (17) Crossing over (passing through) intersection
 (18) This vehicle decelerating
 (19) Unknown travel direction

OTHER MOTOR VEHICLE IN LANE

- (50) Other vehicle stopped
 (51) Traveling in same direction with lower steady speed
 (52) Traveling in same direction while decelerating
 (53) Traveling in same direction with higher speed
 (54) Traveling in opposite direction
 (55) In crossover
 (56) Backing
 (59) Unknown travel direction of other motor vehicle in lane

OTHER MOTOR VEHICLE ENCROACHING INTO LANE

- (60) From adjacent lane (same direction)—over left lane line
 (61) From adjacent lane (same direction)—over right lane line
 (62) From opposite direction—over left lane line
 (63) From opposite direction—over right lane line
 (64) From parking lane
 (65) From crossing street, turning into same direction
 (66) From crossing street, across path
 (67) From crossing street, turning into opposite direction
 (68) From crossing street, intended path not known
 (70) From driveway, turning into same direction
 (71) From driveway, across path
 (72) From driveway, turning into opposite direction
 (73) From driveway, intended path not known
 (74) From entrance to limited access highway
 (78) Encroachment by other vehicle—details unknown

PEDESTRIAN, PEDALCYCLIST, OR OTHER NONMOTORIST

































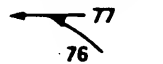
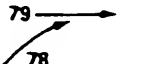
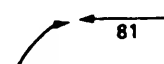
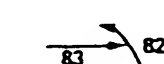
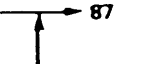

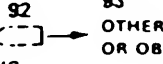

- (80) Pedestrian in roadway
 (81) Pedestrian approaching roadway
 (82) Pedestrian—unknown location
 (83) Pedalcyclist or other nonmotorist in roadway (specify): _____
 (84) Pedalcyclist or other nonmotorist approaching roadway, (specify): _____
 (85) Pedalcyclist or other nonmotorist—unknown location (specify): _____

OBJECT OR ANIMAL

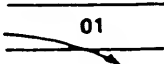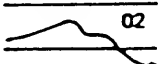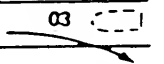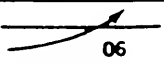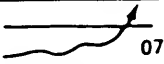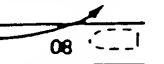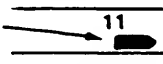- (87) Animal in roadway
 (88) Animal approaching roadway
 (89) Animal—unknown location
 (90) Object in roadway
 (91) Object approaching roadway
 (92) Object—unknown location
 (98) Other critical precrash event (specify): _____
 (99) Unknown
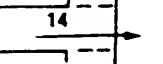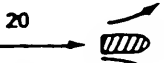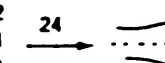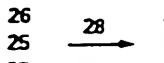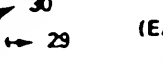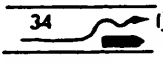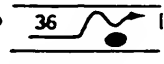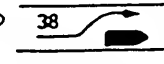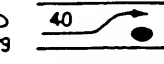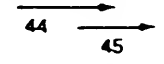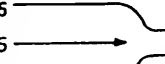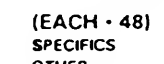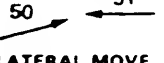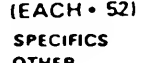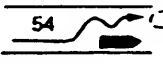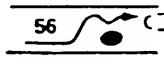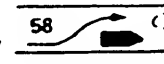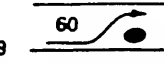
<p>33. Attempted Avoidance Maneuver <u>01</u></p> <p>(00) No driver present (01) No avoidance maneuver (02) Braking (no lockup) (03) Braking (lockup) (04) Braking (lockup unknown) (05) Releasing brakes (06) Steering left (07) Steering right (08) Braking and steering left (09) Braking and steering right (10) Accelerating (11) Accelerating and steering left (12) Accelerating and steering right (98) Other action (specify): _____ (99) Unknown</p> <p>34. Pre-Impact Stability <u>1</u></p> <p>(0) No driver present (1) Tracking (2) Skidding longitudinally—rotation less than 30 degrees (3) Skidding laterally—clockwise rotation (4) Skidding laterally—counterclockwise rotation (7) Other vehicle loss-of-control (specify): _____ (9) Precrash stability unknown</p>	<p>35. Pre-Impact Location <u>2</u></p> <p>(0) No driver present (1) Stayed in original travel lane (2) Stayed on roadway but left original travel lane (3) Stayed on roadway, not known if left original travel lane (4) Departed roadway (5) Remained off roadway (6) Returned to roadway (7) Entered roadway (9) Unknown</p> <p>36. Accident Type <u>50</u> (Note: Applicable codes on back of this page)</p> <p>(00) No impact Code the number of the diagram that best describes the accident circumstance (98) Other accident type (specify): _____ (99) Unknown</p>
--	--

STOP HERE IF GV07 DOES NOT EQUAL 01 - 49

Category	Configuration	ACCIDENT TYPES (Includes Intent)				
I Single Driver	A Right Roadside Departure	 01 DRIVE OFF ROAD	 02 CONTROL/ TRACTION LOSS	 03 AVOID COLLISION WITH VEH., PED., ANIM.	04 SPECIFICS OTHER	05 SPECIFICS UNKNOWN
	B Left Roadside Departure	 06 DRIVE OFF ROAD	 07 CONTROL/ TRACTION LOSS	 08 AVOID COLLISION WITH VEH., PED., ANIM.	09 SPECIFICS OTHER	10 SPECIFICS UNKNOWN
	C Forward Impact	 11 PARKED VEH.	 12 STA. OBJECT	 13 PEDESTRIAN/ ANIMAL	 14 END DEPARTURE	15 SPECIFICS OTHER 16 SPECIFICS UNKNOWN
II Same Trafficway Same Direction	D Rear-End	 20 STOPPED 21, 22, 23	 22 SLOWER 25, 26, 27	 24 DECEL. 29, 30, 31	 26 AVOID COLLISION WITH VEH.	(EACH • 32) SPECIFICS OTHER (EACH • 33) SPECIFICS UNKNOWN
	E Forward Impact	 34 CONTROL/ TRACTION LOSS	 36 CONTROL/ TRACTION LOSS	 38 AVOID COLLISION WITH VEH.	 40 AVOID COLLISION WITH OBJECT	(EACH • 42) SPECIFICS OTHER (EACH • 43) SPECIFICS UNKNOWN
	F Sideswipe Angle	 44 LATERAL MOVE	 46 LATERAL MOVE	 48 LATERAL MOVE	(EACH • 48) SPECIFICS OTHER	(EACH • 49) SPECIFICS UNKNOWN
III Same Trafficway Opposite Direction	G Head-On	 50 LATERAL MOVE	 51 LATERAL MOVE	(EACH • 52) SPECIFICS OTHER	(EACH • 53) SPECIFICS UNKNOWN	
	H Forward Impact	 54 CONTROL/ TRACTION LOSS	 56 CONTROL/ TRACTION LOSS	 58 AVOID COLLISION WITH VEH.	 60 AVOID COLLISION WITH OBJECT	(EACH • 62) SPECIFICS OTHER (EACH • 63) SPECIFICS UNKNOWN
	I Sideswipe Angle	 64 LATERAL MOVE	 66 LATERAL MOVE	(EACH • 66) SPECIFICS OTHER	(EACH • 67) SPECIFICS UNKNOWN	
IV Change Trafficway Vehicle Turning	J Turn Across Path	 68 INITIAL OPPOSITE DIRECTIONS	 71 INITIAL SAME DIRECTIONS	 73 INITIAL SAME DIRECTIONS	(EACH • 74) SPECIFICS OTHER (EACH • 75) SPECIFICS UNKNOWN	
	K Turn Into Path	 77 TURN INTO SAME DIRECTION	 79 TURN INTO SAME DIRECTION	 81 TURN INTO OPPOSITE DIRECTIONS	 83 TURN INTO OPPOSITE DIRECTIONS	(EACH • 84) SPECIFICS OTHER (EACH • 85) SPECIFICS UNKNOWN
V Intersecting Paths (Vehicle Damage)	L Straight Paths	 87 STRAIGHT PATHS	 89 STRAIGHT PATHS	(EACH • 90) SPECIFICS OTHER	(EACH • 91) SPECIFICS UNKNOWN	
VI Miscellaneous	M Backing Etc	 92 BACKING VEH.	 93 OTHER VEH OR OBJECT	98 Other Accident Type 99 Unknown Accident Type 00 No Impact		

OCCUPANT RELATED

37. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
38. Number of Occupants This Vehicle 01
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
39. Number of Occupant Forms Submitted 01

AIR BAG RELATED

40. Is this an AOPS Vehicle? 0
 (0) No (includes unknown)
 (1) Yes - researcher determined
 (2) VIN determined air bag system
 (3) VIN determined automatic (passive) belts
 (4) VIN determined air bag and automatic (passive) belts
41. Air Bag(s) Deployment, First Seat Frontal 0
 (0) Not equipped or not available
 (1) No air bags deployed
Single Air Bag Vehicle
 (2) Driver air bag deployed
 (3) Driver air bag, unknown if deployed
Multiple Air Bag Vehicle
 (4) Driver side only deployed
 (5) Passenger side only deployed
 (6) Driver and passenger side deployed
 (7) Driver and passenger side unknown if deployed
 (8) Air bag(s) deployed, details unknown
 (9) Unknown
42. Air Bag(s) Deployment, Other Than First Seat Frontal 0
 (0) Not equipped with an "other" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

Specify type of "other" air bag present: _____

VEHICLE WEIGHT ITEMS

43. Vehicle Curb Weight 1.600
 _____ Code weight to nearest 10 kilograms.
 (045) Less than 454 kilograms
 (612) 6,124 kilograms or more
 (999) Unknown
3532 lbs X 4536 = 1.602 kgs

Source: _____

44. Vehicle Cargo Weight 100
 _____ Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (454) 4,536 kilograms or more
 (999) Unknown
220 lbs X .4536 = 100 kgs

Source: _____

ROLLOVER DATA

45. Rollover 00
 (00) No rollover (no overturning)
Rollover (primarily about the longitudinal axis)
 (01-16) Code the number of quarter turns
 (17) Rollover, 17 or more quarter turns (specify): _____
 (98) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (99) Rollover (overturn), details unknown
46. Rollover Initiation Type 00
 (00) No rollover
 (01) Trip-over
 (02) Flip-over
 (03) Turn-over
 (04) Climb-over
 (05) Fall-over
 (06) Bounce-over
 (07) Collision with another vehicle
 (08) Other rollover initiation type specify): _____
 (98) Rollover--end-over-end
 (99) Unknown rollover initiation type
47. Location of Rollover Initiation 0
 (0) No rollover
 (1) On roadway
 (2) On shoulder--paved
 (3) On shoulder--unpaved
 (4) On roadside or divided trafficway median
 (8) Rollover--end-over-end
 (9) Unknown
48. Rollover Initiation Object Contacted 00
 (Note: Applicable codes on back of page)
49. Location on Vehicle Where Initial Principal Tripping Force Is Applied 0
 (0) No rollover
 (1) Wheels/tires
 (2) Side plane
 (3) End plane
 (4) Undercarriage
 (5) Other location on vehicle (specify): _____
 (6) Non-contact rollover forces (specify): _____
 (8) Rollover--end-over-end
 (9) Unknown
50. Direction of Initial Roll 0
 (0) No rollover
 (1) Roll right - primarily about the longitudinal axis
 (2) Roll left - primarily about the longitudinal axis
 (8) Rollover--end-over-end
 (9) Unknown roll direction

OVERRIDE/UNDERRIDE (THIS VEHICLE)

51. Front Override/Underride (this Vehicle) 0
52. Rear Override/Underride (this Vehicle) 0
- (0) No override/underride, or not an end-to-end impact between two CDS applicable vehicles, and no medium/heavy truck or bus underride
- Override (see specific CDC)*
(Between 2 CDS applicable vehicles (Bodytype, GV07 = 1-49))
- (1) 1st CDC
 (2) 2nd CDC
 (3) Other not automated CDC (specify):

- Underride (see specific CDC)*
(Between 2 CDS applicable vehicles (Bodytype, GV07 = 1-49))
- (4) 1st CDC
 (5) 2nd CDC
 (6) Other not automated CDC (specify):

- (7) Medium/heavy truck or bus override (of any configuration)
 (9) Unknown

HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V

Values: (000)-(359) Code actual value
 (996) Non-horizontal impact
 (997) Noncollision
 (998) Impact with object
 (999) Unknown

53. Heading Angle For This Vehicle 245
54. Heading Angle For Other Vehicle 090

RECONSTRUCTION DATA

55. Towed Trailing Unit 0
- (0) No towed unit
 (1) Yes—towed trailing unit
 (9) Unknown
56. Documentation of Trajectory Data for This Vehicle 0
- (0) No
 (1) Yes
57. Post Collision Condition of Tree or Pole (For Highest Delta V) 0
- (0) Not collision (for highest delta V) with tree or pole
 (1) Not damaged
 (2) Cracked/sheared
 (3) Tilted < 45 degrees
 (4) Tilted ≥ 45 degrees
 (5) Uprooted tree
 (6) Separated pole from base
 (7) Pole replaced
 (8) Other (specify):

- (9) Unknown

ACCIDENT RECONSTRUCTION PROGRAMS HIGHEST DELTA V

58. Basis for Total (Resultant) Delta V (highest) 03

(00) No vehicle inspection

Delta V Calculated

- (01) Reconstruction program—damage only routine
 (02) Reconstruction program—damage and trajectory routine
 (03) Missing vehicle algorithm

Delta V Not Calculated

- (04) At least one vehicle (which may be this vehicle) is beyond the scope of an acceptable reconstruction program, regardless of collision conditions.

All vehicles within scope (CDC applicable) of reconstruction program but one of the collision conditions is beyond the scope of the reconstruction program or other acceptable reconstruction technique, regardless of adequacy of damage data.

- (05) Rollover
 (06) Other non-horizontal forces
 (07) Sideswipe type damage
 (08) Severe override
 (09) Yielding object
 (10) Overlapping damage
 (11) All vehicle and collision conditions are within scope of one of the acceptable reconstruction programs, but there is insufficient data available, (specify):

- (98) Other, (specify): _____

COMPUTER GENERATED CRASH SEVERITY

59. Total Delta V

Highest

48 Nearest kmph (highest) Nearest kmph (secondary)

(NOTE: 000 means less than 0.5 kmph)
 (160) 159.5 kmph and above
 (999) Unknown

60. Longitudinal Component of Delta V

Highest

-48 Nearest kmph (highest) Nearest kmph (secondary)

(NOTE: 000 means greater than
 -0.5 kmph and less than +0.5 kmph)
 (±160) ±159.5 kmph and above
 (999) Unknown

61. Lateral Component of Delta V

Highest

-4 Nearest kmph (highest) Nearest kmph (secondary)

(NOTE: 000 means greater than -0.5 kmph and
 less than +0.5 kmph)
 (±160) ±159.5 kmph and above
 (999) Unknown

62. Energy Absorption

Highest

168,912 Nearest 100 joules (highest) Nearest 100 joules (secondary)

(NOTE: 0000 means less than 50 joules)
 (9997) 999,650 joules or more
 (9999) Unknown

63. Impact Speed

Highest

 Nearest kmph (highest) Nearest kmph (secondary)

(NOTE: 000 means
 less than 0.5 kmph)
 (160) 159.5 kmph and above
 (998) Trajectory algorithm not run
 (999) Unknown

DELTA V CONFIDENCE LEVEL

64. Confidence In Reconstruction Program Results (For Highest Delta V)

- (0) No reconstruction 1
 (1) Collision fits model — results appear reasonable
 (2) Collision fits model — results appear high
 (3) Collision fits model — results appear low
 (4) Borderline reconstruction — results appear reasonable

OTHER SPEED ESTIMATE

65. Barrier Equivalent Speed

Highest

45.8 Nearest kmph (highest) Nearest kmph (secondary)

(NOTE: 000 means
 less than 0.5 kmph)
 (160) 159.5 kmph and above
 (999) Unknown

ESTIMATED DELTA V		INSPECTION TYPE	
66. Estimated Highest Delta V (Researcher Determined) <u>0</u>		67. Type of Vehicle Inspection <u>0</u>	
(0) Reconstruction Delta V coded		(0) No inspection	
<i>Estimated Delta V</i>		(1) Vehicle fully repaired-no damage evident	
(1) Less than 10 kmph		(2) Partial inspection (specify):	
(2) ≥ 10 kmph but < 25 kmph		(3) Complete inspection	
(3) ≥ 25 kmph but < 40 kmph			
(4) ≥ 40 kmph but < 55 kmph			
(5) ≥ 55 kmph			
<i>Other estimates of damage severity</i>			
(6) Minor			
(7) Moderate			
(8) Severe			
(9) Unknown			
		DELTA V EVENT NUMBER	
		68. Delta V Event Number <u>1</u>	
		Code the accident event sequence number that resulted in the Delta V that has been coded above for this vehicle	
		(99) Unknown	
*** IF THE CDS APPLICABLE VEHICLE WAS NOT INSPECTED (I.E., GV67 = 0), ***			
DO NOT COMPLETE THE EXTERIOR AND INTERIOR VEHICLE FORMS			
*** IF GV07 DOES NOT EQUAL 01-49, DO NOT COMPLETE ***			
THE EXTERIOR VEHICLE, INTERIOR VEHICLE,			
OCCUPANT ASSESSMENT, AND OCCUPANT INJURY FORMS.			

EXTERIOR VEHICLE FORM

**NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM**

1. Primary Sampling Unit Number	<u>10</u>	3. Vehicle Number	<u>02</u>
2. Case Number - Stratum	<u>9616</u>		

VEHICLE IDENTIFICATION

VIN 1GTD C14H2GJ _____ Model Year 86
Vehicle Make (specify): GMC _____ Vehicle Model (specify): SIERRA CLASSIC pickup

LOCATOR

Locate the end of the damage with respect to the vehicle's damaged center point or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L	Location of Max Crush
	* VEHICLE NOT INSPECTED		

CRUSH PROFILE IN CENTIMETERS

NOTES: Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.

Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.

Use as many lines/columns as necessary to describe each damage profile.

[illegible]

ORIGINAL SPECIFICATIONS WORK SHEET

BEST AVAILABLE

Wheelbase 117.5 inches x 2.54 = 298.5 cm
 Overall Length 193.5 inches x 2.54 = 491.5 cm
 Maximum Width 79.6 inches x 2.54 = 202.2 cm
 Curb Weight 3,532 pounds x 0.4536 = 1,602 kg
 Average Track inches x 2.54 = cm
 Front Overhang 33.8 inches x 2.54 = 86 cm
 Rear Overhang 42.2 inches x 2.54 = 107 cm
 Undeformed End Width inches x 2.54 = cm
 Engine Size: cyl/disl. cc x 0.001 = 5.0 L
305 CID x 0.0164 = 5.0 L


Branhams Shipping 3,282
 Weight V-6 100
 V-6 to V-8 100
3,482
 Gasoline Truck Index
 Curb Weight V-6 3,432
 V-6 to V-8 100
3,532

SPECIAL CRASH INVESTIGATION ADDENDUM


Submodel Designation: {specify}		Color: {specify} <u>Blue</u>	Repair Cost: \$
Transmission: {circle} Automatic Manual		Speed: 3-speed 4-speed 5-speed Other:	
Steering: {circle}	Power-assisted Manual	Type: rack-and-pinion worm-and-gear <u>Other</u>	
{please describe}: <u>? Either</u>		<u>recirculating ball gear</u>	
Brakes: {circle}	Power-assisted Manual	Type: 4-wheel disc 4-wheel drum 4-wheel hydraulic	
<u>? Either</u>		<u>front disc, rear drum</u> Other:	
Observed Defects: {specify}			
Fleet Type: {circle} <u>Private vehicle</u> Rental vehicle Leased vehicle Commercial vehicle Other			
{please describe}:			

VEHICLE DAMAGE SKETCH




TIRE—WHEEL DAMAGE a. Rotation physically restricted RF <u>2</u> LF <u>9</u> RR <u>2</u> LR <u>2</u> (1) Yes (2) No (8) NA (9) Unk.		Tire deflated RF <u>2</u> LF <u>1</u> RR <u>2</u> LR <u>2</u>		ORIGINAL SPECIFICATIONS Wheelbase <u>298</u> cm Overall Length <u>491</u> cm Maximum Width <u>202</u> cm Curb Weight <u>1,602</u> kg Average Track <u>UNK</u> cm Front Overhang <u>86</u> cm Rear Overhang <u>107</u> cm Undeformed End Width <u>UNK</u> cm Engine Size: cyl./displ. <u>V-8 5.0</u> L		WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only) RF ± _____ ° LF ± _____ ° RR ± _____ ° LR ± _____ ° Within ± 5 degrees	
TYPE OF TRANSMISSION <input type="checkbox"/> Manual <input type="checkbox"/> Automatic END SHIFT ≥ 10 CM <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No				DRIVE WHEELS <input type="checkbox"/> FWD <input checked="" type="checkbox"/> RWD <input type="checkbox"/> 4WD		Approximate Cargo Weight <u>100</u> kg	

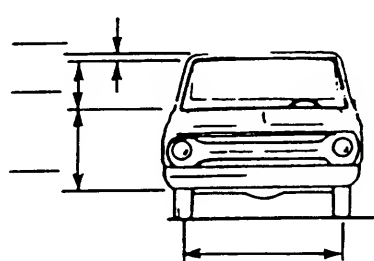

MEASUREMENTS IN CENTIMETERS

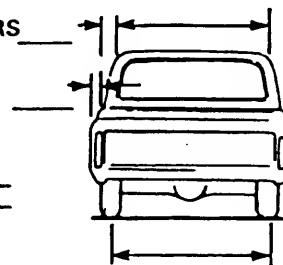

*VEHICLE NOT INSPECTED
 Damage per photographs

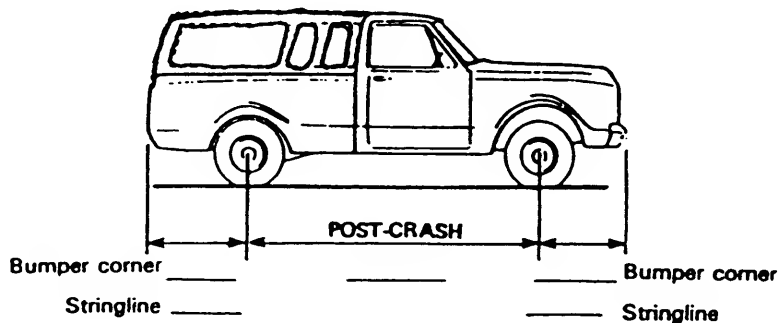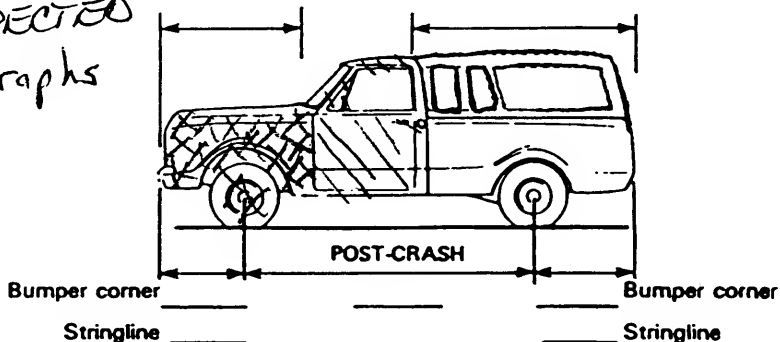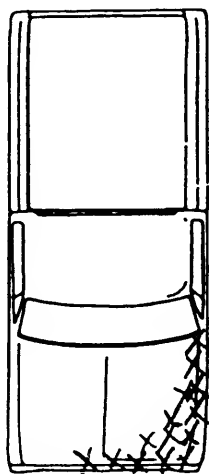

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

BRANHAM AUTOMOBILE REFERENCE BOOK

GMC Truck and Coach Div., General Motors Corp.,

Model	No. Cyl.	Bore & Stroke	Tax. H.P.	Max. G.V.W.	Type of Body	Ship. Wgt.	Ins. W.B.	Wgt. Class	List Price
-------	----------	---------------	-----------	-------------	--------------	------------	-----------	------------	------------

1985

Application (FT6), 18M lbs. cap. (Rockwell FL941), add 419 lbs. \$2360. Power Steering, add 81 lbs. \$723. Front Suspension: 18M lbs. cap., add 134 lbs. \$88. Cab Equipment: (X77) Five Star General, add 24 lbs. \$306; (BNZ) (Sleeper Box—Alum. 34") \$600. Dragfoiler, add 57 lbs. \$610. Power Windows: L.H. and R.H., add 3 lbs. \$125. Radio: Delco AM—without sleeper box, add 7 lbs. \$174; with sleeper box, add 11 lbs. \$225.

ASTRO GLIDER 9500 SERIES—Detroit Diesel Eng. 6V-92T; 55" BBC Cab, Dual Air Brakes.

D9K020 6 4.84x5.0 56.2 Variable Front End Only 4445 F. Variable NA \$22,289
Optional Equip.: Front Axle: Tractor Application (FT6) 18M lbs., Rockwell FL941, add \$2552. Power Steering, Sheppard Gear only, add 105 lbs. \$723. Front Suspension: 18M lbs. \$88. Dragfoiler (Reduces air drag), add 66 lbs. \$610. Radio Delco AM, add 10 lbs. \$174; AM/FM, add 10 lbs. \$350. Windows, power operated R.H. & L.H., add 2 lbs. \$250. Air Conditioning Provisions, add 40 lbs. \$296.

ASTRO SLEEPER GLIDER SERIES—Dell Diesel Eng. 6V-92T—87" BBC Cab, Dual Air Brakes.

D9L020 6 4.84x5.0 56.2 Variable Front End Only 4486 Variable NA \$23,623
Optional Equip.: Cab Equip.: (E21) 24" Sleeper Cab, Dix. Alum. \$603. For other equip., see Model D9K020.

1986

LIGHT DUTY CONVENTIONAL MODELS—GASOLINE—2 & 4-WHEEL DRIVES, PICKUP (PU)

S-10/15 Series, 2-Wheel Drive (2.5 L. (151) L4 EFI Gas. Eng., 4-Spd. Manual. (EC) Extended Cab

S10603	4	4.00x3.00	25.60	4,800	6' PU (X96)	2,475	108.3"	L	\$7,046
S10803				5,000	7'5" PU (E63)	2,546	117.9"	L	7,281
S10653				5,100	6' PU EC (E63)	2,614	122.9"	L	7,733
S10603-E63				5,100	6' PU (X81)	2,475	108.3"	L	5,990

S-10/15 Series, 4-Wheel Drive (2.5 L. (151) L4 EFI Gas Eng., 4-Spd. Manual; (EC) Extended Cab.

T10603	4	4.00x3.00	25.60	4,984	6' PU (E63)	2,806	108.3"	L	\$8,907
T10803				5,368	7'5" PU (E63)	2,853	117.9"	L	9,065
T10653				5,368	6' PU EC (E63)	2,932	122.9"	L	9,393

Optional Equip.: Engine: 2.8 L., V6, EFI, T1 Series: LL2, \$275.00; Trans. 4-spd. Auto. w/O.D. \$695; 5-spd. Manual w/O.D. \$175; Air Conditioning: \$740; Power Door Locks \$135; Radio: AM/FM \$82; Electronic Speed Controls \$195; Tilt Steering Wheel \$115; Power Windows \$190; Power Steering \$260.

C/K PICKUP—REGULAR CAB Gas Engine: 4.3 L. (262) V6-4-bbl. (LBI) Gas Eng.

C18/C1500 Series, 2-Wheel Drive; Fenderside/Wideside (F/W); Stepside/Fenderside (S/F)

Body Codes—E62, E63, C6P, B3J

C10703	6	4.00x3.48	38.40	4,900	6'5" (E62)	3,282	117.5"	L	\$7,955
C10703				4,900	6'5" (E63)	3,282	117.5"	L	7,815
C10903				4,900	8' (E63)	3,445	131.5"	L	7,989

C28/2500 Series, 2-Wheel Drive

C20903	6	4.00x3.48	38.40	6,400	8' F/W (E63)	3,842	131.5"	L	\$9,164
C20903 w/C6P				6,400	8' S/F (E62)	3,939	131.5"	L	9,304

K18/1500 Series, 4x4

K10703	6	4.00x3.48	38.40	6,100	6'5" F/W (E63)	3,871	117.5"	L	\$10,375
K10703				6,100	6'5" S/F (E62)	3,871	117.5"	L	10,516
K10903				6,100	8' F/W (E63)	4,050	131.5"	L	10,552

Gas Engine: 4.8 L. (292) L6, 1-bbl. (Code L25)

C28/C2500/C6P Series: H.D. Chassis, 2-Wheel Drive (Body Codes: (A) E62/C6P; (B) E63/C6P)

C20903	6	3.88x4.12	36.13	6,400	8' F/W (B)	3,996	131.5"	L	\$10,153
C20903				6,400	8' S/F (A)	3,939	131.5"	L	10,292




C20/2500 Series: 2 W.D. Bonus Cab (BC), Crew Cab (CC); (1) E63/Y64; (2) E63/AS3.

C20943	6	3.88x4.12	36.13	8,600	8' BC (F/W)(1)	4,623	164.5"	L	\$11,150
C20943				8,600	8' CC (F/W)(1)	4,684	164.5"	L	11,498

C30/3500 Series: 2 W.D.

C30903	6	3.88x4.12	36.13	9,000	8' (F/W) (E63)	4,276	131.5"	L	\$10,238
C30903				9,000	8' SF (E62)	4,276	131.5"	L	10,377

GMC PICKUPS—C-K-1500, 2500, 3500

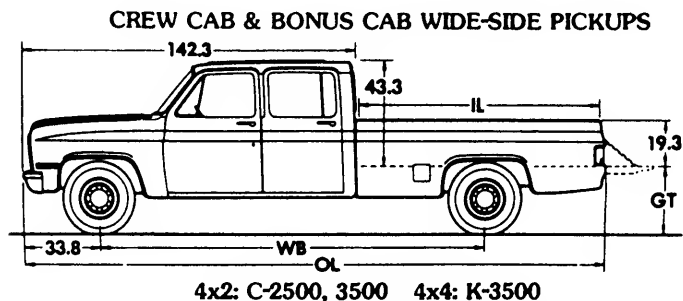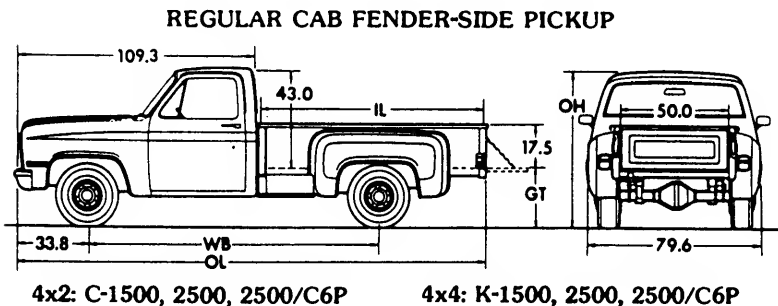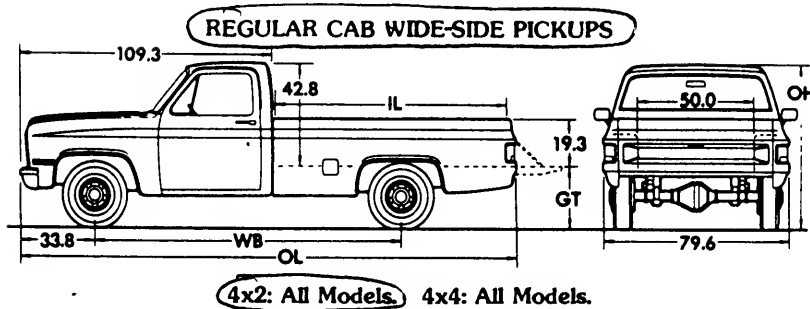

GASOLINE TRUCK INDEX

GMC PICKUPS -- C-1500 SERIES

GVW Ratings: 4,900-6,100 Lbs.

ENGINE: Standard: GMC 4.3L 262-4 V6, 155 NHP @ 4000 RPM.
Optional: GMC 5.0L 305-4 V8, 160 NHP @ 4400 RPM.
Calif. engines: GMC 4.3L 262-4 V6, 155 NHP @ 4000 RPM.
GMC 5.0L 305-4 V8, 155 NHP @ 4000 RPM.

MODELS AVAILABLE: 6.5' or 8' Wide-Side or Fender-Side Pickup body, Regular cab.

GVW RATING	MINIMUM EQUIPMENT REQUIRED FOR GVW RATING
4,900	Standard
5,200	Vacuum Power Hyd. Brakes w/9.5" dia. vacuum booster; P205/75R15 tires.
5,600	1,750 lb. HD r. springs; Vacuum Power Hyd. Brakes w/9.5" dia. vacuum booster; P205/75R15 tires.
6,100	2,000 lb. HD rear springs; Power assist Hyd. brakes, 11.86 x 1.28" disc front & 11.15 x 2.75 drum rear; P235/75R15 tires.

CURB WEIGHTS & DIMENSIONS: (Standard equipment, 6-cyl. engine)							
Model	Front	Rear	Total	WB	IL	OH	OL
C10703 Wideside	2,009	1,423	3,432	117.5	78.2	69.2	193.5
C10903 Wideside	2,088	1,507	3,595	131.5	98.1	69.2	212.2
C10703 Fenderside	2,007	1,378	3,385	117.5	78.4	69.5	191.1

GENERAL SPECIFICATIONS

FRONT AXLE: Independent front suspension, rated capacity 2,950 lbs., 7.6" clearance (7.5" w/Fender-Side pickup).

REAR AXLE: Salisbury axle, single reduction, hypoid drive, 3,750 lb. capacity, 2.73 ratio, 7.3" clearance (7.2" w/Fender-Side pickup). Optional: Standard axle with 3.08, 3.42, or 3.73 ratios; locking differential rear axle.

SERVICE BRAKES: Hydraulic, self-adjusting, 11.86 x 1.04" rotor disc front 239.6 sq. in. swept front area, 11 x 2" drum rear 138.2 sq. in. swept area. Optional: Vacuum Hydraulic, incl. 9.5" dia. single diaphragm vacuum power booster, 11.86 x 1.00" disc front & 11 x 2" drum rear brakes; Vacuum Hydraulic, incl. 9.5 x 8 dia. Dual diaphragm vacuum booster, 11.86 x 1.29" disc front & 11.15 x 2.75 drum rear, 192.7 sq. in swept area, includes hyd. power booster.

PARKING BRAKES: Cable to rear wheels.

CLUTCH: Single plate, dry disc, 11" dia., 124 sq. in. frictional area.

GASOLINE TRUCK INDEX

GASOLINE TRUCK INDEX

OPTIONAL EQUIPMENT: High Sierra or Sierra Classic custom options; air conditioning; increased capacity electrical and cooling systems; Glide-out, or side mounted spare wheel carrier; Cold Climate package; Automatic speed control; Calif. or High Altitude emission systems; Operating Convenience package; Rear bumper; Power windows & locks; HD shocks; Pickup box side rails; 9 x 6.5 or 7.5 x 10.5 side mirrors; Radio equipment; 3-speed windshield wipers; 1" front stabilizer bar.

GASOLINE TRUCK INDEX

MODEL	2.5L 151-EFI L4	2.8L 173-EFI V6	4.3L 262-EFI V6
Available with	Safari & S-15	S-15	Caballero
Type	Valve-in-Head	Valve-in-Head	Valve-in-Head
Displacement	151.0 cu. in.	173.0 cu. in.	262.0 cu. in.
Bore and Stroke	4.00 x 3.00	3.50 x 2.99	4.00 x 3.48
Net Horsepower	92 @ 4400*	125 @ 4800*	140 @ 4000*
Net Torque	134 @ 2800*	150 @ 2200*	225 @ 2000*
Compression Ratio	9.0 to 1	8.5 to 1	9.3 to 1
Carburetor/Injector	-----Rochester Throttle Body Injection-----		
MODEL	4.3L 262-4 V6	4.8L 292-1 IL-Six	4.8L 292-1 IL-Six
Available with	C/K1500, & C2500	G/K/P2500, 3500	C/K/P2500, 3500
Type	Valve-in-Head	Valve-in-Head	Valve-in-Head
Displacement	262 cu. in.	262 cu. in.	292 cu. in.
Bore and Stroke	4.00 x 3.48	4.00 x 3.48	3.88 x 4.12
Net Horsepower	155 @ 4000*	145 @ 4000*	115 @ 4000*(F)
Net Torque	230 @ 2400*	225 @ 2400*	210 @ 800*(F)
Compression Ratio	9.3 to 1	9.3 to 1	7.8 to 1
Carburetor	Rochester 4-bbl	Rochester 4-bbl	Rochester 1-bbl
MODEL	5.0L 305-4 V8	5.0L 305-4 V8	5.7L 350-4 V8
Available with	Caballero	Caballero	C/K/G1500-3500
Type	Valve-in-Head	Valve-in-Head	Valve-in-Head
Displacement	305 cu. in.	305 cu. in.	350 cu. in.
Bore and Stroke	3.74 x 3.48	3.74 x 3.48	4.00 x 3.48
Net Horsepower	150 @ 4000*	160 @ 4400*(F)	165 @ 3800*
Net Torque	240 @ 2000*	235 @ 2000*(F)	275 @ 1600*
Compression Ratio	9.5 to 1	9.2 to 1	8.2 to 1
Carburetor	Rochester 4-bbl	Rochester 4-bbl	Rochester 4-bbl
* - Light Duty emission, 8,500 lb. GVWR and below.	(C) - Available in California only.		
** - Heavy Duty emission, 8,501 lb. GVWR and above.	(F) - Avail. in All States except Calif.		

GMC

CDC WORKSHEET

CODES FOR OBJECT CONTACTED

(01-30) – Vehicle Number

Noncollision

- (31) Overturn — rollover (excludes end-over-end)
(32) Rollover — end-over-end
(33) Fire or explosion
(34) Jackknife
(35) Other intraunit damage (specify):

- (36) Noncollision injury
(38) Other noncollision (specify):

- (39) Noncollision — details unknown

Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
(42) Tree (> 10 cm in diameter)
(43) Shrubbery or bush
(44) Embankment

- (45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
(51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
(52) Pole or post (> 30 cm in diameter)
(53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
(55) Impact attenuator
(56) Other traffic barrier (includes guardrail)
(specify):

- (57) Fence
(58) Wall
(59) Building
(60) Ditch or culvert
(61) Ground
(62) Fire hydrant
(63) Curb
(64) Bridge
(68) Other fixed object (specify):

- (69) Unknown fixed object

Collision with Nonfixed Object

- (70) Passenger car, light truck, van, or other vehicle not in-transport
(71) Medium/heavy truck or bus not in-transport
(72) Pedestrian
(73) Cyclist or cycle
(74) Other nonmotorist or conveyance

- (75) Vehicle occupant
(76) Animal
(77) Train
(78) Trailer, disconnected in transport
(79) Object fell from vehicle in-transport
(88) Other nonfixed object (specify):

- (89) Unknown nonfixed object

- (98) Other event (specify):

- (99) Unknown event or object

DEFORMATION CLASSIFICATION BY EVENT NUMBER

[illegible]

COLLISION DEFORMATION CLASSIFICATION**HIGHEST DELTA "V"**

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>01</u>	6. <u>12</u>	7. <u>F</u>	8. <u>Y</u>	9. <u>E</u>	10. <u>W</u>	11. <u>04</u>

Second Highest Delta "V"

12. _____ 13. _____ 14. _____ 15. _____ 16. _____ 17. _____ 18. _____ 19. _____

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. L	21. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	22. ±D
_____	_____	_____	_____	_____	_____	_____	_____
							+
							=

Second Highest Delta "V"

23. L	24. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	25. ±D
_____	_____	_____	_____	_____	_____	_____	_____
							+
							=

26. Undeformed End Width

(Coded when highest severity impact is an end plane impact.)

_____ Code to the nearest centimeter

(250) 250 centimeters or more

(998) No highest severity end plane impact

(999) Unknown

999

27. Direct Damage Width

(For highest severity impact)

_____ Code to the nearest centimeter

(250) 250 centimeters or more

(999) Unknown

999

28. Original Wheelbase

298 Code to the nearest centimeter

(650) 650 centimeters or more

(999) Unknown

117.5 inches X 2.54 = 298 centimeters

298

29. Original Average Track Width

_____ Code to the nearest centimeter

(185) 185 centimeters or more

(999) Unknown

_____ inches X 2.54 = _____ centimeters

999

**NASS CDS INTERVIEW FORM:
CASE VEHICLE DRIVER**



INTERVIEW FORM (A)

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number 10

Interviewee(s) Role or Name(s): FATHER OF
DRIVER

2. Case Number - Stratum 96 16

3. Vehicle Number 01

Phone number: _____

Review all available information and interview questions prior to conducting interview(s) to ensure the acquisition of all pertinent data.

If the driver was not the person interviewed, was an appointment made for a follow-up interview?

DRIVER'S DESCRIPTION OF ACCIDENT EVENTS

Not Applicable

Roof in vehicle twice


OCCUPANT'S DESCRIPTION OF ACCIDENT EVENTS

Not Applicable

SPECIFIC QUESTIONS TO ASK INTERVIEWEE

High School Teacher
came by scene and talked to Father

ACCIDENT DIAGRAM



Use this diagram to aid in relating interviewee accident trajectory data (i.e., pre-impact to FRP orientations) to identifiable objects in the environment.

NORTH

AS PER AN INTERVIEW WITH A WESTBOUND WITNESS 5-TO-6 VEHICLES BEHIND VEHICLE #2, THE PICKUP TRUCK (V-2) HAD BEEN PASSING VEHICLES RECKLESSLY AND AT HIGH SPEEDS FOR OVER 8 MILES. THE ROAD IS HILLY AND TWISTING. VEHICLE #2 WAS REPORTED TO HAVE PASSED ON DOUBLE-SOLID YELLOW CENTRELINES. TRAFFIC DENSITY WAS HIGH FOR WESTBOUND VEHICLES AS A CONCERT HAD ENDED SOME FIVE MILES EAST OF THE CRASH SCENE. ACCORDING TO THE WITNESS, NO ONE WAS CLOSE ENOUGH TO VEHICLE #2 TO SEE THE IMPACT WITH THE CASE VEHICLE. THE WITNESS REPORTEDLY CONVERSED WITH OCCUPANTS OF A VEHICLE FIRST IN LINE BEHIND V-2.

SPECIFIC QUESTIONS FOR THE RESIDENT PATHOLOGIST WHO PERFORMED THE AUTOPSIES

	Case Vehicle's Driver	Case Vehicle's Right Front Occupant
Did you determine of the amount (in millimeters) of subluxation (dislocation)?	Do not measure	Do not measure
Did you determine the direction of the subluxation (i.e., anterior, posterior, lateral, superior, or some combination)?	Posteriorly	Posteriorly
Each occupant's autopsy states: "The spinal cord is not examined." Were the spinal cords not examined because they:		
"most likely" did not sustain any lesions, or "most likely" did sustain lesions?	The spinal cord is assumed injured when an atlanto-occipital subluxation occurs	The spinal cord is assumed injured when an atlanto-occipital subluxation occurs
The right front passenger's autopsy indicated that she sustained a lacerated basilar artery as a result of the subluxation. Did you determine whether the laceration was:		
"most likely" a shearing type (transection) injury, or "most likely" was a tension type (stretching) injury?		The lesion was a stretching (tension) type injury rather than a shearing type injury because there were no cervical fractures
The autopsy indicated that the injuries were of the deceleration type, as opposed to the impact type. What do you think caused the deceleration injury?		Suspected that this occupant's head hyperflexed backwards over the top of her seatback
Were you aware that the driver and right front passenger were occupants of an air bag-equipped vehicle when you performed their autopsies?	No	No

CRASH DATA INFORMATION

IF POSSIBLE OBTAIN THIS INFORMATION FROM THE DRIVER:

SOURCE OF INFORMATION:	<input type="checkbox"/> Driver <input type="checkbox"/> Other occupant <input checked="" type="checkbox"/> Relative/friend
TRAVEL DIRECTION?	<input type="checkbox"/> North <input type="checkbox"/> South <input checked="" type="checkbox"/> East <input type="checkbox"/> West (Or where were they coming from or going to?)
LANE?	<input checked="" type="checkbox"/> 1 <input type="checkbox"/> 2 <input type="checkbox"/> 3 <input type="checkbox"/> 4 <input type="checkbox"/> Other Note: lane 1 is the right curb lane
ROAD CONDITION?	<input type="checkbox"/> Dry <input type="checkbox"/> Wet <input type="checkbox"/> Snow <input type="checkbox"/> Slush <input type="checkbox"/> Ice <input type="checkbox"/> Sand, dirt, oil <input type="checkbox"/> Other (specify) PAR
WEATHER CONDITIONS? (Check all that apply)	<input type="checkbox"/> No adverse conditions PAR <input type="checkbox"/> Rain <input type="checkbox"/> Fog <input type="checkbox"/> Sleet <input type="checkbox"/> Hail <input type="checkbox"/> Snow <input type="checkbox"/> Other (specify)
SIGN OR SIGNAL PRESENT? (check all that apply)	<input type="checkbox"/> Traffic control signal (includes flashing beacons, lane control signals, and green / amber / red signal) <input type="checkbox"/> Stop sign <input type="checkbox"/> Yield sign <input type="checkbox"/> School zone sign <input type="checkbox"/> Other regulatory sign (No "U" turn, left turn only, wrong way, etc.) specify: _____ <input type="checkbox"/> Warning sign (Winding road sign, stop ahead, intersection signs, etc.) specify: _____ <input checked="" type="checkbox"/> Miscellaneous control (including railroad controls) specify: _____ <input checked="" type="checkbox"/> None ST <input type="checkbox"/> Unknown
WAS THE CONTROL FUNCTIONING PROPERLY?	<input checked="" type="checkbox"/> No traffic control device present <input type="checkbox"/> Not functioning properly (includes defaced, badly worn, covered with snow, rotated etc.) specify: _____ <input type="checkbox"/> Functioning properly <input type="checkbox"/> Unknown
SPEED BEFORE THE IMPACT? (in mph)	<input type="checkbox"/> Stopped <input type="checkbox"/> 11-20 <input type="checkbox"/> 31-40 <input type="checkbox"/> 51-60 <input type="checkbox"/> 70+ PAR <input type="checkbox"/> 1-10 <input type="checkbox"/> 21-30 <input type="checkbox"/> 41-50 <input type="checkbox"/> 61-70 <input type="checkbox"/> Unknown
BEFORE IMPACT, INTENDING TO ... ? (check all that apply)	<input type="checkbox"/> Go straight <input type="checkbox"/> Stopped <input type="checkbox"/> Turn left <input type="checkbox"/> Turn right <input type="checkbox"/> Slow down <input type="checkbox"/> Accelerate <input type="checkbox"/> Back up <input type="checkbox"/> Change lanes to right <input type="checkbox"/> Other (specify): PAR <input type="checkbox"/> Change lanes to left
CONTROL LOSS DUE TO WEATHER OR MECHANICAL PROBLEMS?	<input type="checkbox"/> No PAR <input type="checkbox"/> Unknown <input type="checkbox"/> Yes (describe)
AVOIDANCE ACTIONS?	<input type="checkbox"/> None <input type="checkbox"/> Braking with lock-up <input type="checkbox"/> Accelerating <input checked="" type="checkbox"/> Unknown <input type="checkbox"/> Braking without lock-up <input type="checkbox"/> Steering left <input type="checkbox"/> Other- specify: <input type="checkbox"/> Releasing brakes <input type="checkbox"/> Steering right
LOCATION OF VEHICLE AT TIME OF IMPACT?	<input checked="" type="checkbox"/> Original travel lane <input type="checkbox"/> Different travel lane <input type="checkbox"/> In intersection <input type="checkbox"/> Off roadway to right <input type="checkbox"/> Off roadway to left <input type="checkbox"/> Other (specify): _____
SPEED AT THE TIME OF IMPACT? (in mph)	<input type="checkbox"/> Stopped <input type="checkbox"/> 11-20 <input type="checkbox"/> 31-40 <input type="checkbox"/> 51-60 <input type="checkbox"/> 70+ <input type="checkbox"/> 1-10 <input type="checkbox"/> 21-30 <input type="checkbox"/> 41-50 <input type="checkbox"/> 61-70 <input checked="" type="checkbox"/> Unknown
DESCRIBE ALL THE IMPACTS to the vehicle and how this vehicle moved to its stopped position, after the collision?	No first hand knowledge

VEHICLE INFORMATION

ROLLOVER DATA

DID THIS VEHICLE ROLL OVER DURING THE CRASH?

SI

☐ YES -- ASK THE FOLLOWING QUESTIONS☒ NO -- SKIP TO "FIRE DATA" BELOW
☐ UNKNOWN -- SKIP TO "FIRE DATA" BELOW

ROLLOVER BEGAN	<input type="checkbox"/> On roadway <input type="checkbox"/> On shoulder <input type="checkbox"/> On roadside or median <input type="checkbox"/> Unknown
ROLLOVER CAUSE?	<input type="checkbox"/> Other vehicle (specify vehicle number) _____ <input type="checkbox"/> Contact to object (specify): _____ <input type="checkbox"/> Other cause (specify): _____ <input type="checkbox"/> Unknown
DIRECTION OF VEHICLE ROLL?	<input type="checkbox"/> Toward the right (passenger side) <input type="checkbox"/> Toward the left (driver side) <input type="checkbox"/> End-over-end <input type="checkbox"/> Unknown
NUMBER OF TURNS	_____ Number of QUARTER TURNS <input type="checkbox"/> Unknown _____ Number of COMPLETE TURNS
PLANE IN CONTACT WITH GROUND AT FINAL REST?	<input type="checkbox"/> Left side <input type="checkbox"/> Top <input type="checkbox"/> Right side <input type="checkbox"/> Wheels <input type="checkbox"/> Unknown

FIRE DATA

DID THIS VEHICLE EXPERIENCE A FIRE?

PAR

☐ YES -- ASK THE FOLLOWING QUESTIONS☒ NO -- SKIP THIS SECTION
☐ UNKNOWN -- SKIP THIS SECTION

FIRE STARTED, OR SMOKE WAS FIRST SEEN ...	<input type="checkbox"/> Under the hood <input type="checkbox"/> In the trunk/cargo area <input type="checkbox"/> Behind the instrument panel <input type="checkbox"/> Under the vehicle <input type="checkbox"/> In the passenger compartment <input type="checkbox"/> From other involved vehicle <input type="checkbox"/> Unknown
FIRE START WITH THE ELECTRICAL SYSTEM? <input type="checkbox"/> No <input type="checkbox"/> Unknown	<input type="checkbox"/> Yes (specify): _____
FIRE START WITH THE FUEL SYSTEM? <input type="checkbox"/> No <input type="checkbox"/> Unknown	<input type="checkbox"/> Yes -- specify Which part of the fuel system may have been involved? <input type="checkbox"/> Fuel tank <input type="checkbox"/> Fuel lines <input type="checkbox"/> Engine compartment (specify component if known) <input type="checkbox"/> Unknown

Describe any additional rollover or fire information here:

SPECIAL CRASH INVESTIGATION ADDENDUM: DRIVER INFORMATION

Do you recall the type of development in the area of the crash?	<input type="checkbox"/> Residential <input type="checkbox"/> Industrial <input checked="" type="checkbox"/> Undeveloped <input type="checkbox"/> Other: _____	<input type="checkbox"/> Commercial <input type="checkbox"/> Agricultural <input type="checkbox"/> School
What were the weather conditions at the time of the crash?	<input type="checkbox"/> Clear (no clouds, no precipitation) <input type="checkbox"/> Cloudy (partially cloudy, no precipitation) <input type="checkbox"/> Overcast (full cloud cover, no precipitation) <input type="checkbox"/> Precipitating <input type="checkbox"/> Unknown <i>PAR</i>	
What was the type of precipitation?	<input type="checkbox"/> No precipitation <input type="checkbox"/> Unknown <input type="checkbox"/> Raining <input type="checkbox"/> Freezing rain <input type="checkbox"/> Sleet <input type="checkbox"/> Snowing <i>PAR</i> <input type="checkbox"/> Hailing	
What was the condition of the road surface?	<input type="checkbox"/> Dry <input type="checkbox"/> Wet <input type="checkbox"/> Snowy, slushy <input type="checkbox"/> Icy <i>PAR</i> <input type="checkbox"/> Other (e.g., sand, dirt, oil on surface, etc.) <input type="checkbox"/> Unknown	
How would you describe the amount of traffic at the time of the crash?	<input type="checkbox"/> Heavy <input type="checkbox"/> Moderate <input type="checkbox"/> Light <input type="checkbox"/> No other traffic present <i>Unknown</i>	
What is your occupation?	<input type="checkbox"/> Professional <input type="checkbox"/> Technical <input type="checkbox"/> Government official <input type="checkbox"/> Management <input type="checkbox"/> Proprietors <input type="checkbox"/> Sales <input type="checkbox"/> Clerical <input checked="" type="checkbox"/> Craftsman and foreman <i>Superintendent</i> <input type="checkbox"/> Service worker <input type="checkbox"/> Student <input type="checkbox"/> Farmers and farm-managers <i>@ Weddle</i> <input type="checkbox"/> Farm labors and foreman <i>Brather</i> <input type="checkbox"/> Private household worker <i>Construction.</i> <input type="checkbox"/> Housewife <input type="checkbox"/> Other: <i>Farmed on the side</i>	
How long have you driven this vehicle?	Years: _____	Months: <i>2-3 months</i>
How many miles do you think that you have driven it in the last 12-month period?	Miles: <i>Unknown</i> <i>Wife (RF occupant) drove it most of the time</i>	
How often do you drive this particular roadway?	<input checked="" type="checkbox"/> Daily <input type="checkbox"/> Twice weekly <input type="checkbox"/> Once weekly <input type="checkbox"/> Twice monthly <input type="checkbox"/> Once monthly <input type="checkbox"/> Very infrequently <input type="checkbox"/> First time on road	
Where were you coming from just prior to the crash?	<input checked="" type="checkbox"/> Home <input type="checkbox"/> Work <input type="checkbox"/> School <input type="checkbox"/> Shopping <input type="checkbox"/> Social/recreational <input type="checkbox"/> Restaurant <input type="checkbox"/> Personal business <input type="checkbox"/> Other: _____	
Where were you intending to go when the crash occurred?	<input type="checkbox"/> Home <input type="checkbox"/> Work <input type="checkbox"/> School <input type="checkbox"/> Shopping <i>According to other sources</i> <input type="checkbox"/> Social/recreational <input checked="" type="checkbox"/> Restaurant <input type="checkbox"/> Personal business <input type="checkbox"/> Other: _____	



ADDITIONAL VEHICLE INFORMATION

YEAR, MAKE AND MODEL?	Year: 19 <u>95</u> Make: <u>Isuzu</u> Model: <u>Trooper</u>
PREVIOUS OR POST-CRASH DAMAGE?	<input checked="" type="checkbox"/> No <u>only had vehicle a month and one-half</u> <input type="checkbox"/> Yes - describe: <input type="checkbox"/> Unknown
DOORS OR HATCH OPEN DURING THE CRASH?	<input type="checkbox"/> No <u>VI</u> <input type="checkbox"/> Yes <input type="checkbox"/> LF <input type="checkbox"/> RF <input type="checkbox"/> LR <input type="checkbox"/> RR <input type="checkbox"/> HATCH <input type="checkbox"/> OTHER _____ <input type="checkbox"/> Unknown
WINDOWS BREAK DURING THE CRASH?	<input type="checkbox"/> No <u>Check all that apply</u> <input type="checkbox"/> Yes <input type="checkbox"/> WS <input type="checkbox"/> LF <input type="checkbox"/> RF <input type="checkbox"/> LR <input type="checkbox"/> RR <input type="checkbox"/> BL <input type="checkbox"/> Roof <input type="checkbox"/> Other <input type="checkbox"/> Unknown <u>VI</u>
WINDOW PRECRASH STATUS	<u>Unknown</u> <input type="checkbox"/> WS <input type="checkbox"/> LF <input type="checkbox"/> RF <input type="checkbox"/> LR <input type="checkbox"/> RR <input type="checkbox"/> BL <input type="checkbox"/> Roof <input type="checkbox"/> Other "O" = open "C" = Closed "P" = partially open "U" = Unknown
GLOVE COMPARTMENT DOOR OPEN DURING THE CRASH?	<input type="checkbox"/> No <input type="checkbox"/> Yes - describe: <u>VI</u> <input type="checkbox"/> Unknown
CARGO IN THE VEHICLE?	<input checked="" type="checkbox"/> No <u>In vehicle</u> <input type="checkbox"/> Unknown <input type="checkbox"/> Yes - describe: <u>30 minutes prior to crash</u> Approximate weight - _____ pounds
VEHICLE MILEAGE	<u>VI</u> miles <input type="checkbox"/> Unknown
IF VEHICLE HAS NOT BEEN INSPECTED	Current location of the vehicle: _____ <u>Not Applicable</u> Contact person: _____
Detail any notes, questions to ask interviewee (i.e., rescue personnel damage to vehicle) or directions to vehicle location:	

OCCUPANT DATA QUESTIONS

HOW MANY PEOPLE WERE IN THE VEHICLE AT THE TIME OF THE CRASH?

2

	DRIVER	OCCUPANT # <u>2</u>	OCCUPANT # _____
SEATING POSITION? Front Left (FL) Second Left (2L) Front Middle (FM) Second Middle (2M) Front Right (FR) Second Right (2R) Third Left (3L) Other (SPECIFY in block) Third Middle (3M) Third Right (3R)	FRONT LEFT	FR	
SEX, HEIGHT, WEIGHT, AND AGE? CIRCLE DRIVER'S RACE: White Black American Indian Eskimo or Aleut Asian or Pacific Islander Other (specify): Unknown	[X] M [] F - Not pregnant [] F - Pregnant - # of months ____ [] F - Unk. if pregnant HEIGHT: _____ WEIGHT: _____ AGE: _____ DRIVER OF HISPANIC ORIGIN? [] Y [X] N [] U	[X] M [] F - Not pregnant [] F - Pregnant - # of months ____ [] F - Unk. if pregnant HEIGHT: _____ WEIGHT: _____ AGE: _____ 	[] M [] F - Not pregnant [] F - Pregnant - # of months ____ [] F - Unk. if pregnant HEIGHT: _____ WEIGHT: _____ AGE: _____ 
OCCUPANT POSTURE A) Kneeling or standing on seat B) Lying on or across seat C) Kneeling, standing or sitting in front of seat D) Sitting sideways, turned to side or back E) Sitting on console F) Lying back in reclined position G) Other (specify) H) Unknown	[] Leaning to left [] Leaning to right [X] Sitting upright [X] Unknown Indicate all letters that apply and describe if other than above	[] Leaning to left [] Leaning to right [] Sitting upright [X] Unknown Indicate all letters that apply and describe if other than above	[] Leaning to left [] Leaning to right [] Sitting upright [] Unknown Indicate all letters that apply and describe if other than above
FEET AND HANDS/ARMS LOCATION JUST PRIOR TO IMPACT <u>FEET</u> A) On floor or foot controls B) One or both on dash C) One or both on seat D) Other (specify) E) Unknown <u>HANDS / ARMS</u> F) Both hands on steering wheel G) One on wheel, other hand resting or adjusting a control (specify hand on wheel and control involved) H) Dialing a cellular phone (specify location and type of phone) I) Holding a cellular phone (specify location and type of phone) J) Bracing with one or both hands K) On lap L) One or both out of window (specify) M) Other (specify) N) Unknown	Indicate all letters that apply and further describe as needed Unknown	Indicate all letters that apply and further describe as needed	Indicate all letters that apply and further describe as needed

OCCUPANT DATA CONTINUED ON NEXT PAGE

OCCUPANT DATA QUESTIONS (continued)

	DRIVER	OCCUPANT # <u>2</u>	OCCUPANT # <u> </u>																																																
BACK UP AGAINST THE SEAT BACK?	<input type="checkbox"/> No (describe) <input checked="" type="checkbox"/> Yes <input checked="" type="checkbox"/> Unknown	<input type="checkbox"/> No (describe) <input checked="" type="checkbox"/> Yes <input checked="" type="checkbox"/> Unknown	<input type="checkbox"/> No (describe) <input type="checkbox"/> Yes <input type="checkbox"/> Unknown																																																
ADJUSTABLE SEAT TRACK, IF "YES" WHERE WAS THE TRACK PRIOR TO IMPACT?	<input type="checkbox"/> Not adjustable <input type="checkbox"/> Seat all the way forward <input type="checkbox"/> Between forward and middle <input checked="" type="checkbox"/> At middle position <input checked="" type="checkbox"/> Between middle and rear position <i>Most likely</i> <input type="checkbox"/> Seat all the way rearward <input type="checkbox"/> Unknown	<input type="checkbox"/> Not adjustable <input type="checkbox"/> Seat all the way forward <input checked="" type="checkbox"/> Between forward and middle <i>Most likely</i> <input type="checkbox"/> At middle position <input type="checkbox"/> Between middle and rear position <input type="checkbox"/> Seat all the way rearward <input type="checkbox"/> Unknown	<input type="checkbox"/> Not adjustable <input type="checkbox"/> Seat all the way forward <input type="checkbox"/> Between forward and middle <input type="checkbox"/> At middle position <input type="checkbox"/> Between middle and rear position <input type="checkbox"/> Seat all the way rearward <input type="checkbox"/> Unknown																																																
ADJUSTABLE SEAT BACK, IF "YES" WHERE WAS THE BACK PRE AND POST IMPACT	<table border="0"> <tr> <td>PRE</td> <td>POST</td> </tr> <tr> <td><input type="checkbox"/> Not adjustable</td> <td><input type="checkbox"/> Not adjustable</td> </tr> <tr> <td><input type="checkbox"/> Completely upright</td> <td><input type="checkbox"/> Completely upright</td> </tr> <tr> <td><input type="checkbox"/> Slightly reclined</td> <td><input type="checkbox"/> Slightly reclined</td> </tr> <tr> <td><input type="checkbox"/> Completely reclined</td> <td><input type="checkbox"/> Completely reclined</td> </tr> <tr> <td><input type="checkbox"/> Slightly forward of upright</td> <td><input type="checkbox"/> Slightly forward of upright</td> </tr> <tr> <td><input checked="" type="checkbox"/> Completely forward</td> <td><input checked="" type="checkbox"/> Completely forward</td> </tr> <tr> <td><input checked="" type="checkbox"/> Unknown</td> <td><input checked="" type="checkbox"/> Unknown</td> </tr> </table>	PRE	POST	<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Completely upright	<input type="checkbox"/> Completely upright	<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Slightly forward of upright	<input type="checkbox"/> Slightly forward of upright	<input checked="" type="checkbox"/> Completely forward	<input checked="" type="checkbox"/> Completely forward	<input checked="" type="checkbox"/> Unknown	<input checked="" type="checkbox"/> Unknown	<table border="0"> <tr> <td>PRE</td> <td>POST</td> </tr> <tr> <td><input type="checkbox"/> Not adjustable</td> <td><input type="checkbox"/> Not adjustable</td> </tr> <tr> <td><input type="checkbox"/> Completely upright</td> <td><input type="checkbox"/> Completely upright</td> </tr> <tr> <td><input type="checkbox"/> Slightly reclined</td> <td><input type="checkbox"/> Slightly reclined</td> </tr> <tr> <td><input type="checkbox"/> Completely reclined</td> <td><input type="checkbox"/> Completely reclined</td> </tr> <tr> <td><input type="checkbox"/> Slightly forward of upright</td> <td><input type="checkbox"/> Slightly forward of upright</td> </tr> <tr> <td><input checked="" type="checkbox"/> Completely forward</td> <td><input checked="" type="checkbox"/> Completely forward</td> </tr> <tr> <td><input checked="" type="checkbox"/> Unknown</td> <td><input checked="" type="checkbox"/> Unknown</td> </tr> </table>	PRE	POST	<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Completely upright	<input type="checkbox"/> Completely upright	<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Slightly forward of upright	<input type="checkbox"/> Slightly forward of upright	<input checked="" type="checkbox"/> Completely forward	<input checked="" type="checkbox"/> Completely forward	<input checked="" type="checkbox"/> Unknown	<input checked="" type="checkbox"/> Unknown	<table border="0"> <tr> <td>PRE</td> <td>POST</td> </tr> <tr> <td><input type="checkbox"/> Not adjustable</td> <td><input type="checkbox"/> Not adjustable</td> </tr> <tr> <td><input type="checkbox"/> Completely upright</td> <td><input type="checkbox"/> Completely upright</td> </tr> <tr> <td><input type="checkbox"/> Slightly reclined</td> <td><input type="checkbox"/> Slightly reclined</td> </tr> <tr> <td><input type="checkbox"/> Completely reclined</td> <td><input type="checkbox"/> Completely reclined</td> </tr> <tr> <td><input type="checkbox"/> Slightly forward of upright</td> <td><input type="checkbox"/> Slightly forward of upright</td> </tr> <tr> <td><input type="checkbox"/> Completely forward</td> <td><input type="checkbox"/> Completely forward</td> </tr> <tr> <td><input type="checkbox"/> Unknown</td> <td><input type="checkbox"/> Unknown</td> </tr> </table>	PRE	POST	<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Completely upright	<input type="checkbox"/> Completely upright	<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Slightly forward of upright	<input type="checkbox"/> Slightly forward of upright	<input type="checkbox"/> Completely forward	<input type="checkbox"/> Completely forward	<input type="checkbox"/> Unknown	<input type="checkbox"/> Unknown
PRE	POST																																																		
<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Not adjustable																																																		
<input type="checkbox"/> Completely upright	<input type="checkbox"/> Completely upright																																																		
<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Slightly reclined																																																		
<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Completely reclined																																																		
<input type="checkbox"/> Slightly forward of upright	<input type="checkbox"/> Slightly forward of upright																																																		
<input checked="" type="checkbox"/> Completely forward	<input checked="" type="checkbox"/> Completely forward																																																		
<input checked="" type="checkbox"/> Unknown	<input checked="" type="checkbox"/> Unknown																																																		
PRE	POST																																																		
<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Not adjustable																																																		
<input type="checkbox"/> Completely upright	<input type="checkbox"/> Completely upright																																																		
<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Slightly reclined																																																		
<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Completely reclined																																																		
<input type="checkbox"/> Slightly forward of upright	<input type="checkbox"/> Slightly forward of upright																																																		
<input checked="" type="checkbox"/> Completely forward	<input checked="" type="checkbox"/> Completely forward																																																		
<input checked="" type="checkbox"/> Unknown	<input checked="" type="checkbox"/> Unknown																																																		
PRE	POST																																																		
<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Not adjustable																																																		
<input type="checkbox"/> Completely upright	<input type="checkbox"/> Completely upright																																																		
<input type="checkbox"/> Slightly reclined	<input type="checkbox"/> Slightly reclined																																																		
<input type="checkbox"/> Completely reclined	<input type="checkbox"/> Completely reclined																																																		
<input type="checkbox"/> Slightly forward of upright	<input type="checkbox"/> Slightly forward of upright																																																		
<input type="checkbox"/> Completely forward	<input type="checkbox"/> Completely forward																																																		
<input type="checkbox"/> Unknown	<input type="checkbox"/> Unknown																																																		

TILT STEERING COLUMN ADJUSTMENT PRIOR TO IMPACT

<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Full up	<input type="checkbox"/> Between full up and center
<input type="checkbox"/> Center	<input checked="" type="checkbox"/> Between center and full down	
<input type="checkbox"/> Full down	<input checked="" type="checkbox"/> Unknown	

TELESCOPING STEERING COLUMN PRIOR TO IMPACT

<input type="checkbox"/> Not adjustable	<input type="checkbox"/> Full back	<input type="checkbox"/> Between full back and midpoint
<input type="checkbox"/> Midpoint	<input checked="" type="checkbox"/> Between midpoint and full forward	
<input type="checkbox"/> Full forward	<input checked="" type="checkbox"/> Unknown	

Did this vehicle have a cellular phone in it during the crash?

☒ No
☒ Yes - describe type: _____
 (e.g., portable, mounted in vehicle, flip phone, etc.)
☐ Unknown

(Note to researcher: try to determine any driver distractions without implying fault)

Was the driver doing any of the following? (check all that apply - and specify)

- ☐ Talking to or listening to another occupant (specify):
 - ☐ Was there a moving object in vehicle (specify):
 - ☐ Talking or listening on a cellular phone (specify):
 - ☐ Dialing a cellular phone (specify):
 - ☐ Adjusting climate control (specify):
 - ☐ Adjusting radio, CD or cassette player (specify):
 - ☐ Using other device or object in vehicle (specify):
 - ☐ Sleepy / asleep (specify):
 - ☐ Distracted by outside person, object, or event (specify):
 - ☐ Eating or drinking (specify):
 - ☐ Smoking related (specify):
 - ☐ Other (specify):
 - ☐ Unknown
- Unknown*

RESTRAINT INFORMATION

	DRIVER	OCCUPANT # <u>2</u>	OCCUPANT # <u> </u>
TYPE OF SEAT BELT AVAILABLE NOTE: If a belt is not available for a seat position -- describe reason	<input type="checkbox"/> Unknown <input type="checkbox"/> Lap belt <input type="checkbox"/> Shoulder belt <input type="checkbox"/> Lap & Shoulder <input type="checkbox"/> Not available * * Describe: <u>VI</u>	<input type="checkbox"/> Unknown <input type="checkbox"/> Lap belt <input type="checkbox"/> Shoulder belt <input type="checkbox"/> Lap & Shoulder <input type="checkbox"/> Not available * * Describe: <u>VI</u>	<input type="checkbox"/> Unknown <input type="checkbox"/> Lap belt <input type="checkbox"/> Shoulder belt <input type="checkbox"/> Lap & Shoulder <input type="checkbox"/> Not available * * Describe:
DO BELTS MOVE ALONG A MOTORIZED TRACK FOR THIS SEAT? (i.e., 2-point automatic belt)	<input type="checkbox"/> Unknown <input type="checkbox"/> No <input type="checkbox"/> Yes *	<input type="checkbox"/> Unknown <input type="checkbox"/> No <input type="checkbox"/> Yes *	<input type="checkbox"/> Unknown <input type="checkbox"/> No <input type="checkbox"/> Yes *
* IF "YES", WERE THEY WORKING PROPERLY?	<input type="checkbox"/> Yes <input type="checkbox"/> No (describe)	<input type="checkbox"/> Yes <input type="checkbox"/> No (describe)	<input type="checkbox"/> Yes <input type="checkbox"/> No (describe)
ARE ANY BELTS ATTACHED TO THE DOOR? (i.e., 3-point automatic belt)	<input type="checkbox"/> Unknown <input type="checkbox"/> No <input type="checkbox"/> Yes *	<input type="checkbox"/> Unknown <input type="checkbox"/> No <input type="checkbox"/> Yes *	<input type="checkbox"/> Unknown <input type="checkbox"/> No <input type="checkbox"/> Yes *
* IF "YES", DOES IT CROSS:	<input type="checkbox"/> Chest <input type="checkbox"/> Lap <input type="checkbox"/> Both	<input type="checkbox"/> Chest <input type="checkbox"/> Lap <input type="checkbox"/> Both	<input type="checkbox"/> Chest <input type="checkbox"/> Lap <input type="checkbox"/> Both
OCCUPANT WEARING ANY SEATBELT?	<input type="checkbox"/> No <input type="checkbox"/> Yes <u>PAR</u> <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Yes <u>PAR</u> <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown
SKIP THE FOLLOWING IF NO SEAT BELT WAS WORN			
TYPE OF BELT WORN?	<input type="checkbox"/> Lap belt <input type="checkbox"/> Shoulder belt <input type="checkbox"/> Lap & Shoulder <input checked="" type="checkbox"/> Unknown	<input type="checkbox"/> Lap belt <input type="checkbox"/> Shoulder belt <input type="checkbox"/> Lap & Shoulder <input checked="" type="checkbox"/> Unknown	<input type="checkbox"/> Lap belt <input type="checkbox"/> Shoulder belt <input type="checkbox"/> Lap & Shoulder <input type="checkbox"/> Unknown
LAP BELT SITUATED?	<input type="checkbox"/> Low on lap <input type="checkbox"/> Across stomach <input type="checkbox"/> Other (specify): _____ <input checked="" type="checkbox"/> Unknown	<input type="checkbox"/> Low on lap <input type="checkbox"/> Across stomach <input type="checkbox"/> Other (specify): _____ <input checked="" type="checkbox"/> Unknown	<input type="checkbox"/> Low on lap <input type="checkbox"/> Across stomach <input type="checkbox"/> Other (specify): _____ <input type="checkbox"/> Unknown
SHOULDER BELT SITUATED?	<input type="checkbox"/> Over shoulder <input type="checkbox"/> Under the arm <input type="checkbox"/> Behind back <input type="checkbox"/> Behind seat <input type="checkbox"/> Other (specify): _____ <input checked="" type="checkbox"/> Unknown	<input type="checkbox"/> Over shoulder <input type="checkbox"/> Under the arm <input type="checkbox"/> Behind back <input type="checkbox"/> Behind seat <input type="checkbox"/> Other (specify): _____ <input checked="" type="checkbox"/> Unknown	<input type="checkbox"/> Over shoulder <input type="checkbox"/> Under the arm <input type="checkbox"/> Behind back <input type="checkbox"/> Behind seat <input type="checkbox"/> Other (specify): _____ <input type="checkbox"/> Unknown
Describe any breaks, tears, or failures to any of the seat belts:			

EJECTION, ENTRAPMENT, MOBILITY INFORMATION

	DRIVER	OCCUPANT # <u>2</u>	OCCUPANT # <u> </u>
ANY PART OF BODY THROWN OUTSIDE THE VEHICLE DURING THE CRASH?	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes * <input type="checkbox"/> Unknown * If "Yes" - what part(s) were ejected, and what area of the vehicle was involved. <u>PAR</u>	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes * <input type="checkbox"/> Unknown * If "Yes" - what part(s) were ejected, and what area of the vehicle was involved. <u>PAR</u>	<input type="checkbox"/> No <input type="checkbox"/> Yes * <input type="checkbox"/> Unknown * If "Yes" - what part(s) were ejected, and what area of the vehicle was involved.
ANYONE PINNED IN THE VEHICLE?	<input type="checkbox"/> No <input checked="" type="checkbox"/> Yes <u>physically pinned</u> <u>jammed doors</u> <u>fire, etc.</u> <input checked="" type="checkbox"/> Unknown <u>Father</u> Detail any entrapment <u>Per EMS record</u>	<input type="checkbox"/> No <input checked="" type="checkbox"/> Yes <u>physically pinned</u> <u>jammed doors</u> <u>fire, etc.</u> <input checked="" type="checkbox"/> Unknown <u>Father-in-law</u> Detail any entrapment <u>Per EMS record</u>	<input type="checkbox"/> No <input type="checkbox"/> Yes <u>physically pinned</u> <u>jammed doors</u> <u>fire, etc.</u> <input type="checkbox"/> Unknown Detail any entrapment
<u>Per PAR and EMS records</u> HOW DID OCCUPANT(S) EXIT THE VEHICLE?	<input checked="" type="checkbox"/> Fatal before removed <input type="checkbox"/> Removed while unconscious, or not oriented to time or place <input type="checkbox"/> Removed due to perceived serious injuries <input type="checkbox"/> Exited with some assistance <input type="checkbox"/> Exited under own power <input type="checkbox"/> Fully ejected <input type="checkbox"/> Unknown	<input checked="" type="checkbox"/> Fatal before removed <input type="checkbox"/> Removed while unconscious, or not oriented to time or place <input type="checkbox"/> Removed due to perceived serious injuries <input type="checkbox"/> Exited with some assistance <input type="checkbox"/> Exited under own power <input type="checkbox"/> Fully ejected <input type="checkbox"/> Unknown	<input type="checkbox"/> Fatal before removed <input type="checkbox"/> Removed while unconscious, or not oriented to time or place <input type="checkbox"/> Removed due to perceived serious injuries <input type="checkbox"/> Exited with some assistance <input type="checkbox"/> Exited under own power <input type="checkbox"/> Fully ejected <input type="checkbox"/> Unknown

Further describe any ejection, entrapment, or mobility information here:

AIR BAG INFORMATION

WAS THIS VEHICLE EVER EQUIPPED WITH AN AIR BAG?

☒ YES (IF "YES" COMPLETE THIS SECTION)☐ NO ☐ UNKNOWN (IF "NO" OR "UNKNOWN" SKIP THIS SECTION)

	DRIVER SIDE FRONTAL	PASSENGER SIDE FRONTAL OCCUPANT # ____	"OTHER" AIR BAG SPECIFY: _____ OCCUPANT # ____
VEHICLE BEEN IN ANY PREVIOUS CRASHES? <input checked="" type="checkbox"/> NO <input checked="" type="checkbox"/> YES - continue to right <input type="checkbox"/> UNKNOWN - go to box below	<input type="checkbox"/> Prior crash <u>without</u> deployment <input type="checkbox"/> One prior crash <u>with</u> deployment <input type="checkbox"/> > 1, <u>with</u> at least one deployment <input type="checkbox"/> Previous accident(s) unknown if deployed <u>IF PRIOR DEPLOYMENT</u> <input type="checkbox"/> CHECK IF <u>NOT</u> REINSTALLED	<input type="checkbox"/> Prior crash <u>without</u> deployment <input type="checkbox"/> One prior crash <u>with</u> deployment <input type="checkbox"/> > 1, <u>with</u> at least one deployment <input type="checkbox"/> Previous accident(s) unknown if deployed <u>IF PRIOR DEPLOYMENT</u> <input type="checkbox"/> CHECK IF <u>NOT</u> REINSTALLED	<input type="checkbox"/> Prior crash <u>without</u> deployment <input type="checkbox"/> One prior crash <u>with</u> deployment <input type="checkbox"/> > 1, <u>with</u> at least one deployment <input type="checkbox"/> Previous accident(s) unknown if deployed <u>IF PRIOR DEPLOYMENT</u> <input type="checkbox"/> CHECK IF <u>NOT</u> REINSTALLED
TYPE OF AIR BAG?	<input checked="" type="checkbox"/> Original equipment <input type="checkbox"/> Retrofitted <input type="checkbox"/> Replacement <input type="checkbox"/> Unknown	<input checked="" type="checkbox"/> Original equipment <input type="checkbox"/> Retrofitted <input type="checkbox"/> Replacement <input type="checkbox"/> Unknown	<input type="checkbox"/> Original equipment <input type="checkbox"/> Retrofitted <input type="checkbox"/> Replacement <input type="checkbox"/> Unknown
PRIOR SERVICE ON THE AIR BAG SYSTEM?	<input checked="" type="checkbox"/> No <input type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:	<input checked="" type="checkbox"/> No <input type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:	<input type="checkbox"/> No <input type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:
DID AIR BAG INFLATE DURING THIS CRASH?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> Unknown <input type="checkbox"/> No If "NO" was the wiring disconnected prior to the crash? <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Unk	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> Unknown <input type="checkbox"/> No If "NO" was the wiring disconnected prior to the crash? <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Unk	<input type="checkbox"/> Yes <input type="checkbox"/> Unknown <input type="checkbox"/> No If "NO" was the wiring disconnected prior to the crash? <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Unk
WAS THIS PERSON WEARING ANY TYPE OF EYE-WEAR (EYE/ SUNGLASSES OR CONTACT LENSES) ANY JEWELRY, OR HAVE ANY OBJECTS IN MOUTH OR HAND?	<input checked="" type="checkbox"/> No <input type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:	<input checked="" type="checkbox"/> No <input type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:	<input type="checkbox"/> No <input type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:
WAS THE AIR BAG IN THIS POSITION CONTACTED BY ANOTHER OCCUPANT?	<input type="checkbox"/> No <input checked="" type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:	<input type="checkbox"/> No <input checked="" type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:	<input type="checkbox"/> No <input type="checkbox"/> Unknown <input type="checkbox"/> Yes - Specify:

Describe any additional information here:

CHILD SAFETY SEAT INFORMATION

WAS THERE A PERSON IN A CHILD SAFETY SEAT IN THIS VEHICLE?

☐ YES (IF "YES" COMPLETE THIS SECTION)☒ NO ☐ UNKNOWN (IF "NO" OR "UNKNOWN" SKIP THIS SECTION)

	DRIVER	OCCUPANT # ____	OCCUPANT # ____
MAKE AND MODEL OF THE SAFETY SEAT?			
TYPE OF SEAT?		<input type="checkbox"/> Infant <input type="checkbox"/> Toddler <input type="checkbox"/> Convertible <input type="checkbox"/> Booster <input type="checkbox"/> Integral <input type="checkbox"/> Other Specify: _____ <input type="checkbox"/> Unknown	<input type="checkbox"/> Infant <input type="checkbox"/> Toddler <input type="checkbox"/> Convertible <input type="checkbox"/> Booster <input type="checkbox"/> Integral <input type="checkbox"/> Other Specify: _____ <input type="checkbox"/> Unknown
DIRECTION FACING PRIOR TO THE CRASH?		<input type="checkbox"/> Front <input type="checkbox"/> Rearward <input type="checkbox"/> Unknown	<input type="checkbox"/> Front <input type="checkbox"/> Rearward <input type="checkbox"/> Unknown
VEHICLE'S SEAT BELT USED TO HOLD THE SEAT IN PLACE?		<input type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown
HOW WAS THE VEHICLE'S SEAT BELT SECURED TO THE CHILD SEAT?		<input type="checkbox"/> Looped through designated rear framing studs <input type="checkbox"/> Looped through arm rest slots <input type="checkbox"/> Belt across safety shield <input type="checkbox"/> Looped through rear frame outside the designated framing struts <input type="checkbox"/> Other (specify): _____ <input type="checkbox"/> Unknown	<input type="checkbox"/> Looped through designated rear framing studs <input type="checkbox"/> Looped through arm rest slots <input type="checkbox"/> Belt across safety shield <input type="checkbox"/> Looped through rear frame outside the designated framing struts <input type="checkbox"/> Other (specify): _____ <input type="checkbox"/> Unknown
WHAT WAS THE CHILD SEAT EQUIPPED WITH AT TIME OF PURCHASE?		<input type="checkbox"/> Harness <input type="checkbox"/> Shield <input type="checkbox"/> Tether <input type="checkbox"/> Unknown	<input type="checkbox"/> Harness <input type="checkbox"/> Shield <input type="checkbox"/> Tether <input type="checkbox"/> Unknown
ANY OF THESE ADDED AFTER THEY OWNED THE SAFETY SEAT?		<input type="checkbox"/> Harness <input type="checkbox"/> Shield <input type="checkbox"/> Tether <input type="checkbox"/> None <input type="checkbox"/> Unknown	<input type="checkbox"/> Harness <input type="checkbox"/> Shield <input type="checkbox"/> Tether <input type="checkbox"/> None <input type="checkbox"/> Unknown


Describe any additional information here:

INJURY INFORMATION


	DRIVER	OCCUPANT # <u>2</u>	OCCUPANT # <u> </u>
WERE YOU INJURED? ▶ If "YES" go to manikin page and record injuries in detail ▶ If "NO" ask next questions	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown
DID YOU HAVE ANY OF THE FOLLOWING: <i>(If any injuries are checked, go to the manikin page and record location, lesion, and source)</i>	<input type="checkbox"/> Cuts <input type="checkbox"/> Abrasions <input type="checkbox"/> Bruises <input type="checkbox"/> Broken bones <input type="checkbox"/> Head, skull, brain <input type="checkbox"/> Internal injury <input type="checkbox"/> Sprains, strains <input type="checkbox"/> Other - specify on manikin	<input type="checkbox"/> Cuts <input type="checkbox"/> Abrasions <input type="checkbox"/> Bruises <input type="checkbox"/> Broken bones <input type="checkbox"/> Head, skull, brain <input type="checkbox"/> Internal injury <input type="checkbox"/> Sprains, strains <input type="checkbox"/> Other - specify on manikin	<input type="checkbox"/> Cuts <input type="checkbox"/> Abrasions <input type="checkbox"/> Bruises <input type="checkbox"/> Broken bones <input type="checkbox"/> Head, skull, brain <input type="checkbox"/> Internal injury <input type="checkbox"/> Sprains, strains <input type="checkbox"/> Other - specify on manikin
TRANSPORTED DIRECTLY FROM ACCIDENT SCENE FOR TREATMENT?	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown
RECEIVE ANY MEDICAL TREATMENT? <i>Never received</i> <i>any on my part of hospital bills</i> (check all that apply)	<input type="checkbox"/> Hospital <input type="checkbox"/> Medical clinic <input type="checkbox"/> Paramedics at scene <input type="checkbox"/> Doctor's office <input checked="" type="checkbox"/> Treated by self <input type="checkbox"/> Unknown	<input type="checkbox"/> Hospital <input type="checkbox"/> Medical clinic <input type="checkbox"/> Paramedics at scene <input type="checkbox"/> Doctor's office <input type="checkbox"/> Treated by self <input type="checkbox"/> Unknown	<input type="checkbox"/> Hospital <input type="checkbox"/> Medical clinic <input type="checkbox"/> Paramedics at scene <input type="checkbox"/> Doctor's office <input type="checkbox"/> Treated by self <input type="checkbox"/> Unknown
HOSPITALIZED?	<input type="checkbox"/> No <input type="checkbox"/> Yes - # of days <input type="checkbox"/> Unknown	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes - # of days <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Yes - # of days <input type="checkbox"/> Unknown
TREATED AND RELEASED FROM THE EMERGENCY ROOM?	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Yes <input type="checkbox"/> Unknown
NAME OF MEDICAL TREATMENT FACILITY?			
RECEIVE ANY FOLLOW-UP TREATMENT?	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes - describe any additional injuries diagnosed: _____ <input type="checkbox"/> Unknown	<input checked="" type="checkbox"/> No <input type="checkbox"/> Yes - describe any additional injuries diagnosed: _____ <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Yes - describe any additional injuries diagnosed: _____ <input type="checkbox"/> Unknown
LOST ANY DAYS FROM WORK OR SCHOOL (COLLEGE) DUE TO THE CRASH?	<input type="checkbox"/> No FATAL <input type="checkbox"/> Not working prior to crash <input type="checkbox"/> Yes - # of days <input type="checkbox"/> Unknown	<input type="checkbox"/> No FATAL <input type="checkbox"/> Not working prior to crash <input type="checkbox"/> Yes - # of days <input type="checkbox"/> Unknown	<input type="checkbox"/> No <input type="checkbox"/> Not working prior to crash <input type="checkbox"/> Yes - # of days <input type="checkbox"/> Unknown
IF REQUIRED: WILL YOU SIGN A MEDICAL RELEASE? * If not an in-person interview, make appointment to have release signed	<input type="checkbox"/> No <input type="checkbox"/> Yes* <input type="checkbox"/> Unknown DATE: _____ TIME: _____ PLACE: _____	<input type="checkbox"/> No <input type="checkbox"/> Yes* <input type="checkbox"/> Unknown DATE: _____ TIME: _____ PLACE: _____	<input type="checkbox"/> No <input type="checkbox"/> Yes* <input type="checkbox"/> Unknown DATE: _____ TIME: _____ PLACE: _____

PSU Number 10Case Number-Stratum 9616Vehicle Number 01Occupant Number 01**INJURY DATA FROM INTERVIEWEE(S)**Indicate the Location, Lesion, Detail, and Source of all injuries. Specify interviewee(s): FATHER


SOFT TISSUE/INTERNAL INJURIES

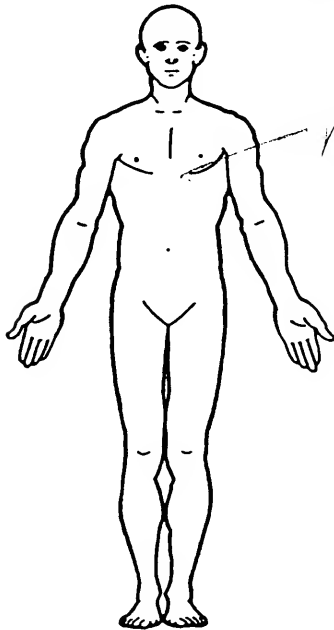


Fractured R. vertebrae

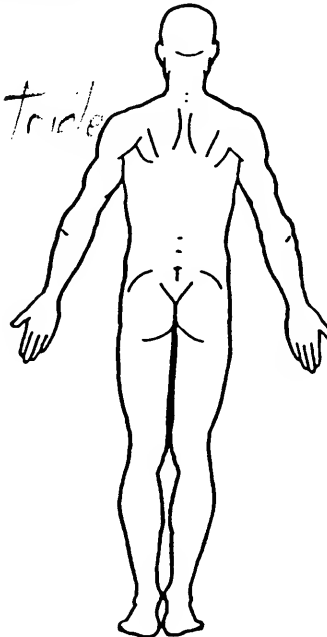

SKELETAL INJURIES

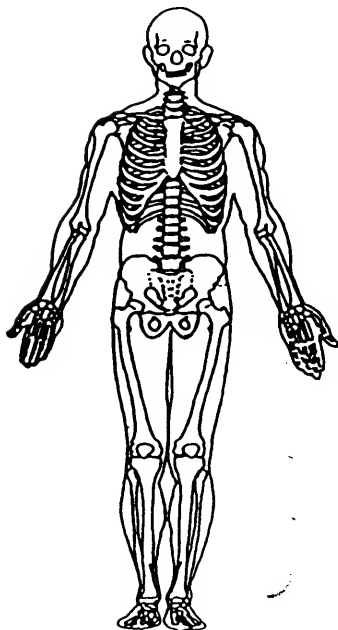



Broken lg, NFS

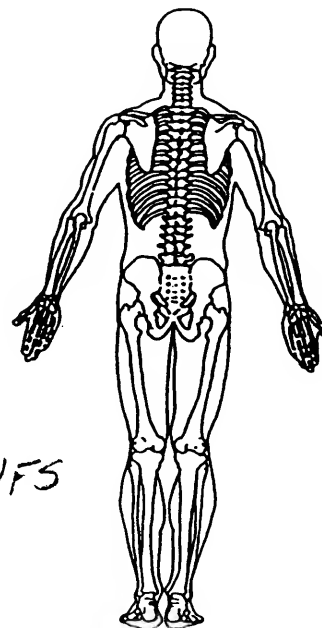



The space provided on the back of this page may be used to further detail injuries noted by the interviewee(s).

PSU Number 10Case Number—Stratum 9616Vehicle Number 01Occupant Number 02**INJURY DATA FROM INTERVIEWEE(S)**Indicate the *Location, Lesion, Detail, and Source* of all injuries. Specify interviewee(s): FATHER-IN-LAW

SOFT TISSUE/INTERNAL INJURIES

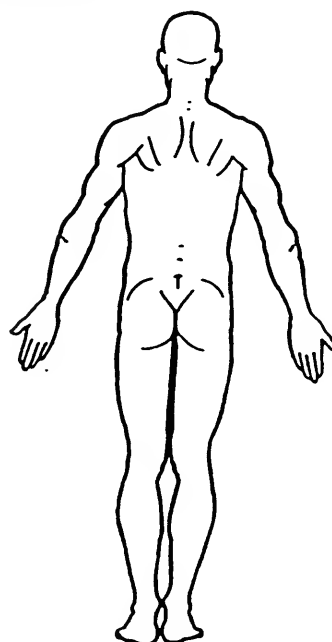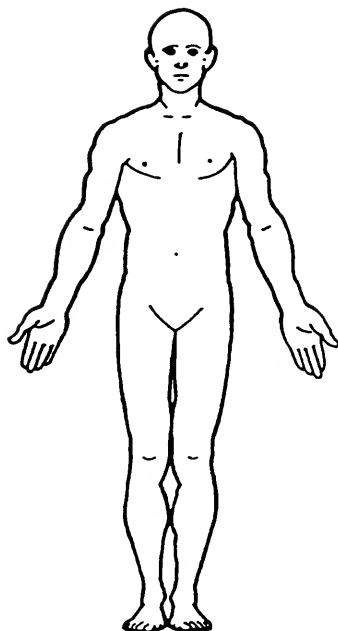



SKELETAL INJURIES

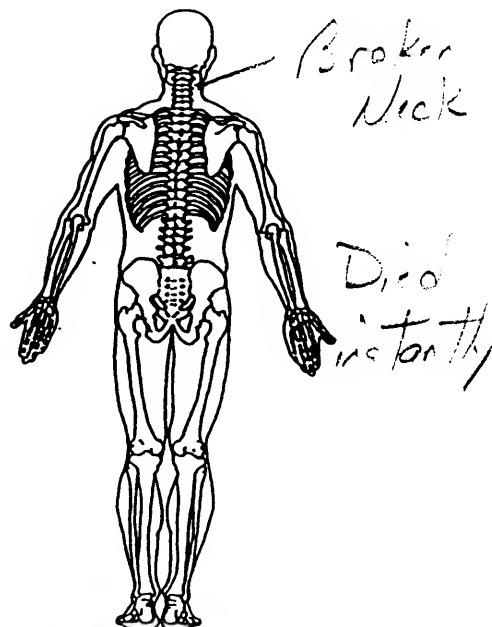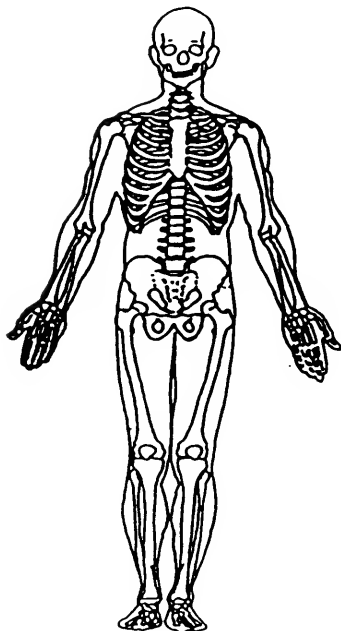



The space provided on the back of this page may be used to further detail injuries noted by the interviewee(s).

PSU Number 10 Case Number—Stratum 96 Vehicle Number _____ Occupant Number _____**INJURY DATA FROM INTERVIEWEE(S)**Indicate the *Location, Lesion, Detail, and Source* of all injuries. Specify interviewee(s): _____

SOFT TISSUE/INTERNAL INJURIES

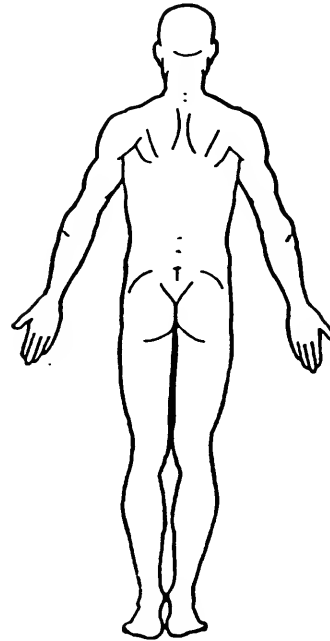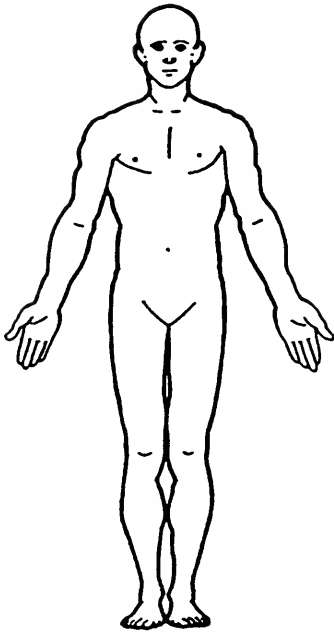

SKELETAL INJURIES

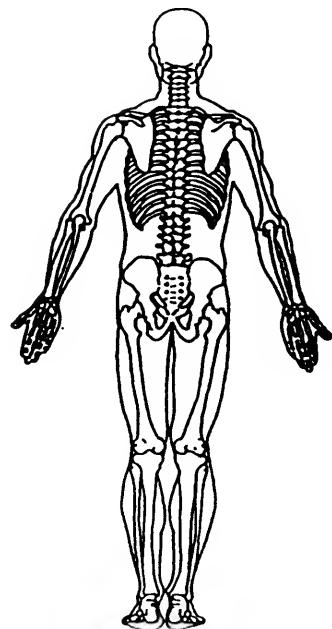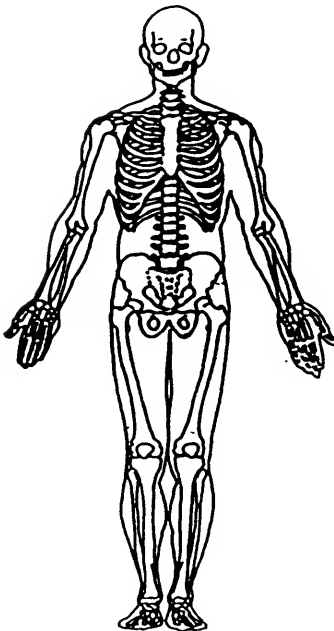

The space provided on the back of this page may be used to further detail injuries noted by the interviewee(s).

NASS CDS OCCUPANT ASSESSMENT FORM:
CASE VEHICLE DRIVER



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 10
2. Case Number - Stratum 9616
3. Vehicle Number 01
4. Occupant Number 01

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 39
Code actual age at time of accident.
(00) Less than one year old (specify by month):

(97) 97 years and older
(99) Unknown
6. Occupant's Sex 1
(1) Male
(2) Female-not reported pregnant
(3) Female-pregnant-1st trimester(1st-3rd month)
(4) Female-pregnant-2nd trimester(4th-6th month)
(5) Female-pregnant-3rd trimester(7th-9th month)
(6) Female-pregnant-term unknown
(9) Unknown
7. Occupant's Height 188
Code actual height to the nearest
centimeter.
(999) Unknown

74 inches X 2.54 = 188.0 centimeters
8. Occupant's Weight 075
Code actual weight to the nearest
kilogram.
(999) Unknown

166 pounds X .4536 = 75.3 kilograms
9. Occupant's Role 1
(1) Driver
(2) Passenger
(9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 11
Front Seat
(11) Left side
(12) Middle
(13) Right side
(14) Other (specify):
(15) On or in the lap of another occupant
- Second Seat*
(21) Left side
(22) Middle
(23) Right side
(24) Other (specify):
(25) On or in the lap of another occupant
- Third Seat*
(31) Left side
(32) Middle
(33) Right side
(34) Other (specify):
(35) On or in the lap of another occupant
- Fourth Seat*
(41) Left side
(42) Middle
(43) Right side
(44) Other (specify):
(45) On or in the lap of another occupant
- (97) In or on unenclosed area
(98) Other seat (specify):
(99) Unknown
11. Occupant's Posture 9
(0) Normal posture
- Abnormal posture*
(1) Kneeling or standing on seat
(2) Lying on or across seat
(3) Kneeling, standing or sitting in front of seat
(4) Sitting sideways or turned to talk with another occupant or to look out a rear window
(5) Sitting on a console
(6) Lying back in a reclined seat position
(7) Bracing with feet or hands on a surface in front of seat
(8) Other abnormal posture (specify):
(9) Unknown

EJECTION/ENTRAPMENT12. Ejection 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____
- (5) Integral structure
- (8) Other medium (specify): _____
- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 0

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors, fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility 0

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or not oriented to time or place
- (2) Removed from vehicle due to perceived serious injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (8) Removed from vehicle for other reasons
(specify): _____
- (9) Unknown

BELT SYSTEM FUNCTION

<p>18. Manual (Active) Belt System Availability <u>4</u></p> <p>(0) None available (1) Belt removed/destroyed (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt available—type unknown</p> <p><i>Integral Belt Partially Destroyed</i> (6) Shoulder belt (lap belt destroyed/removed) (7) Lap belt (shoulder belt destroyed/removed) (8) Other belt (specify): (9) Unknown</p>	<p>22. Manual Shoulder Belt Upper Anchorage Adjustment <u>1</u></p> <p>(0) No manual shoulder belt (1) No upper anchorage adjustment for manual shoulder belt</p> <p><i>Adjustable shoulder Belt Upper Anchorage</i> (2) In full up position (3) In mid position (4) In full down position (5) Position unknown (9) Unknown if position has adjustable upper anchorage adjustment</p>
<p>19. Manual (Active) Belt System Use <u>00</u></p> <p>(00) None used, not available, or belt removed/destroyed (01) Inoperative (specify): (02) Shoulder belt (03) Lap belt (04) Lap and shoulder belt (05) Belt used—type unknown (08) Other belt used (specify): (12) Shoulder belt used with child safety seat (13) Lap belt used with child safety seat (14) Lap and shoulder belt used with child safety seat (15) Belt used with child safety seat—type unknown (18) Other belt used with child safety seat (specify): (99) Unknown if belt used</p>	<p>23. Automatic (Passive) Belt System Availability/Function <u>0</u></p> <p>(0) Not equipped/not available (1) 2 point automatic belts (2) 3 point automatic belts (3) Automatic belts - type unknown</p> <p><i>Non-functional</i> (4) Automatic belts destroyed or rendered inoperative (9) Unknown</p> <p>24. Automatic (Passive) Belt System Use <u>0</u></p> <p>(0) Not equipped/not available/destroyed or rendered inoperative (1) Automatic belt in use (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): (3) Automatic belt use unknown (9) Unknown</p>
<p>20. Proper Use of Manual (Active) Belts <u>0</u></p> <p>(0) None used or not available (1) Belt used properly (2) Belt used properly with child safety seat</p> <p><i>Belt Used Improperly</i> (3) Shoulder belt worn under arm (4) Shoulder belt worn behind back or seat (5) Belt worn around more than one person (6) Lap belt worn on abdomen (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): (8) Other improper use of manual belt system (specify): (9) Unknown</p>	<p>25. Automatic (Passive) Belt System Type <u>0</u></p> <p>(0) Not equipped/not available (1) Non-motorized system (2) Motorized system (9) Unknown</p> <p>26. Proper Use of Automatic (Passive) Belt System <u>0</u></p> <p>(0) Not equipped/not available/not used (1) Automatic belt used properly (2) Automatic belt used properly with child safety seat</p> <p><i>Automatic Belt Used Improperly</i> (3) Automatic shoulder belt worn under arm (4) Automatic shoulder belt worn behind back (5) Automatic belt worn around more than one person (6) Lap portion of automatic belt worn on abdomen (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): (8) Other improper use of automatic belt system (specify): (9) Unknown</p>
<p>21. Manual (Active) Belt Failure Modes During Accident <u>0</u></p> <p>(0) No manual belt used or not available (1) No manual belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): (6) Broken retractor (7) Combination of above (specify): (8) Other manual belt failure (specify): (9) Unknown</p>	<p>27. Automatic (Passive) Belt Failure Modes During Accident <u>0</u></p> <p>(0) Not equipped/not available/not in use (1) No automatic belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): (6) Broken retractor (7) Combination of above (specify): (8) Other automatic belt failure (specify): (9) Unknown</p>

POLICE REPORTED RESTRAINT USE**AIR BAG SYSTEM FUNCTION**28. Police Reported Belt Use 0

- (0) None used
- (1) Police did not indicate belt use
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt used, type not specified
- (6) Child safety seat
- (7) Automatic belt
- (8) Other type belt, (specify):

(9) Police indicated "unknown"

29. Police Reported Air Bag Availability/Function 1

- (0) No air bag available
- (1) Police did not indicate air bag availability/function
- (2) Deployed
- (3) Not deployed
- (4) Unknown if deployed
- (9) Police indicated "unknown"

Check the Primary Source Used In Determining Belt Use.

- ☒ Vehicle inspection
- ☐ Official injury data
- ☐ Driver/occupant interview
- ☐ Other (specify):

☐ Unknown if belt used

30. Frontal Air Bag System Availability/Function (This Occupant Position) 1

- (0) Not equipped/not available
- (1) Air bag

Non-functional

- (2) Air bag disconnected (specify):

- (3) Air bag not reinstalled
- (9) Unknown

31. Frontal Air Bag System Deployment (This Occupant Position) 1

- (0) Not equipped/not available
- (1) Deployed during accident (as a result of impact)
- (2) Deployed inadvertently just prior to accident
- (3) Deployed, details unknown
- (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (5) Unknown if deployed
- (7) Nondeployed
- (9) Unknown

32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) 0

- (0) Not equipped/not available
- (1) Air bag

Non-functional

- (2) Air bag disconnected (specify):

- (3) Air bag not reinstalled
- (9) Unknown

Specify type of "other" air bag present:

33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) 0

- (0) Not equipped with an "other" air bag
- (1) Deployed during accident (as a result of impact)
- (2) Deployed inadvertently just prior to accident
- (3) Deployed, details unknown
- (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (5) Unknown if deployed
- (7) Nondeployed
- (9) Unknown

34. Are There Indications of Air Bag System Failure? 1

- (This Occupant Position)
- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):

(9) Unknown

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION35. Had Vehicle Been in Previous Accident(s)? 1

- (0) Not equipped/not available
(1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
(3) One previous accident with deployment
(4) More than one previous accident with at least one deployment
(8) Previous accidents, unknown deployment status
(9) Unknown

36. Type of Air Bag 1

- (0) Not equipped/not available
(1) Original manufacturer installed system
(2) Retrofitted air bag
(3) Replacement air bag
(8) Unknown type of air bag
(9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 1

- (0) Not equipped/not available
(1) No prior maintenance
(2) Yes, prior maintenance (specify):

(9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 01

- (00) Not equipped/not available

Code the accident event sequence number that initiated the air bag deployment
(96) Deployed, unknown event
(97) Not deployed
(98) Unknown if deployed
(99) Unknown

39. CDC For Air Bag Deployment Impact 1

- (0) Not equipped/not available
(1) Highest delta V
(2) Second highest delta V
(3) Other non-coded delta V (specify):

(6) Deployed, unknown event
(7) Not deployed
(8) Unknown if deployed
(9) Unknown

40. Longitudinal Component of Delta V For Air Bag + 0 4 1

Deployment Impact

(_000) Not equipped/not available

Code the value of the delta V for the impact that initiated the air bag deployment

(_996) Deployment, unknown longitudinal Delta V

(_997) Not deployed

(_998) Unknown if deployed

(_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 2

- (0) Not equipped/not available
(1) No
(2) Yes
(3) Deployed, unknown if flap(s) opened at designated tear points
(7) Not deployed
(8) Unknown if deployed
(9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 1

- (0) Not equipped/not available
(1) No
(2) Yes (specify): _____
(3) Deployed, unknown if air bag module cover flap(s) damaged
(7) Not deployed
(8) Unknown if deployed
(9) Unknown

43. Was There Damage To The Air Bag? 0 1

- (00) Not equipped/not available
(01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
(03) Cut
(04) Torn
(05) Holed
(06) Burned
(07) Abraded
(88) Other damage (specify):

- (95) Damaged, details unknown
(96) Deployed, unknown if damaged
(97) Not deployed
(98) Unknown if deployed
(99) Unknown

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*

44. Source of Air Bag Damage 01
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):
 (03) Object carried by occupant, (specify):
 (04) Adaptive/assistive controls, (specify):
 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (08) Other damage source (specify):
 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):
Two
 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):
Two
 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 1
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):
 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 1
 (0) Not air bag equipped/air bag not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION


49. Head Restraint Type/Damage by Occupant at This Occupant Position 3
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):
 (9) Unknown
50. Seat Type (this Occupant Position) 02
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):
 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):
 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 9
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track
- Adjustable Seat Track**
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions — *Most Likely per interviewee*
 (6) Seat at rear most track position
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION *continued*53. Seat Back Incline Prior and Post Impact 99


- (00) Occupant not seated or no seat
 (01) Not adjustable

Upright prior to impact


- (11) Moved to completely rearward position
 (12) Moved to rearward midrange position
 (13) Moved to slightly rearward position
 (14) Retained pre-impact position
 (15) Moved to slightly forward position
 (16) Moved to forward midrange position
 (17) Moved to completely forward position

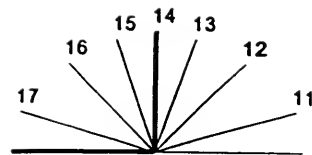***Slightly reclined prior to impact***

- (21) Moved to completely rearward position
 (22) Moved to rearward midrange position
 (23) Retained pre-impact position
 (24) Moved to upright position
 (25) Moved to slightly forward position
 (26) Moved to forward midrange position
 (27) Moved to completely forward position

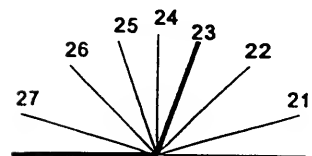***Completely reclined prior to impact***

- (31) Retained pre-impact position
 (32) Moved to rearward midrange position
 (33) Moved to slightly rearward position
 (34) Moved to upright position
 (35) Moved to slightly forward position
 (36) Moved to forward midrange position
 (37) Moved to completely forward position

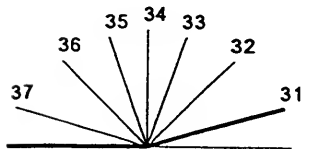

(99) Unknown

54. Seat Performance (this Occupant Position) 1

- (0) Occupant not seated or no seat
 (1) No seat performance failure(s)
 (2) Seat adjusters failed
 (3) Seat back folding locks or "seat back" failed (specify): _____
 (4) Seat track/anchors failed
 (5) Deformed by impact of occupant
 (6) Deformed by passenger compartment intrusion, (specify): _____
 (7) Combination of above (specify): _____
 (8) Other (specify): _____
 (9) Unknown

CHILD SAFETY SEAT55. Child Safety Seat Make/Model 0 0 0

(000) No child safety seat

Applicable codes are found in your NASS CDS
Data Collection, Coding and Editing

(950) Built-in child safety seat

(997) Other make/model (specify):

(998) Unknown make/model

(999) Unknown if child safety seat used

56. Type of Child Safety Seat 0

(0) No child safety seat

(1) Infant seat

(2) Toddler seat

(3) Convertible seat

(4) Booster seat - with shield

(5) Booster seat - without shield

(7) Other type child safety seat (specify):

(8) Unknown child safety seat type

(9) Unknown if child safety seat used

57. Child Safety Seat Orientation 0 0

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing

(02) Forward facing

(08) Other orientation (specify):

(09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing

(12) Forward facing

(18) Other orientation (specify):

(19) Unknown orientation

*Unknown Design or Orientation For This
Age/Weight, or Unknown Age/Weight*

(21) Rear facing

(22) Forward facing

(28) Other orientation (specify):

(29) Unknown orientation

(99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 0 059. Child Safety Seat Shield Usage 0 060. Child Safety Seat Tether Usage 0 0Note: Options below applicable to
Variables OA58-OA60.

(00) No child safety seat

Not Designed With Harness/Shield/Tether(01) After market harness/shield/tether
added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market
harness/shield/tether added(09) Unknown if harness/shield/tether
added or used*Designed With Harness/Shield/Tether*

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES61. Injury Severity (Police Rating) 4

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 1

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

64. Hospital Stay 00

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 62

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP WORK HERE**VARIABLES 66-74****TO BE CODED BY THE ZONE CENTER**

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES**

66. Time to Death 01
 Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
 (00) Not fatal
 (96) Fatal - ruled disease
 (99) Unknown

67. 1st Medically Reported Cause of Death 01

68. 2nd Medically Reported Cause of Death 06

69. 3rd Medically Reported Cause of Death 10
 Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
 (00) Not fatal or no additional causes
 (96) Mode of death given but specific injuries are not linked to cause of death. (specify):
 (97) Other result (includes fatal ruled disease) (specify):
 (99) Unknown

70. Number of Recorded Injuries for This Occupant 24
 Code the actual number of injuries recorded for this occupant.
 (00) No recorded injuries
 (97) Injured, details unknown
 (99) Unknown if injured

TRAUMA DATA

71. Glasgow Coma Scale (GCS) Score 01
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured
12 Initially @ Scene → 3

72. Was the Occupant Given Blood? 1
 (1) No - blood not given
 (2) Yes - blood given
 (specify units):
 (9) Unknown if blood given

73. Arterial Blood Gases (ABG) - HCO₃ 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO₃
 (96) ABGs reported, HCO₃ unknown
 (97) Injured, details unknown
 (99) Unknown if injured

BELT USE DETERMINATION

74. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify):
 (9) Unknown if belt used

NASS CDS OCCUPANT INJURY FORM:
CASE VEHICLE DRIVER



U.S. Department of Transportation
National Highway Traffic Safety
Administration

OCCUPANT INJURY FORM

BEST AVAILABLE Form Approved
O.M.B. No. 2127-0021
NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number	<u>10</u>	3. Vehicle Number	<u>01</u>
2. Case Number - Stratum	<u>9616</u>	4. Occupant Number	<u>01</u>

INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

Source of Injury Data	Body Region	A.I.S. - 90				Injury Source	Injury Source Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number		
		Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity						
Laceration ① 1st Ventricle	5. <u>1</u>	6. <u>4</u>	7. <u>4</u>	8. <u>10</u>	9. <u>12</u>	10. <u>5</u>	11. <u>4</u>	12. <u>006</u>	13. <u>1</u>	14. <u>1</u>	15. <u>07</u>
Contusions ② 2nd Ventricle	16. <u>1</u>	17. <u>4</u>	18. <u>4</u>	19. <u>10</u>	20. <u>02</u>	21. <u>3</u>	22. <u>4</u>	23. <u>006</u>	24. <u>1</u>	25. <u>1</u>	26. <u>07</u>
Laceration Peri-3rd Cordial arc	27. <u>1</u>	28. <u>4</u>	29. <u>4</u>	30. <u>16</u>	31. <u>02</u>	32. <u>2</u>	33. <u>4</u>	34. <u>006</u>	35. <u>1</u>	36. <u>1</u>	37. <u>07</u>
Laceration both 4th Lungs	38. <u>1</u>	39. <u>4</u>	40. <u>4</u>	41. <u>14</u>	42. <u>50</u>	43. <u>4</u>	44. <u>3</u>	45. <u>006</u>	46. <u>1</u>	47. <u>1</u>	48. <u>07</u>
Contusions both 5th Lungs	49. <u>1</u>	50. <u>4</u>	51. <u>4</u>	52. <u>14</u>	53. <u>10</u>	54. <u>4</u>	55. <u>3</u>	56. <u>006</u>	57. <u>1</u>	58. <u>1</u>	59. <u>07</u>
Lacerations 6th liver	60. <u>1</u>	61. <u>5</u>	62. <u>4</u>	63. <u>18</u>	64. <u>24</u>	65. <u>3</u>	66. <u>1</u>	67. <u>004</u>	68. <u>2</u>	69. <u>1</u>	70. <u>07</u>
Laceration 7th Spleen	71. <u>1</u>	72. <u>5</u>	73. <u>4</u>	74. <u>42</u>	75. <u>22</u>	76. <u>2</u>	77. <u>2</u>	78. <u>004</u>	79. <u>2</u>	80. <u>1</u>	81. <u>07</u>
Injury ① 8th Adrenal gland	82. <u>1</u>	83. <u>5</u>	84. <u>4</u>	85. <u>02</u>	86. <u>99</u>	87. <u>1</u>	88. <u>2</u>	89. <u>004</u>	90. <u>2</u>	91. <u>1</u>	92. <u>07</u>
Injury ① 9th LUQ Mesentery	93. <u>1</u>	94. <u>5</u>	95. <u>4</u>	96. <u>20</u>	97. <u>99</u>	98. <u>2</u>	99. <u>8</u>	100. <u>004</u>	101. <u>2</u>	102. <u>1</u>	103. <u>07</u>
Fx Ribs ① 4, 5-6 ② 4-6	104. <u>1</u>	105. <u>4</u>	106. <u>5</u>	107. <u>02</u>	108. <u>40</u>	109. <u>4</u>	110. <u>3</u>	111. <u>006</u>	112. <u>1</u>	113. <u>1</u>	114. <u>07</u>

[illegible]

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Level of Injury	Aspect
(1) Head		Specific injuries are assigned consecutive two-digit numbers beginning with 02.	(1) Right
(2) Face			(2) Left
(3) Neck			(3) Bilateral
(4) Thorax			(4) Central
(5) Abdomen		To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.	(5) Anterior
(6) Spine			(6) Posterior
(7) Upper Extremity			(7) Superior
(8) Lower Extremity			(8) Inferior
(9) Unspecified			(9) Unknown
	The exceptions to this rule apply to:		(0) Whole region
Type of Anatomic Structure	Whole Area		
(1) Whole Area	(02) Skin - Abrasion		
(2) Vessels	(04) Skin - Contusion		
(3) Nerves	(06) Skin - Laceration		
(4) Organs (includes Muscles/ligaments)	(08) Skin - Avulsion		
(5) Skeletal (includes joints)	(10) Amputation		
(6) Head - LOC	(20) Burn		
(9) Skin	(30) Crush		
	(40) Degloving		
	(50) Injury - NFS		
	(90) Trauma, other than mechanical		
	Head - LOC		
	(02) Length of LOC		
	(04) Level		
	(06) of		
	(08) Consciousness		
	(10) Concussion		
	Spine		
	(02) Cervical		
	(04) Thoracic		
	(06) Lumbar		

Abbreviated Injury Scale

- (1) Minor Injury
- (2) Moderate Injury
- (3) Serious Injury
- (4) Severe Injury
- (5) Critical Injury
- (6) Maximum (untreatable)
- (7) Injured, unknown severity

SOURCE OF INJURY DATA**INJURY SOURCE****DIRECT/INDIRECT INJURY****CONFIDENCE LEVEL****OFFICIAL RECORDS**

- (1) Autopsy records with or without hospital/medical records
- (2) Hospital/medical records other than emergency room (e.g., discharge summary)
- (3) Emergency room records only (including associated X-rays or other lab reports)
- (4) Private physician, walk-in or emergency clinic

UNOFFICIAL RECORDS

- (5) Lay coroner report
- (6) E.M.S. personnel
- (7) Interviewee
- (8) Other source (specify): _____
- (9) Police

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

- (1) Direct contact injury
- (2) Indirect contact injury
- (3) Noncontact injury
- (7) Injured, unknown source

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Unrestrained driver

Height: 74 Inches; weight: 166 Pounds

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

AUTOPSY

Restrained?

☒ No☐ YesBlood Alcohol Level
(mg/dl)

BAL = .034

Glasgow Coma
Scale Score


GCSS =

Units of Blood
Given

Units =

Arterial Blood Gases

pH =

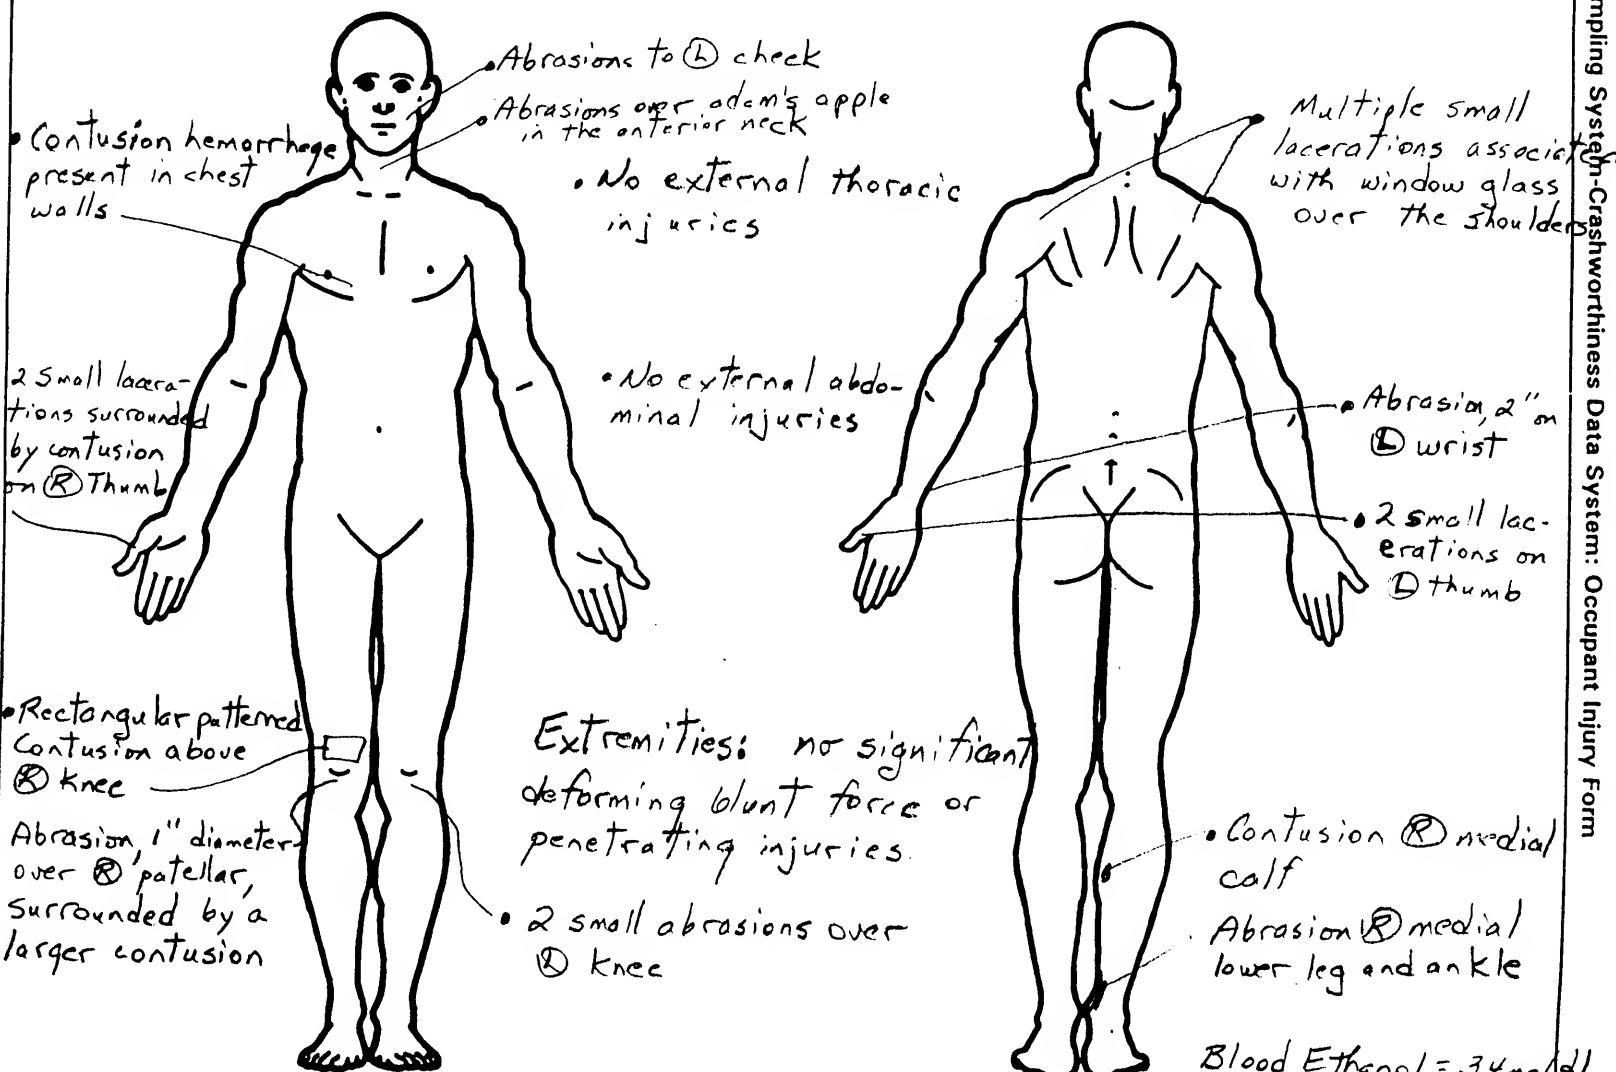PO₂ =PCO₂ =HCO₃ =

Extremities: no significant
deforming blunt force or
penetrating injuries.

2 small abrasions over
(L) knee


Blood Ethanol = 34mg/dl

An odor like alcohol is apparent in
the body cavities, in stomach

OFFICIAL INJURY DATA — SKELETAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

AUTOPSY

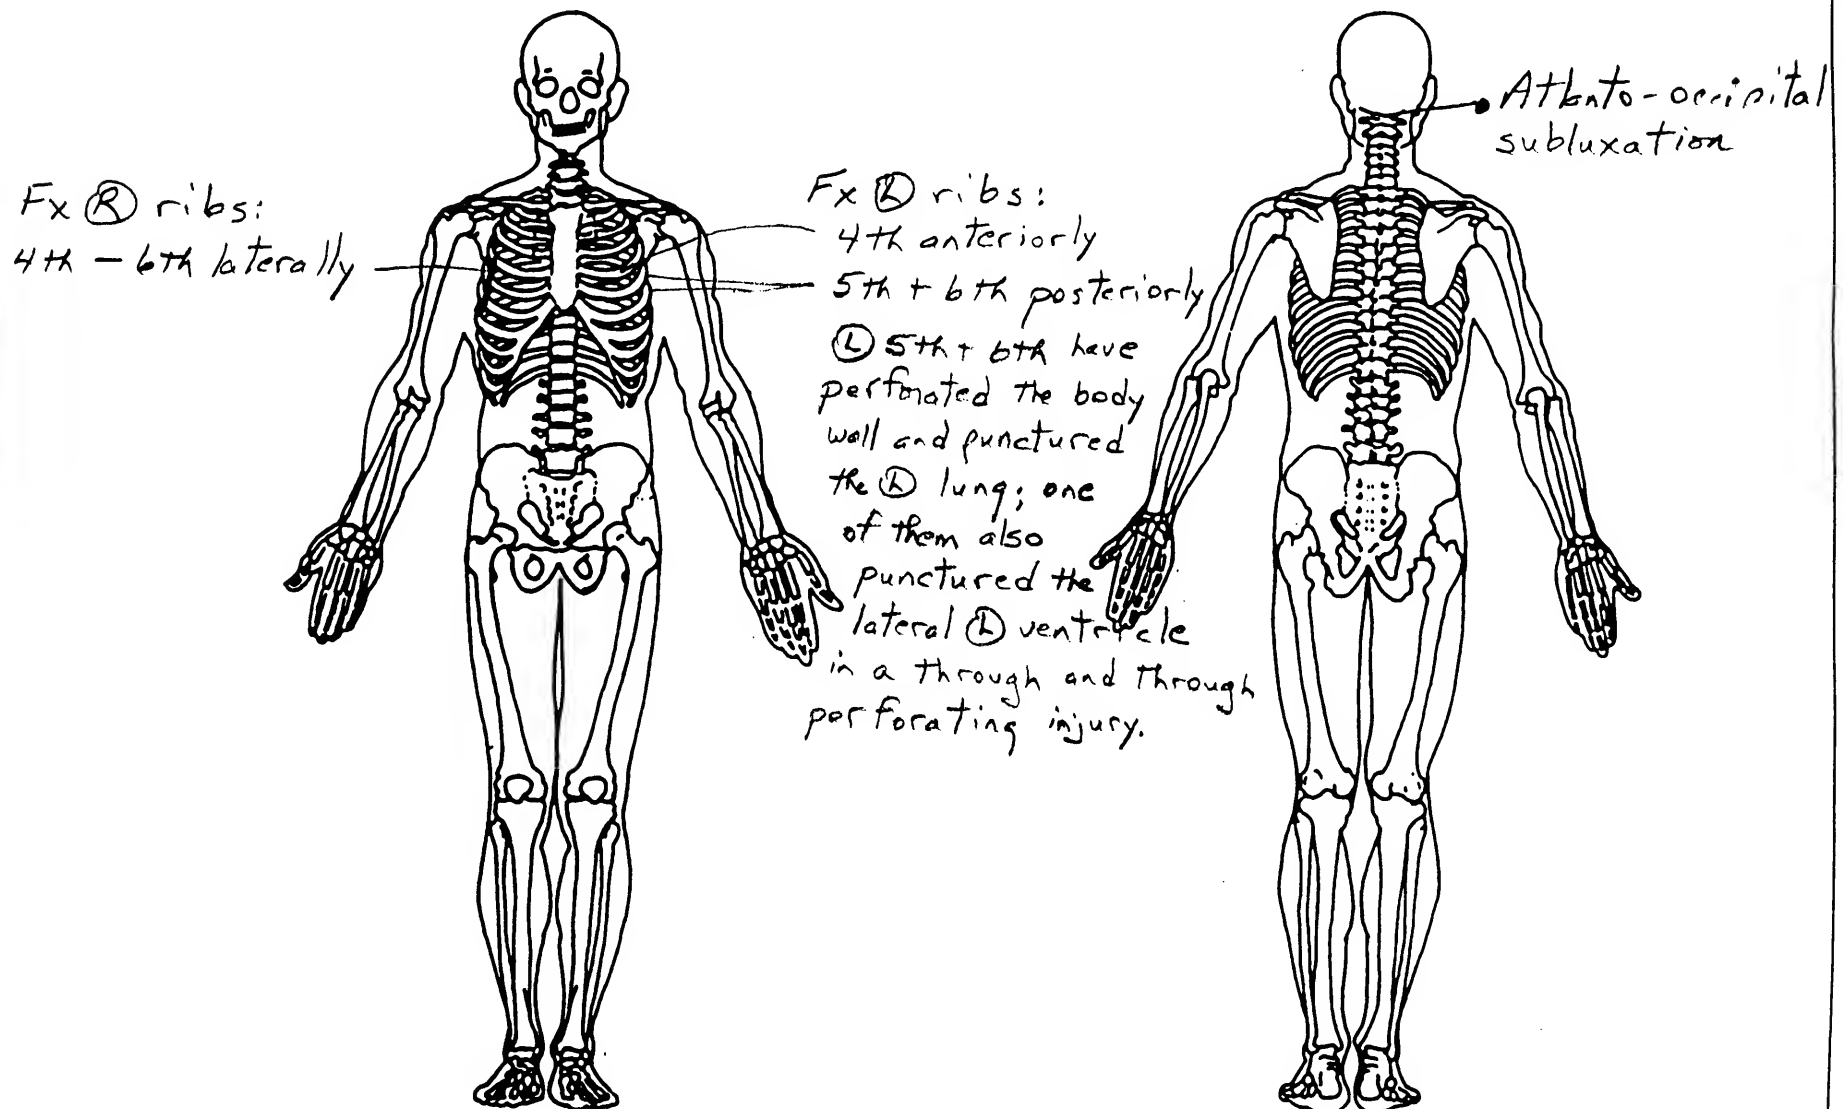

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify) _____
- (195) Other air bag compartment cover (specify) _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____

- (410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

EXTERIOR of OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify): _____
- (454) Unknown exterior objects

EXTERIOR of OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify): _____
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify): _____
- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify): _____
- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (551) Ground
- (598) Other vehicle or object (specify): _____
- (599) Unknown vehicle or object

NONCONTACT INJURY


- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify): _____
- (604) Air bag exhaust gases
- (697) Injured, unknown source

OFFICIAL INJURY DATA —INTERNAL INJURIES

BEST AVAILABLE

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

AUTOPSY

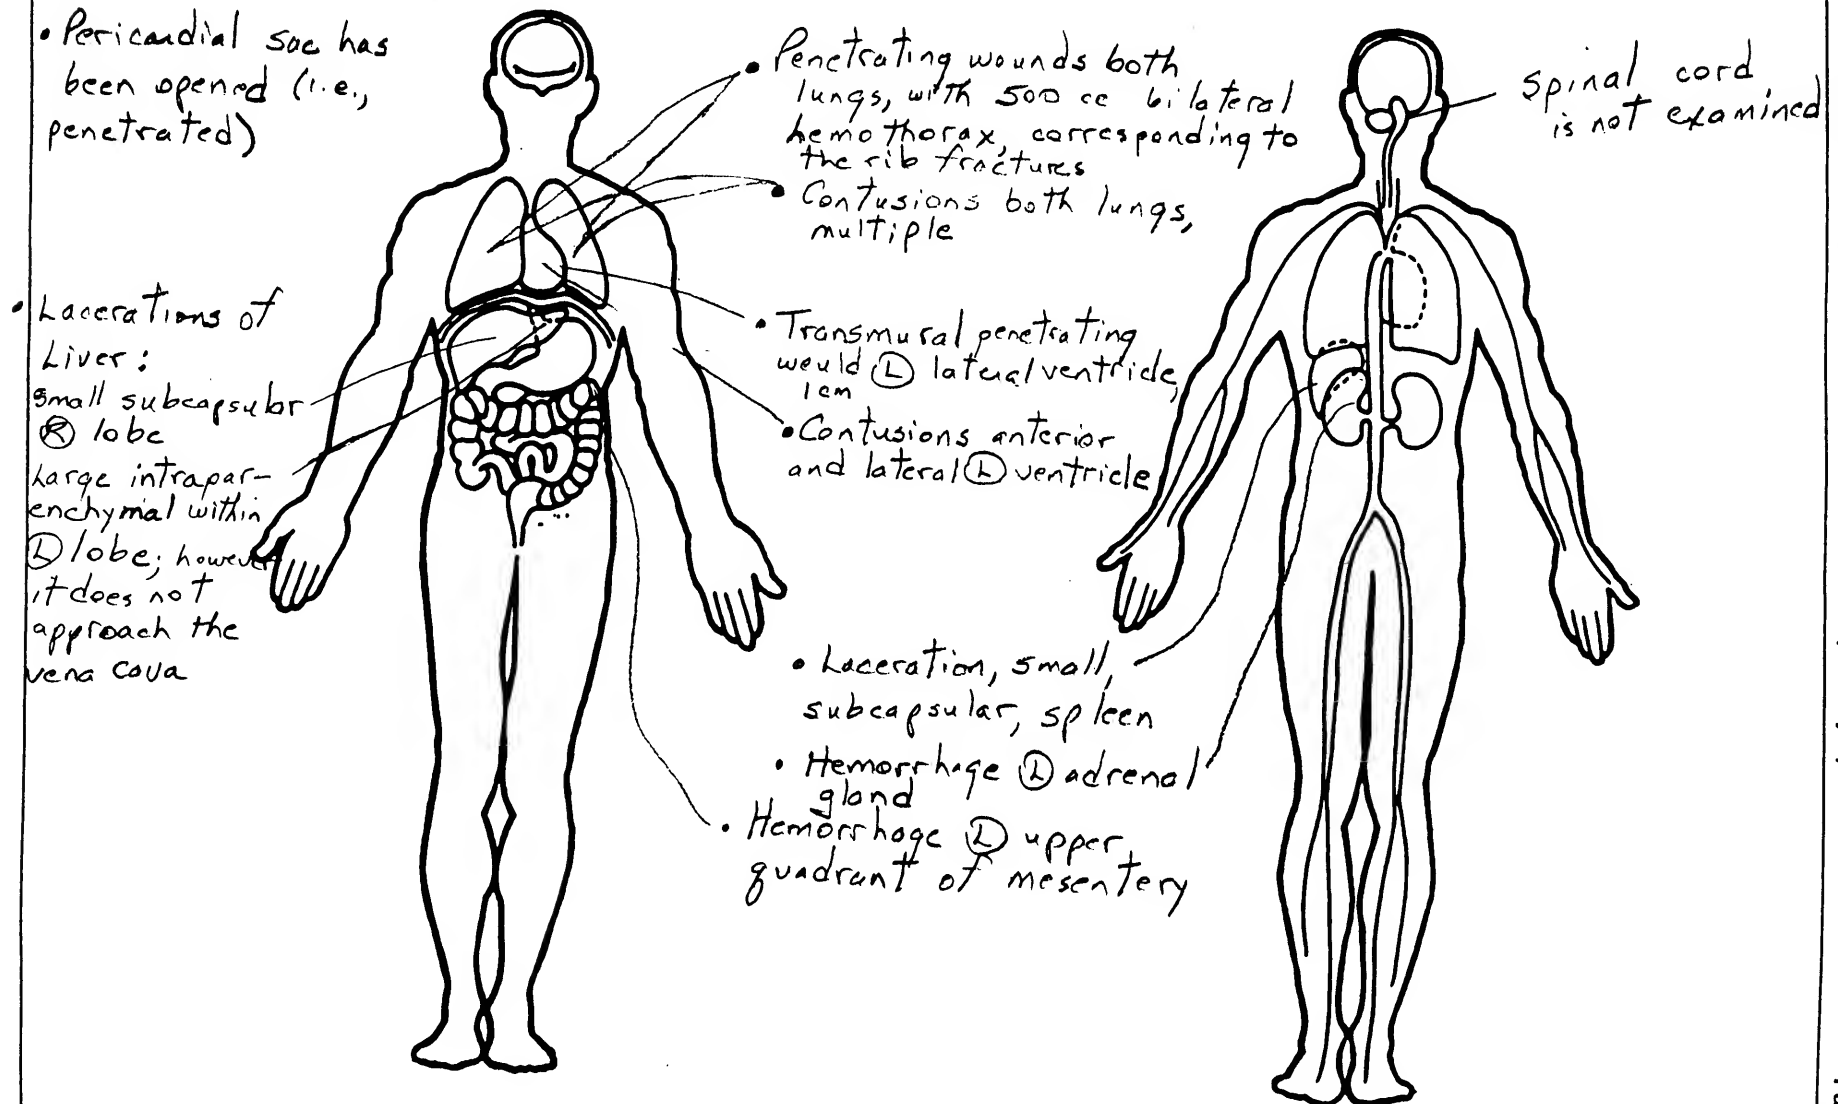

CAUSE OF DEATH

BEST AVAILABLE

Blunt force injuries of chest and abdomen

ICD-9-CM

OTHER DRUGS (GV16)

Specimen Test Type	Drug(s)	Drug Type
<input type="checkbox"/> Blood and urine tests <input type="checkbox"/> Blood test only <input checked="" type="checkbox"/> Urine test only <input type="checkbox"/> Other test <input type="checkbox"/> Unspecified	Urine positive for nicotine/tobacco Negative for: Opiates Amphetamines Barbiturates Benzodiazepines Cocaine metabolites THC metabolites Ethchlorvynol	other Narcotic Stimulant Depressant Depressant Stimulant Cannabinoid Depressant

MEDICAL RECORD ABBREVIATIONS

Symbol	Record Type Description
A	Autopsy—medical information based upon an invasive examination of a body
ME	Medical examiner's record—where the information reported on the patient is based on a non-invasive examination of the body
AR	Admission record/summary—any medical information on this record should be considered as post-ER since it summarizes the patient's admission; these records are common in short hospitalizations and usually only contain: admission DX(s), final DX(s), and a listing of surgical treatments; ICD-9-CM codes are frequently available.
FS	Admission/discharge face sheet—face sheets are essentially the same as admission record/summaries and contain the same types of information as discussed above
DS	Discharge summary—shorten history of a patient's hospitalization highlighting the patient's major injuries; this record is often written from the perspective of its author which in many cases is a consultant
OS	Operative record—summary of a performed surgical operation often providing detailed information about a specific trauma; patients who survive the surgery are normally admitted; thus, this record is normally considered post-ER; however, if this record results from an outpatient surgery, then treat it as emergency-room related
FX	Radiographic records—taken after the patient has been admitted, or while in surgery or intensive care
PN	Patient progress notes—supplemental record containing additional nurses notes taken after the patient's admission
HP	History and physical exam—medical history and the results of the physical exam obtained by the emergency room physician assigned to the patient upon arrival at the emergency room
CN	Consultation record—consultations are in essence additional history and physical exams performed by doctors whose expertise was requested by the emergency room physician; the consultation may occur during the emergency room visit or after admission
ER	Emergency room report—where the author of this information is undefined
EN	Emergency room nurse—"nurse/complaint of" section on the emergency room report
ED	Emergency room doctor—"objective/physical exam" section plus "diagnosis and treatment" sections (i.e., doctor portion of emergency room report)
NN	Nurse notes—supplemental record containing additional notes taken by the emergency room nurse(s)
EX	Radiographic records—taken during the patients stay in the emergency room
CV	Coroner's verdict—statement of cause of death for legal specific regarding injuries; care must be exercised to ascertain the credentials of the verdict's author.
CR	Coroner's report—medical information based upon a noninvasive examination performed by a person who is not a doctor but who has the title of a coroner
ET	Emergency medical technician—report by a person who qualifies as an emergency medical services technician (EMS or EMT)
O	Other source—medical information based on an other source (e.g., newspaper, DVM—Doctor of Veterinary Medicine)

TIME	B/P	PULSE	RESPIRATIONS	SpO ₂ %	PUPILS	SKIN
2240	76	Rate <input type="checkbox"/> Regular <input checked="" type="checkbox"/> Weak <input type="checkbox"/> Irregular <input type="checkbox"/> Bounding	Rate 112 <input type="checkbox"/> Clear <input type="checkbox"/> Wheezes <input type="checkbox"/> Rales <input type="checkbox"/> Equal <input type="checkbox"/> R > L <input type="checkbox"/> L > R <input type="checkbox"/> Normal <input type="checkbox"/> Labored <input type="checkbox"/> Assisted		<input type="checkbox"/> Peril <input type="checkbox"/> Non-React <input type="checkbox"/> Dilated <input type="checkbox"/> Constricted <input type="checkbox"/> Deviated <input type="checkbox"/> Unequal	<input type="checkbox"/> Warm <input type="checkbox"/> Dry <input type="checkbox"/> Moist <input type="checkbox"/> Cool <input type="checkbox"/> Clammy <input type="checkbox"/> Cold <input type="checkbox"/> Pale <input type="checkbox"/> Sweaty <input type="checkbox"/> Assisted <input type="checkbox"/> Cap. Refill <input type="checkbox"/> Sec.
2210	76	Rate <input type="checkbox"/> Regular <input checked="" type="checkbox"/> Weak <input type="checkbox"/> Irregular <input type="checkbox"/> Bounding	Rate <input type="checkbox"/> Clear <input type="checkbox"/> Wheezes <input type="checkbox"/> Rales <input type="checkbox"/> Equal <input type="checkbox"/> R > L <input type="checkbox"/> L > R <input type="checkbox"/> Normal <input type="checkbox"/> Labored <input type="checkbox"/> Assisted		<input type="checkbox"/> Peril <input type="checkbox"/> Non-React <input type="checkbox"/> Dilated <input type="checkbox"/> Constricted <input type="checkbox"/> Deviated <input type="checkbox"/> Unequal	<input type="checkbox"/> Warm <input type="checkbox"/> Dry <input type="checkbox"/> Moist <input type="checkbox"/> Cool <input type="checkbox"/> Clammy <input type="checkbox"/> Cold <input type="checkbox"/> Pale <input type="checkbox"/> Sweaty <input type="checkbox"/> Assisted <input type="checkbox"/> Cap. Refill <input type="checkbox"/> Sec.
		Rate <input type="checkbox"/> Regular <input type="checkbox"/> Weak <input type="checkbox"/> Irregular <input type="checkbox"/> Bounding	Rate <input type="checkbox"/> Clear <input type="checkbox"/> Wheezes <input type="checkbox"/> Rales <input type="checkbox"/> Equal <input type="checkbox"/> R > L <input type="checkbox"/> L > R <input type="checkbox"/> Normal <input type="checkbox"/> Labored <input type="checkbox"/> Assisted		<input type="checkbox"/> Peril <input type="checkbox"/> Non-React <input type="checkbox"/> Dilated <input type="checkbox"/> Constricted <input type="checkbox"/> Deviated <input type="checkbox"/> Unequal	<input type="checkbox"/> Warm <input type="checkbox"/> Dry <input type="checkbox"/> Moist <input type="checkbox"/> Cool <input type="checkbox"/> Clammy <input type="checkbox"/> Cold <input type="checkbox"/> Pale <input type="checkbox"/> Sweaty <input type="checkbox"/> Assisted <input type="checkbox"/> Cap. Refill <input type="checkbox"/> Sec.

O ₂ THERAPY				MEDICAL HISTORY													
TIME	DOSAGE LPM	ROUTE		Mark each matrix square which applies to injury to specific areas listed below													
				Head													
				Face / eye													
				Neck													
				Chest													
				Back													
				Abdomen													
				Upper arm / shoulder													
				Lower arm / elbow													
				Hand / wrist													
				Upper leg / hip													
				Lower leg / knee													
				Foot / Ankle													
GLASGOW COMA SCALE																	
Eyes	Spontaneous	4	4	Verbal Response	Oriented	5	5	Motor Response	Obeys commands	6	6	Total Score	Time	2152 2210			
	To verbal command	3	3		Confused	4	4		Localized pain	5	5						
	To pain	2	2		Inappropriate words	3	3		Withdraws	4	4						
	No response	1	1		Incomprehensible sounds	2	2		Abnormal flexion	3	3						
					No response	1	1		Abnormal extension	2	2						
NARRATIVE																	

TO THE SCENE		FROM THE SCENE		NO TRANSPORT		SCENE DEATH		WORK RELATED		SUSPECTED	
<input checked="" type="checkbox"/> Lights & Siren	<input type="checkbox"/> Lights & Siren	<input type="checkbox"/> Lights & Siren	<input type="checkbox"/> Lights & Siren	<input type="checkbox"/> Cancelled	<input type="checkbox"/> Refusal	<input type="checkbox"/> No Patient	<input type="checkbox"/> Pnv. Car	<input checked="" type="checkbox"/> No Transport	<input type="checkbox"/> Transport	<input type="checkbox"/> Yes	<input type="checkbox"/> No
<input type="checkbox"/> No Lights & Siren	<input type="checkbox"/> No Lights & Siren	<input type="checkbox"/> No Lights & Siren	<input type="checkbox"/> No Lights & Siren	<input type="checkbox"/> Refusal	<input type="checkbox"/> Refusal	<input type="checkbox"/> No Patient	<input type="checkbox"/> Pnv. Car	<input type="checkbox"/> No Transport	<input type="checkbox"/> Transport	<input type="checkbox"/> Yes	<input type="checkbox"/> No
SAFETY EQUIPMENT:				MODE OF INJURY				CARE PRIOR TO AMBULANCE ARRIVAL			
<input checked="" type="checkbox"/> Lap & Shoulder <input checked="" type="checkbox"/> Air Bag <input type="checkbox"/> Shoulder Strap <input type="checkbox"/> Lap Belt				<input type="checkbox"/> Secured Child Seat <input type="checkbox"/> Unsecured Child Seat <input type="checkbox"/> Helmet <input type="checkbox"/> None <input type="checkbox"/> Other				<input checked="" type="checkbox"/> Motorcycle <input checked="" type="checkbox"/> Motor Vehicle <input type="checkbox"/> Pedestrian <input type="checkbox"/> Poison <input type="checkbox"/> Stab / Cut <input type="checkbox"/> Thermal/Flame			
<input type="checkbox"/> Home <input checked="" type="checkbox"/> Street/Highway <input type="checkbox"/> Public Bldg. <input type="checkbox"/> Recreational site <input type="checkbox"/> Residential site				<input type="checkbox"/> Hospital <input type="checkbox"/> Clinic <input type="checkbox"/> Industrial Site <input type="checkbox"/> Extended Care Facility <input type="checkbox"/> Farm				<input type="checkbox"/> Fire Dept. <input type="checkbox"/> Police <input type="checkbox"/> Other Amb. <input type="checkbox"/> Bystander <input type="checkbox"/> Family			
<input type="checkbox"/> Driver <input type="checkbox"/> Passenger <input type="checkbox"/> Front <input type="checkbox"/> Rear <input type="checkbox"/> Ambulatory <input type="checkbox"/> Ejected				<input type="checkbox"/> Immobilization <input type="checkbox"/> CPR <input type="checkbox"/> Defib <input type="checkbox"/> Dressing <input type="checkbox"/> Extrication				<input type="checkbox"/> IV's <input type="checkbox"/> Medications <input type="checkbox"/> Oxygen <input type="checkbox"/> Airway mgt			
Incident: Time: _____				Witnessed Arrest <input type="checkbox"/> Yes <input type="checkbox"/> No				ALS on Scene Time: _____			
ALS EMS # _____											

Narrative should include a complete chronological flow of events, including times, patient condition, each procedure rendered and how each affected the patient's condition, and, if patient is monitored, describe ECG and staple ECG strip to original report.

Called to 10-50 type unknown @ St Rd
While enroute officer advised that it was a PI, head on
collision. At least two patients upon our arrival noted a dark BMC Sierra
full size pickup cab & heavy damage to front end & front corner pushed into driver
compartment. The second vehicle was an Isuzu Rodeo & the same kind of
damage. Two people in vehicle. was in the driver seat, driver door was
pushed in & was past rear passenger door. Air bag driver side deployed. Steering wheel was
beat down. was confused advised he wanted out of the vehicle, said that
his neck and back hurt. Pulse-radial was very weak - hard to find. Breathing was
labored. Placed C-collar on him from behind for that was the only access I had to
him. When placed C-collar noted that the trachea deviated B.I. totally

Signature of Paramedic _____ Chauffeur Name _____ Technician Name _____ Technician Name _____

Person receiving Pt _____ Medical Control _____ IHERN ☐ Cellular ☐ 800 meg ☐

BILLING INFORMATION			
Name of Guarantor	Relationship to Patient	Medicare Number	Mileage
Home Address (street, apartment /RR#, city or town, Zip code)	Employer	Medicaid Number	
	Home Telephone	State	Other Insurance Information

I request that payment of authorized Medicare benefits be made either to me or on my behalf for any services furnished me by the Columbus Regional Hospital. I authorize any holder of medical or information about me to release to the Health Care Financing Administration (HCFA) and its agents any information needed to determine these benefits or benefits for related services. I further authorize my treatment and transportation to the Columbus Regional Hospital.

AIRWAY						BLOOD	
Time	Attempts	Successful	Tube size	Initial	Blood drawn (time)		
					<input type="checkbox"/> Red	<input type="checkbox"/> Purple	
					<input type="checkbox"/> Blue	<input type="checkbox"/> Other	

ECG					
Defibrillation	<input type="checkbox"/> Automatic	Time			
<input type="checkbox"/> Manual	<input type="checkbox"/> Semi-automatic	Joules			
Cardiac pacing	Rate	/min	Electrical capture	mA	Time of mechanical capture
					Interpretation

After noting trachea distorted, evaluated for an active airway problem. Had a radial pulse, breathing shallow and less effective than by mouth. Not attempted intubation due to patient location. Attempted IV unsuccessful x2. B/P = 112/70. IV was due to mechanism of injury. At this time medic arrived, care was transferred to him and he called it as a 10-0. No further care was done for due to multiple injuries and length of extrication. Medic asked for the surgeon and was then asked to assist per Medical Control. No other changes noted during assistance.

Signature of Physician

Signature of Medics

Chauffeur

Tech

Gold Conv - Med. Dir.

SCHOOL OF MEDICINE
DEPARTMENT OF PATHOLOGY
FORENSIC DIVISION

AUTOPSY REPORT

Name: Autopsy No:
Age: 39 years Date: 1996
Sex: Male Time: 7:30 A.M.
Performed by: Performed for: County Coroner

ANATOMIC FINDINGS

1. Thoracic Trauma
 - A. transmural penetrating wound, lateral left ventricle
 - B. anterior and lateral left ventricular contusion
 - C. penetrating wounds and corresponding contusion of both lungs
 - D. 500 cc bilateral hemothorax
 - E. rib fractures: left 4th anteriorly, left 5th & 6th posteriorly, & right 4th through 6th laterally
2. Abdominal Trauma
 - A. subcapsular and intraparenchymal lacerations of the liver
 - B. small subcapsular splenic laceration
 - C. left upper quadrant mesenteric hemorrhage
 - D. left adrenal hemorrhage
3. Atlanto-occipital subluxation

TOXICOLOGY

Blood ethanol 34 mg/dL
Urine positive for nicotine and caffeine

CAUSE OF DEATH

Blunt Force Injuries of Chest and Abdomen

MANNER OF DEATH

Accident (Driver)

Ph.D., M.D.
Forensic Pathologist

M.D.
Resident Pathologist

Page 2

CIRCUMSTANTIAL SUMMARY

A middle aged white male who was involved in a head-on collision. He was an unrestrained driver struck by a person who crossed the midline.

DOCUMENTS AND EVIDENCE EXAMINED

Telephone conversation with _____ of the
County Coroner's Office.

X-RAYS

None

IDENTIFICATION

1996 at 7:30 A.M., a complete post mortem examination was performed on the body of _____ who was identified by _____ County Coroner's toe tag. Persons present for the autopsy included Dr. _____ and _____

CLOTHING AND VALUABLES: Shirt, jeans, boxers, belt, socks, 1 shoe full of glass, 1 diamond ring, 1 wedding band, 4 sets of keys, \$15.82, pocket knife, nail clippers, money clip, pack of cigarettes and lighter

EXTERNAL EXAMINATION

The body is that of a well developed, well nourished white male adult. The body length is 74 inches and the body weight is 166 pounds. Scalp hair is brown. Jaundice is not present in the skin or sclerae.

The head is normocephalic. The irides are blue and the sclerae are white. The pupils are round and equal in diameter. There are no contact lenses present and

there are no conjunctival petechiae. The nose is unremarkable. There is mucus in the nares and mouth. Teeth are present. There is no denture. Oral hygiene is good. The two ears are not pierced.

There is no significant increase in the anteroposterior diameter of the chest. The breasts are symmetrical without palpable masses and the nipples appear normal without discharge. The abdomen is not distended. The external genitalia are those of a long foreskin male adult. The anus is not dilated and has no evidence of injury.

The extremities are symmetrical and there are no significant deforming blunt force or penetrating injuries.

The following scars, nevi and tattoos are present: None

SIGNS OF DEATH: Rigor mortis is generalized and post mortem lividity is purple and fixed on the posterior surface of the body.

ARTIFACTS: The following artifacts of medical and post mortem care are present:
Cervical collar

The following artifacts of putrefaction are present: None

INJURIES

There are no external thoracic injuries. The left fourth rib is fractured in an anterior position beyond the costal chondral junction. The left fifth and sixth ribs are fractured in the posterior position. The right fourth, fifth and sixth ribs are fractured laterally. The left fifth and sixth ribs which are fractured, have perforated through the body wall and punctured the left lung. One of them has also punctured the lateral left ventricle in a through and through perforating injury. The pericardial sac has also been opened. There are also contusions and puncture wounds of the right lung. There are no external injuries to the abdomen. There is a small sub capsular hepatic laceration in the right lobe and a large intraparenchymal hepatic laceration within the left lobe of the liver. However, it does not approach the inferior vena cava. There is a small sub capsular laceration of the spleen. A hemorrhage is found within the left adrenal.

There are abrasions to the left cheek and over the adam's apple in the neck. Within the neck, there is an Atlanto-occipital subluxation. The back has multiple small lacerations associated with window glass over the shoulders. There are two small lacerations surrounded by contusion on the right thumb and a 2 inch abrasion on the left wrist. There are two small lacerations also on the left thumb. There is a rectangular patterned contusion above the right knee. Over the patella there is an abrasion that is 1 inch in diameter surrounded by a larger contusion and a contusion of the right medial calf. There is an abrasion of the right medial lower leg and ankle. There are also two small abrasions over the left knee. These injuries may reflect the body having collided with the dashboard.

INTERNAL EXAMINATION

SEROUS CAVITIES: The body cavities are opened with a standard Y-shaped incision. The cranial cavity is opened with a coronal incision of the scalp and removal of the calvarium. An odor like alcohol is apparent in the body cavities. The lungs are well aerated and fill the pleural cavities.

There is no evidence of pneumothorax. There is 500 ml of blood in either pleural cavity. The pleural surfaces are smooth and glistening and there are no pleural adhesions. The pericardial sac is opened. There is no evidence of pericarditis. There is no evidence of peritonitis. There is no blood in the peritoneal cavity. There is no ascitic fluid. After removal of the organs from the body, inspection of the serous cavities reveals no evidence of fracture of the sternum, clavicles, vertebral column or pelvic bones. The left 4th rib is fractured anteriorly and the 5th and 6th left ribs are fractured posteriorly. The right 4th-6th ribs are fractured laterally. Contusion hemorrhage is present in the body walls.

NECK ORGANS: The larynx and trachea are in the midline. The neck dissection is performed following removal of the thoracoabdominal viscera. No significant hemorrhage is present in the skin, fat or sternocleidomastoid muscles of the anterior neck. The strap muscles are free of hemorrhage. The thyroid gland is symmetrical and composed of reddish-brown parenchyma. There is no hemorrhage in the intrinsic muscles of the larynx. The laryngeal cartilages and hyoid bone are not fractured. There is no obstruction of the respiratory tract in the nasopharynx, larynx or trachea. There is scant mucus in the larynx. The mucosa of the hypopharynx, larynx

and trachea is smooth and glistening without ulceration or tumor. The arytenoides muscles are free of hemorrhage. Cervical lymph nodes are appropriate for age. No fractures or dislocations of the cervical vertebrae are detected.

THYMUS: The thymus is not identified.

HEART: The 370 gram heart is in usual position with respect to the great vessels and chest cavity. The left ventricle is firm. The left ventricle is not significantly hypertrophied and the cardiac chambers are not dilated. On opening the aorta and pulmonary trunk, there is no evidence of air embolism and there is no evidence of pulmonary thromboembolism. There is no evidence of pericarditis. There are no epicardial petechiae. The circumflex coronary artery arises from the left main coronary. The coronary arteries are examined by multiple cross sections. There is no significant atherosclerotic plaque in the major coronary arteries.

The left main coronary artery is generally not narrowed by plaque. The left anterior descending coronary artery is generally not narrowed by plaque. The circumflex coronary artery is generally not narrowed by plaque. The right coronary artery is generally not narrowed by plaque.

Thrombosis of a coronary artery is not present. The cardiac valve leaflets are delicate, translucent and membranous. The circumferences of the cardiac valves are within normal limits for age and heart size.

There is no softening or mottling of the myocardium due to recent myocardial infarction or necrosis. There is no myocardial fibrosis. There is a transmural puncture wound in the lateral left ventricle that measures 1 cm. There is no myocardial contusion. There are no defects in the atrial or ventricular septa. The ductus arteriosus is not patent. Autolysis is not significant.

VASCULAR SYSTEM: The aorta and its main branches show no atherosclerosis. There is no evidence of aneurysm, coarctation, dissection or laceration of the aorta. The renal arteries are not stenotic.

LUNGS: Right: 490 grams. Left: 660 grams. There is moderate bilateral atelectasis. The trachea is complete, without malformation, from the larynx to the carina. There is no aspirated gastric material and no aspirated blood in the trachea. The distal

bronchi contain scant mucus. The pleural surfaces are smooth and glistening. No petechiae are visible. The lungs and hilar nodes are moderately anthracotic and there is mild centrilobular emphysema. There are focal small blebs at the pleural surface of the left lung. On cut section, there is no aspirated blood apparent in alveoli. Bronchopneumonia is not recognized. There is no focal consolidation and no tumor. There is no significant passive congestion of the lungs. There is no evidence of pulmonary edema. There are penetrating wounds of both lungs corresponding to the rib fractures. There are multiple pulmonary contusions. Pulmonary thromboemboli are not present. There is no putrid gas cavitation.

LIVER: The 1670 gram liver has a focally lacerated capsular surface. There is a small right subcapsular laceration and a large left intraparenchymal laceration at approximately the venacula. On cut section, the parenchyma has a nutmeg brown and tan pattern and a lobular architecture. The liver is not significantly passively congested. Metastatic tumor is not present. The hepatic duct is patent. The gallbladder is present. There are no gallstones. Autolysis of the liver is not significant.

PANCREAS: The pancreas is appropriate in shape and size with respect to total body fat stores. On cut surface, it is lobular with interspersed fat without focal calcification, fibrosis, hemorrhage and/or fat necrosis. Autolysis is not significant.

GASTROINTESTINAL SYSTEM: The esophagus is lined with glistening white mucosa. The stomach is coarsely rugated. The stomach contains 50 ml of fluid. There is an odor like alcohol in the stomach. There are no erosions or ulcers in the stomach or duodenum. There is a small mesenteric hemorrhage in the left upper quadrant. The small bowel and colon are intact without perforation, diverticula or palpable tumors. The vermiform appendix is present.

SPLEEN: The 200 gram spleen is composed of very soft red and white trabecular pulp. There is slight laceration of the splenic capsule. Autolysis is not significant.

ADRENALS: Two adrenals are present with golden brown cortex and white medulla.

There is a left adrenal hemorrhage. No cortical nodules are present in either adrenal. Autolysis is not significant.

URINARY TRACT: Right kidney: 120 grams. Left kidney: 150 grams. The two kidneys, ureters and a bladder are present in their usual positions without dilatation. The kidneys are symmetrical in shape and size. The capsules strip from the cortices with ease and the cortical surfaces are smooth. On cut section, the cortex appears of ample thickness and the medulla appears ample. The kidneys are not congested. There are no stones or tumors in the kidneys, pelvis, ureters or bladder. The mucosa of the urinary bladder appears glistening. Autolysis of the kidneys is not significant.

REPRODUCTIVE SYSTEM: The prostate is not enlarged. The testes are descended into the scrotum and are usual in size for the age.

CENTRAL NERVOUS SYSTEM: There is no hemorrhage in the scalp and galea. The dura, removed by stripping from the calvarium and base of the skull, shows no epidural or subdural hemorrhage. The cerebral and cerebellar hemispheres of the 1500 gram brain are symmetrical. The leptomeninges are transparent and can be stripped with ease. There is no subarachnoid hemorrhage. There is no flattening of the gyri and no widening of the sulci. The major vessels at the base of the brain have a usual anatomic distribution and there is no significant atherosclerosis. The cranial nerves are symmetrical and intact. There is no evidence of herniation at any of the portals of the brain. On serial coronal sectioning of the brain, there is no internal evidence of contusion, edema, hemorrhage, tumor, atrophy, infection or infarction in the cerebrum, cerebellum and brain stem. There are no fractures of the convexity or base of the skull. There is an Atlanto-occipital subluxation. The spinal cord is not examined.

PHOTOGRAPHS: None

SPECIMENS FOR FIREARMS EXAMINATION OR TRACE EVIDENCE: None

SPECIMENS FOR TOXICOLOGY: Blood and urine
Specimens Analyzed: Blood and urine

SPECIMENS FOR CHEMICAL ANALYSIS: None

SPECIMENS FOR CULTURE: None

MICROSCOPIC EXAMINATION: Tissue samples representative of the major organs and injuries have been processed onto glass slides for microscopic examination. These histologic specimens have been examined and there are no additional significant pathologic findings other than those noted on the Anatomic Findings.

UNIVERSITY

FORENSIC TOXICOLOGY REPORT

SCHOOL OF MEDICINE

Demographic Data:

Name:

Submitted by:

Forensic Pathology

Specimens:

1

Blood, gray top

1

Urine (7 mL)

Case No.:

Date submitted:

0830

96-7760

96-7761

Chain of Custody:

Acceptable

Tests ordered:

Blood volatile screen; Urine drug screen

RESULTS

Blood Volatile Screen

Positive
Ethanol

34 mg/dL

Urine Immunoassay Screens

Opiates

Negative

Amphetamines

Negative

Barbiturates

Negative

Benzodiazepines

Negative

Cocaine metabolites

Negative

THC metabolites

Negative

Urine ethchlorvynol spot test

Negative

Urine basic drug GC/MS Screen

consistent with:

Nicotine/Cotinine
Caffeine

DEPARTMENT OF PATHOLOGY
AND LABORATORY MEDICINE

Results reviewed by:

DRUG ANALYSIS LABORATORY
FOR
ATHLETIC DRUG TESTING
AND TOXICOLOGY

Date:

9/6

NASS CDS OCCUPANT ASSESSMENT FORM:
CASE VEHICLE RIGHT FRONT PASSENGER



U.S. Department of Transportation
National Highway Traffic Safety
Administration

OCCUPANT ASSESSMENT FORM

Form Approved
O.M.B. No. 2127-0021

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

<p>1. Primary Sampling Unit Number <u>10</u></p> <p>2. Case Number - Stratum <u>9616</u></p> <p>3. Vehicle Number <u>01</u></p> <p>4. Occupant Number <u>02</u></p>	<p style="text-align: center;">OCCUPANT'S SEATING</p> <p>10. Occupant's Seat Position <u>13</u></p> <p><i>Front Seat</i></p> <p>(11) Left side</p> <p>(12) Middle</p> <p>(13) Right side</p> <p>(14) Other (specify): _____</p> <p>(15) On or in the lap of another occupant</p> <p><i>Second Seat</i></p> <p>(21) Left side</p> <p>(22) Middle</p> <p>(23) Right side</p> <p>(24) Other (specify): _____</p> <p>(25) On or in the lap of another occupant</p> <p><i>Third Seat</i></p> <p>(31) Left side</p> <p>(32) Middle</p> <p>(33) Right side</p> <p>(34) Other (specify): _____</p> <p>(35) On or in the lap of another occupant</p> <p><i>Fourth Seat</i></p> <p>(41) Left side</p> <p>(42) Middle</p> <p>(43) Right side</p> <p>(44) Other (specify): _____</p> <p>(45) On or in the lap of another occupant</p> <p>(97) In or on unenclosed area</p> <p>(98) Other seat (specify): _____</p> <p>(99) Unknown</p>
<p style="text-align: center;">OCCUPANT'S CHARACTERISTICS</p> <p>5. Occupant's Age <u>49</u></p> <p>Code actual age at time of accident.</p> <p>(00) Less than one year old (specify by month): _____</p> <p>(97) 97 years and older</p> <p>(99) Unknown</p> <p>6. Occupant's Sex <u>2</u></p> <p>(1) Male</p> <p>(2) Female-not reported pregnant</p> <p>(3) Female-pregnant-1st trimester(1st-3rd month)</p> <p>(4) Female-pregnant-2nd trimester(4th-6th month)</p> <p>(5) Female-pregnant-3rd trimester(7th-9th month)</p> <p>(6) Female-pregnant-term unknown</p> <p>(9) Unknown</p> <p>7. Occupant's Height <u>168</u></p> <p>Code actual height to the nearest centimeter.</p> <p>(999) Unknown</p> <p><u>66</u> inches X 2.54 = <u>167.6</u> centimeters</p> <p>8. Occupant's Weight <u>092</u></p> <p>Code actual weight to the nearest kilogram.</p> <p>(999) Unknown</p> <p><u>202</u> pounds X .4536 = <u>91.6</u> kilograms</p> <p>9. Occupant's Role <u>2</u></p> <p>(1) Driver</p> <p>(2) Passenger</p> <p>(9) Unknown</p>	<p>11. Occupant's Posture <u>9</u></p> <p>(0) Normal posture</p> <p><i>Abnormal posture</i></p> <p>(1) Kneeling or standing on seat</p> <p>(2) Lying on or across seat</p> <p>(3) Kneeling, standing or sitting in front of seat</p> <p>(4) Sitting sideways or turned to talk with another occupant or to look out a rear window</p> <p>(5) Sitting on a console</p> <p>(6) Lying back in a reclined seat position</p> <p>(7) Bracing with feet or hands on a surface in front of seat</p> <p>(8) Other abnormal posture (specify): _____</p> <p>(9) Unknown</p>

EJECTION/ENTRAPMENT12. Ejection 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____
- (5) Integral structure
- (8) Other medium (specify): _____
- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 0

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors, fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility 0

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or not oriented to time or place
- (2) Removed from vehicle due to perceived serious injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (8) Removed from vehicle for other reasons
(specify): _____
- (9) Unknown

BELT SYSTEM FUNCTION

<p>18. Manual (Active) Belt System Availability 4</p> <p>(0) None available</p> <p>(1) Belt removed/destroyed</p> <p>(2) Shoulder belt</p> <p>(3) Lap belt</p> <p>(4) Lap and shoulder belt</p> <p>(5) Belt available—type unknown</p> <p><i>Integral Belt Partially Destroyed</i></p> <p>(6) Shoulder belt (lap belt destroyed/removed)</p> <p>(7) Lap belt (shoulder belt destroyed/removed)</p> <p>(8) Other belt (specify): _____</p> <p>(9) Unknown</p>	<p>22. Manual Shoulder Belt Upper Anchorage Adjustment 1</p> <p>(0) No manual shoulder belt</p> <p>(1) No upper anchorage adjustment for manual shoulder belt</p> <p><i>Adjustable shoulder Belt Upper Anchorage</i></p> <p>(2) In full up position</p> <p>(3) In mid position</p> <p>(4) In full down position</p> <p>(5) Position unknown</p> <p>(9) Unknown if position has adjustable upper anchorage adjustment</p>
<p>19. Manual (Active) Belt System Use 0 4</p> <p>(00) None used, not available, or belt removed/destroyed</p> <p>(01) Inoperative (specify): _____</p> <p>(02) Shoulder belt</p> <p>(03) Lap belt</p> <p>(04) Lap and shoulder belt</p> <p>(05) Belt used—type unknown</p> <p>(08) Other belt used (specify): _____</p> <p>(12) Shoulder belt used with child safety seat</p> <p>(13) Lap belt used with child safety seat</p> <p>(14) Lap and shoulder belt used with child safety seat</p> <p>(15) Belt used with child safety seat—type unknown</p> <p>(18) Other belt used with child safety seat (specify): _____</p> <p>(99) Unknown if belt used</p>	<p>23. Automatic (Passive) Belt System Availability/Function 0</p> <p>(0) Not equipped/not available</p> <p>(1) 2 point automatic belts</p> <p>(2) 3 point automatic belts</p> <p>(3) Automatic belts - type unknown</p> <p><i>Non-functional</i></p> <p>(4) Automatic belts destroyed or rendered inoperative</p> <p>(9) Unknown</p> <p>24. Automatic (Passive) Belt System Use 0</p> <p>(0) Not equipped/not available/destroyed or rendered inoperative</p> <p>(1) Automatic belt in use</p> <p>(2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____</p> <p>(3) Automatic belt use unknown</p> <p>(9) Unknown</p>
<p>20. Proper Use of Manual (Active) Belts 1</p> <p>(0) None used or not available</p> <p>(1) Belt used properly</p> <p>(2) Belt used properly with child safety seat</p> <p><i>Belt Used Improperly</i></p> <p>(3) Shoulder belt worn under arm</p> <p>(4) Shoulder belt worn behind back or seat</p> <p>(5) Belt worn around more than one person</p> <p>(6) Lap belt worn on abdomen</p> <p>(7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____</p> <p>(8) Other improper use of manual belt system (specify): _____</p> <p>(9) Unknown</p>	<p>25. Automatic (Passive) Belt System Type 0</p> <p>(0) Not equipped/not available</p> <p>(1) Non-motorized system</p> <p>(2) Motorized system</p> <p>(9) Unknown</p> <p>26. Proper Use of Automatic (Passive) Belt System 0</p> <p>(0) Not equipped/not available/not used</p> <p>(1) Automatic belt used properly</p> <p>(2) Automatic belt used properly with child safety seat</p> <p><i>Automatic Belt Used Improperly</i></p> <p>(3) Automatic shoulder belt worn under arm</p> <p>(4) Automatic shoulder belt worn behind back</p> <p>(5) Automatic belt worn around more than one person</p> <p>(6) Lap portion of automatic belt worn on abdomen</p> <p>(7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____</p> <p>(8) Other improper use of automatic belt system (specify): _____</p> <p>(9) Unknown</p>
<p>21. Manual (Active) Belt Failure Modes During Accident 1</p> <p>(0) No manual belt used or not available</p> <p>(1) No manual belt failure(s)</p> <p>(2) Torn webbing (stretched webbing not included)</p> <p>(3) Broken buckle or latchplate</p> <p>(4) Upper anchorage separated</p> <p>(5) Other anchorage separated (specify): _____</p> <p>(6) Broken retractor</p> <p>(7) Combination of above (specify): _____</p> <p>(8) Other manual belt failure (specify): _____</p> <p>(9) Unknown</p>	<p>27. Automatic (Passive) Belt Failure Modes During Accident 0</p> <p>(0) Not equipped/not available/not in use</p> <p>(1) No automatic belt failure(s)</p> <p>(2) Torn webbing (stretched webbing not included)</p> <p>(3) Broken buckle or latchplate</p> <p>(4) Upper anchorage separated</p> <p>(5) Other anchorage separated (specify): _____</p> <p>(6) Broken retractor</p> <p>(7) Combination of above (specify): _____</p> <p>(8) Other automatic belt failure (specify): _____</p> <p>(9) Unknown</p>

POLICE REPORTED RESTRAINT USE28. Police Reported Belt Use 4

- (0) None used
 (1) Police did not indicate belt use
 (2) Shoulder belt
 (3) Lap belt
 (4) Lap and shoulder belt
 (5) Belt used, type not specified
 (6) Child safety seat
 (7) Automatic belt
 (8) Other type belt, (specify):

(9) Police indicated "unknown"

29. Police Reported Air Bag Availability/Function 1

- (0) No air bag available
 (1) Police did not indicate air bag availability/function
 (2) Deployed
 (3) Not deployed
 (4) Unknown if deployed
 (9) Police indicated "unknown"

Check the Primary Source Used In Determining Belt Use.

- ☒ Vehicle inspection
☐ Official injury data
☐ Driver/occupant interview
☐ Other (specify):

☐ Unknown if belt used

AIR BAG SYSTEM FUNCTION30. Frontal Air Bag System Availability/Function 1
(This Occupant Position)

- (0) Not equipped/not available
 (1) Air bag

Non-functional

- (2) Air bag disconnected (specify):

- (3) Air bag not reinstalled
 (9) Unknown

31. Frontal Air Bag System Deployment 1
(This Occupant Position)

- (0) Not equipped/not available
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

32. Other Than First Seat Frontal Air Bag Availability/Function 0
(This Occupant Position)

- (0) Not equipped/not available
 (1) Air bag

Non-functional

- (2) Air bag disconnected (specify):

- (3) Air bag not reinstalled
 (9) Unknown

Specify type of "other" air bag present:

33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) 0

- (0) Not equipped with an "other" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

34. Are There Indications of Air Bag System Failure? 1
(This Occupant Position)

- (0) Not equipped/not available
 (1) No
 (2) Yes (specify):

(9) Unknown

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

35. Had Vehicle Been in Previous Accident(s)? 1

- (0) Not equipped/not available
(1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
(3) One previous accident with deployment
(4) More than one previous accident with at least one deployment
(8) Previous accidents, unknown deployment status
(9) Unknown

36. Type of Air Bag 1

- (0) Not equipped/not available
(1) Original manufacturer installed system
(2) Retrofitted air bag
(3) Replacement air bag
(8) Unknown type of air bag
(9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 1

- (0) Not equipped/not available
(1) No prior maintenance
(2) Yes, prior maintenance (specify): _____

(9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 01

- (00) Not equipped/not available
_____ Code the accident event sequence number that initiated the air bag deployment

- (96) Deployed, unknown event
(97) Not deployed
(98) Unknown if deployed
(99) Unknown

39. CDC For Air Bag Deployment Impact 1

- (0) Not equipped/not available
(1) Highest delta V
(2) Second highest delta V
(3) Other non-coded delta V (specify): _____

- (6) Deployed, unknown event
(7) Not deployed
(8) Unknown if deployed
(9) Unknown

40. Longitudinal Component of Delta V For Air Bag Deployment Impact + 041

- (_000) Not equipped/not available

Code the value of the delta V for the impact that initiated the air bag deployment

- (_996) Deployment, unknown longitudinal Delta V
(_997) Not deployed
(_998) Unknown if deployed
(_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 2

- (0) Not equipped/not available
(1) No
(2) Yes
(3) Deployed, unknown if flap(s) opened at designated tear points
(7) Not deployed
(8) Unknown if deployed
(9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 1

- (0) Not equipped/not available
(1) No
(2) Yes (specify): _____
(3) Deployed, unknown if air bag module cover flap(s) damaged
(7) Not deployed
(8) Unknown if deployed
(9) Unknown

43. Was There Damage To The Air Bag? 01

- (00) Not equipped/not available
(01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
(03) Cut
(04) Torn
(05) Holed
(06) Burned
(07) Abraded
(88) Other damage (specify): _____

- (95) Damaged, details unknown
(96) Deployed, unknown if damaged
(97) Not deployed
(98) Unknown if deployed
(99) Unknown

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*

44. Source of Air Bag Damage 01
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):
 (03) Object carried by occupant, (specify):
 (04) Adaptive/assistive controls, (specify):
 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (08) Other damage source (specify):
 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):
Two
 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):
Two
 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 1
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):
 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 1
 (0) Not air bag equipped/air bag not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION


49. Head Restraint Type/Damage by Occupant at This Occupant Position 3
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):
 (9) Unknown
50. Seat Type (this Occupant Position) 02
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):
 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):
 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 6
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track
Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position *per*
 (9) Unknown *Vehicle Inspection*

HEAD RESTRAINT AND SEAT EVALUATION *continued*53. Seat Back Incline Prior and Post Impact 23


- (00) Occupant not seated or no seat
 (01) Not adjustable

Upright prior to impact


- (11) Moved to completely rearward position
 (12) Moved to rearward midrange position
 (13) Moved to slightly rearward position
 (14) Retained pre-impact position
 (15) Moved to slightly forward position
 (16) Moved to forward midrange position
 (17) Moved to completely forward position

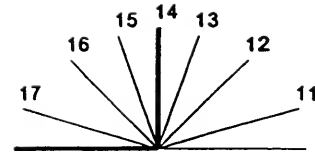***Slightly reclined prior to impact***

- (21) Moved to completely rearward position
 (22) Moved to rearward midrange position
 (23) Retained pre-impact position
 (24) Moved to upright position
 (25) Moved to slightly forward position
 (26) Moved to forward midrange position
 (27) Moved to completely forward position

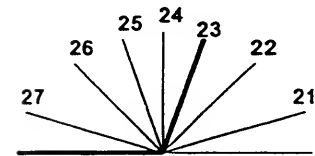***Completely reclined prior to impact***

- (31) Retained pre-impact position
 (32) Moved to rearward midrange position
 (33) Moved to slightly rearward position
 (34) Moved to upright position
 (35) Moved to slightly forward position
 (36) Moved to forward midrange position
 (37) Moved to completely forward position

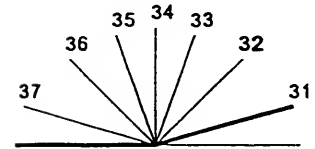

(99) Unknown

54. Seat Performance (this Occupant Position) 1

- (0) Occupant not seated or no seat
 (1) No seat performance failure(s)
 (2) Seat adjusters failed
 (3) Seat back folding locks or "seat back" failed (specify): _____
 (4) Seat track/anchors failed
 (5) Deformed by impact of occupant
 (6) Deformed by passenger compartment intrusion, (specify): _____
 (7) Combination of above (specify): _____
 (8) Other (specify): _____
 (9) Unknown

CHILD SAFETY SEAT55. Child Safety Seat Make/Model 000

(000) No child safety seat

Applicable codes are found in your NASS CDS
Data Collection, Coding and Editing

(950) Built-in child safety seat

(997) Other make/model (specify):

(998) Unknown make/model

(999) Unknown if child safety seat used

56. Type of Child Safety Seat 0

(0) No child safety seat

(1) Infant seat

(2) Toddler seat

(3) Convertible seat

(4) Booster seat - with shield

(5) Booster seat - without shield

(7) Other type child safety seat (specify):

(8) Unknown child safety seat type

(9) Unknown if child safety seat used

57. Child Safety Seat Orientation 00

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing

(02) Forward facing

(08) Other orientation (specify):

(09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing

(12) Forward facing

(18) Other orientation (specify):

(19) Unknown orientation

*Unknown Design or Orientation For This
Age/Weight, or Unknown Age/Weight*

(21) Rear facing

(22) Forward facing

(28) Other orientation (specify):

(29) Unknown orientation

(99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 0059. Child Safety Seat Shield Usage 0060. Child Safety Seat Tether Usage 00Note: Options below applicable to
Variables OA58-OA60.

(00) No child safety seat

Not Designed With Harness/Shield/Tether(01) After market harness/shield/tether
added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market
harness/shield/tether added(09) Unknown if harness/shield/tether
added or used*Designed With Harness/Shield/Tether*

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES61. Injury Severity (Police Rating) 4

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 1

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

64. Hospital Stay 00

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 62

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP WORK HERE**VARIABLES 66-74****TO BE CODED BY THE ZONE CENTER**

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES**

66. Time to Death 01
 Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
 (00) Not fatal
 (96) Fatal - ruled disease
 (99) Unknown

67. 1st Medically Reported Cause of Death 01

68. 2nd Medically Reported Cause of Death 03

69. 3rd Medically Reported Cause of Death 02
 Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
 (00) Not fatal or no additional causes
 (96) Mode of death given but specific injuries are not linked to cause of death. (specify):
 (97) Other result (includes fatal ruled disease) (specify):
 (99) Unknown

70. Number of Recorded Injuries for This Occupant 09
9 Code the actual number of injuries recorded for this occupant.
 (00) No recorded injuries
 (97) Injured, details unknown
 (99) Unknown if injured

TRAUMA DATA

71. Glasgow Coma Scale (GCS) Score 01
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured

72. Was the Occupant Given Blood? 1
 (1) No - blood not given
 (2) Yes - blood given
 (specify units):
 (9) Unknown if blood given

73. Arterial Blood Gases (ABG) - HCO₃ 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO₃
 (96) ABGs reported, HCO₃ unknown
 (97) Injured, details unknown
 (99) Unknown if injured

BELT USE DETERMINATION

74. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify):
 (9) Unknown if belt used

NASS CDS OCCUPANT INJURY FORM:
CASE VEHICLE RIGHT FRONT PASSENGER



U.S. Department of Transportation
National Highway Traffic Safety
Administration

OCCUPANT INJURY FORM

BEST AVAILABLE

Form Approved
O.M.B. No. 2127-0021

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number	<u>10</u>	3. Vehicle Number	<u>01</u>
2. Case Number - Stratum	<u>9616</u>	4. Occupant Number	<u>02</u>

INJURY DATA														
Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.														
A.I.S. - 90														
Source of Injury Data	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect	Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number				
Laceration Basilar 1st Artery	5. <u>1</u>	6. <u>1</u>	7. <u>2</u>	8. <u>04</u>	9. <u>02</u>	10. <u>5</u>	11. <u>9</u>	12. <u>180</u>	13. <u>3</u>	14. <u>2</u>	15. <u>00</u>			
Subarachnoid 2nd Hemorrhage	16. <u>1</u>	17. <u>1</u>	18. <u>4</u>	19. <u>06</u>	20. <u>24</u>	21. <u>3</u>	22. <u>9</u>	23. <u>180</u>	24. <u>3</u>	25. <u>2</u>	26. <u>00</u>			
Subluxation Atlanto 3rd Occipital	27. <u>1</u>	28. <u>6</u>	29. <u>5</u>	30. <u>02</u>	31. <u>08</u>	32. <u>2</u>	33. <u>6</u>	34. <u>180</u>	35. <u>3</u>	36. <u>2</u>	37. <u>00</u>			
Contusion 4th Shoulder	38. <u>1</u>	39. <u>7</u>	40. <u>9</u>	41. <u>04</u>	42. <u>02</u>	43. <u>1</u>	44. <u>1</u>	45. <u>152</u>	46. <u>1</u>	47. <u>1</u>	48. <u>00</u>			
Contusion Chest 5th	49. <u>1</u>	50. <u>4</u>	51. <u>9</u>	52. <u>04</u>	53. <u>02</u>	54. <u>1</u>	55. <u>4</u>	56. <u>152</u>	57. <u>1</u>	58. <u>1</u>	59. <u>00</u>			
Contusion across 6th abdomen	60. <u>1</u>	61. <u>5</u>	62. <u>9</u>	63. <u>04</u>	64. <u>02</u>	65. <u>1</u>	66. <u>5</u>	67. <u>152</u>	68. <u>1</u>	69. <u>1</u>	70. <u>00</u>			
Abrasion 7th groin	71. <u>1</u>	72. <u>8</u>	73. <u>9</u>	74. <u>02</u>	75. <u>02</u>	76. <u>1</u>	77. <u>1</u>	78. <u>697</u>	79. <u>9</u>	80. <u>7</u>	81. <u>99</u>			
Contusion 8th Thigh	82. <u>1</u>	83. <u>8</u>	84. <u>9</u>	85. <u>04</u>	86. <u>02</u>	87. <u>1</u>	88. <u>2</u>	89. <u>697</u>	90. <u>9</u>	91. <u>7</u>	92. <u>99</u>			
Lacerations 9th Thigh	93. <u>1</u>	94. <u>8</u>	95. <u>9</u>	96. <u>06</u>	97. <u>02</u>	98. <u>1</u>	99. <u>2</u>	100. <u>601</u>	101. <u>3</u>	102. <u>3</u>	103. <u>00</u>			
10th	104. <u> </u>	105. <u> </u>	106. <u> </u>	107. <u> </u>	108. <u> </u>	109. <u> </u>	110. <u> </u>	111. <u> </u>	112. <u> </u>	113. <u> </u>	114. <u> </u>			

OCCUPANT INJURY DATA

	Source of Injury Data	Body Region	Type of Anatomic Structure	A.I.S. - 90			Aspect	Injury Source	Injury Source Confidence Level	Direct/ Indirect Injury	Occupant Area Intrusion Number
				Specific Anatomic Structure	Level of Injury	A.I.S. Severity					
11th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
12th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
13th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
14th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
15th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
16th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
17th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
18th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
19th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
20th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
21st	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
22nd	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
23rd	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
24th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —
25th	—	—	—	— — —	— — —	—	—	— — — —	—	—	— — —

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Level of Injury	Aspect
(1) Head		Specific injuries are assigned consecutive two-digit numbers beginning with 02.	(1) Right
(2) Face			(2) Left
(3) Neck	<u>Vessels, Nerves, Organs.</u>		(3) Bilateral
(4) Thorax	<u>Bones, Joints</u> are assigned consecutive two digit numbers beginning with 02.		(4) Central
(5) Abdomen			(5) Anterior
(6) Spine		To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.	(6) Posterior
(7) Upper Extremity			(7) Superior
(8) Lower Extremity			(8) Inferior
(9) Unspecified	The exceptions to this rule apply to:		(9) Unknown
			(0) Whole region
Type of Anatomic Structure	<u>Whole Area</u>		
(1) Whole Area	(02) Skin - Abrasion		
(2) Vessels	(04) Skin - Contusion		
(3) Nerves	(06) Skin - Laceration		
(4) Organs (includes Muscles/ligaments)	(08) Skin - Avulsion		
(5) Skeletal (includes joints)	(10) Amputation		
(6) Head - LOC	(20) Burn		
(9) Skin	(30) Crush		
	(40) Degloving		
	(50) Injury - NFS		
	(90) Trauma, other than mechanical		
	<u>Head - LOC</u>		
	(02) Length of LOC		
	(04) Level		
	(06) of		
	(08) Consciousness		
	(10) Concussion		
	<u>Spine</u>		
	(02) Cervical		
	(04) Thoracic		
	(06) Lumbar		

Abbreviated Injury Scale

- | |
|-------------------------------|
| (1) Minor Injury |
| (2) Moderate Injury |
| (3) Serious Injury |
| (4) Severe Injury |
| (5) Critical Injury |
| (6) Maximum (untreatable) |
| (7) Injured, unknown severity |

SOURCE OF INJURY DATA**INJURY SOURCE****DIRECT/INDIRECT INJURY****CONFIDENCE LEVEL****OFFICIAL RECORDS**

- | | | |
|--|--------------|-----------------------------|
| (1) Autopsy records with or without hospital/medical records | (1) Certain | (1) Direct contact injury |
| (2) Hospital/medical records other than emergency room (e.g., discharge summary) | (2) Probable | (2) Indirect contact injury |
| (3) Emergency room records only (including associated X-rays or other lab reports) | (3) Possible | (3) Noncontact injury |
| (4) Private physician, walk-in or emergency clinic | (9) Unknown | (7) Injured, unknown source |

UNOFFICIAL RECORDS

- | | | |
|-----------------------------|--|--|
| (5) Lay coroner report | | |
| (6) E.M.S. personnel | | |
| (7) Interviewee | | |
| (8) Other source (specify): | | |
| (9) Police | | |

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Restrained Passenger

Height: 66 Inches

Weight: 202 Pounds

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interview data are unavailable.)

AUTOPSY

Restrained?

— No
☒ Yes

Blood Alcohol Level (mg/dl)

BAL = 0

Glasgow Coma Scale Score

GCSS =

Units of Blood Given

Units =

Arterial Blood Gases

pH =

PO₂ =PCO₂ =HCO₃ =

Blood in nares
 and mouth

Pattern contusion in
 the shape of a seat
 belt extending from
 the right shoulder
 across the midline
 to the L hip and
 across the
 suprapubic
 area

Blood in R ear

Small linear
 abrasion in
 R groin



- Multiple small lacerations surrounded by a contusion on L thigh
- Extremities are symmetrical and there are no significant deforming blunt force or penetrating injuries.

• Pattern contusion
 of chest and
 abdomen in the
 shape of a
 seatbelt

OFFICIAL INJURY DATA — SKELETAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

Autopsy

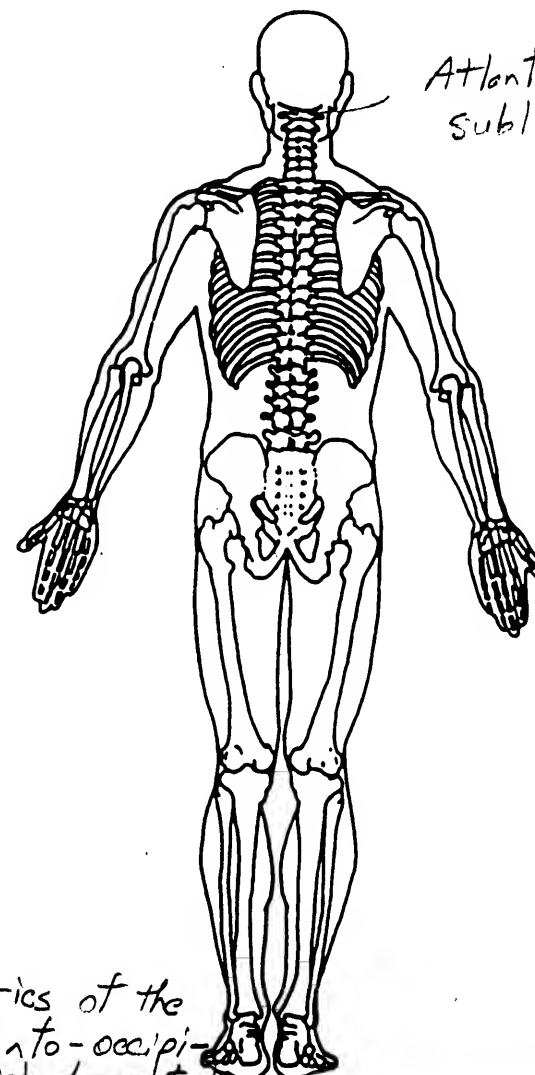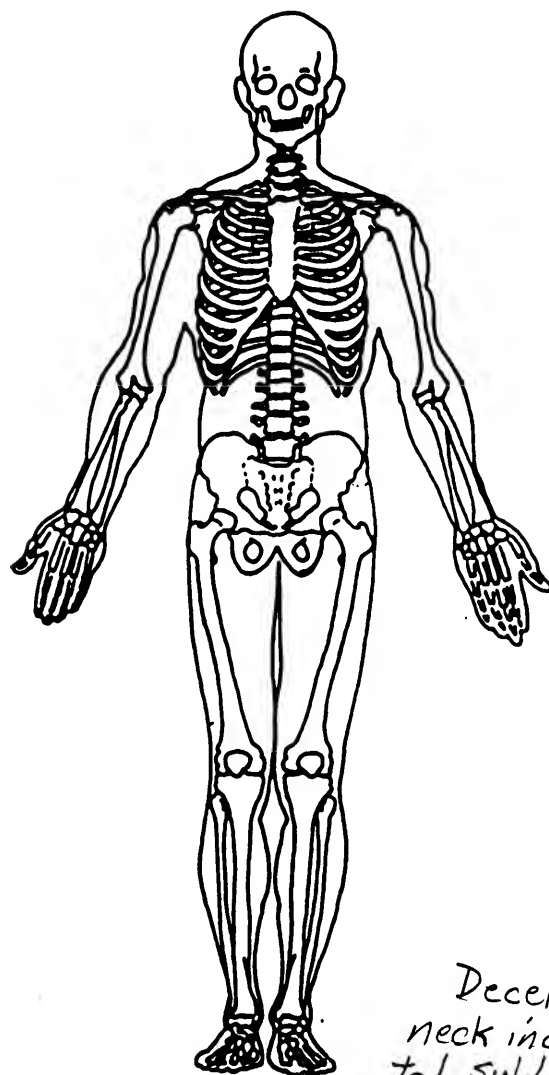

Atlanto-occipital
subluxation

Deceleration injuries of the neck including atlanto-occipital subluxation which lacerated the basilar artery causing the subarachnoid hemorrhage

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify):
- (019) Other front object (specify):

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify):
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify):

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify):
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify):

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify):
- (155) Head restraint system
- (160) Other occupants (specify):
- (161) Interior loose objects
- (162) Child safety seat (specify):
- (163) Other interior object (specify):

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify)
- (195) Other air bag compartment cover (specify)

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify):

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify):
- (409) Additional or relocated switches, (specify):
- (410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify):

EXTERIOR of OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify):
- (454) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify):
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify):
- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify):
- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (551) Ground
- (598) Other vehicle or object (specify):
- (599) Unknown vehicle or object

NONCONTACT INJURY

- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify):
- (604) Air bag exhaust gases
- (697) Injured, unknown source


OFFICIAL INJURY DATA —INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)


AUTOPSY

• Lacerated basilar artery at the level of the medulla caused by the subluxation

• Subarachnoid hemorrhage, 50 cc, resulting from laceration of basilar artery

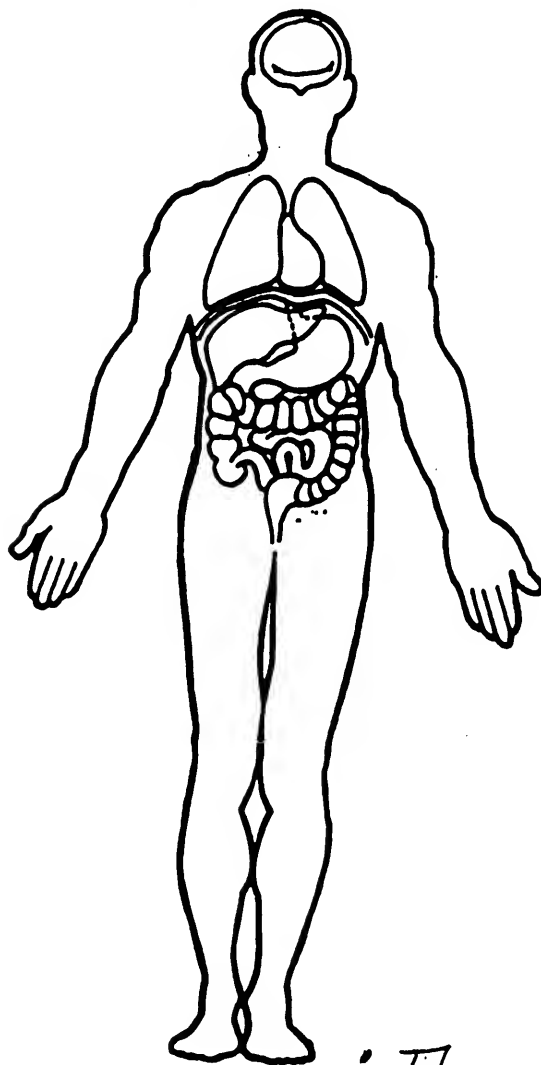

• The spinal cord is not examined

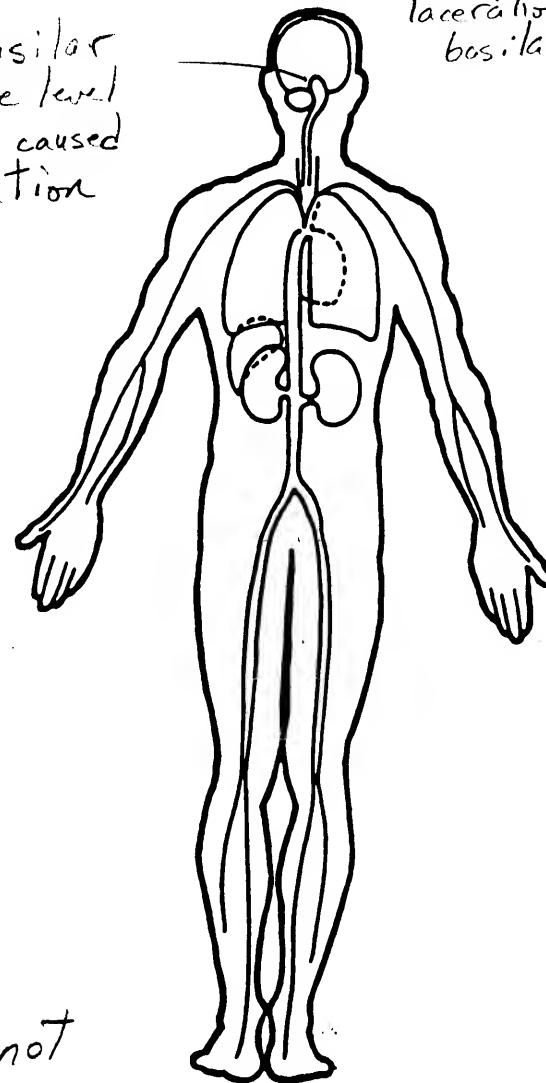

CAUSE OF DEATH

BEST AVAILABLE

Blunt force injury of head and neck

ICD-9-CM

OTHER DRUGS (GV16)

Specimen Test Type	Drug(s)	Drug Type
<input checked="" type="checkbox"/> Blood and urine tests <input checked="" type="checkbox"/> Blood test only <input type="checkbox"/> Urine test only <input type="checkbox"/> Other test <input type="checkbox"/> Unspecified Blood volatile Screen	Negative	

MEDICAL RECORD ABBREVIATIONS

Symbol	Record Type Description
A	Autopsy—medical information based upon an invasive examination of a body
ME	Medical examiner's record—where the information reported on the patient is based on a non-invasive examination of the body
AR	Admission record/summary—any medical information on this record should be considered as post-ER since it summarizes the patient's admission; these records are common in short hospitalizations and usually only contain: admission DX(s), final DX(s), and a listing of surgical treatments; ICD-9-CM codes are frequently available.
FS	Admission/discharge face sheet—face sheets are essentially the same as admission record/summaries and contain the same types of information as discussed above
DS	Discharge summary—shorten history of a patient's hospitalization highlighting the patient's major injuries; this record is often written from the perspective of its author which in many cases is a consultant
OS	Operative record—summary of a performed surgical operation often providing detailed information about a specific trauma; patients who survive the surgery are normally admitted; thus, this record is normally considered post-ER; however, if this record results from an outpatient surgery, then treat it as emergency-room related
FX	Radiographic records—taken after the patient has been admitted, or while in surgery or intensive care
PN	Patient progress notes—supplemental record containing additional nurses notes taken after the patient's admission
HP	History and physical exam—medical history and the results of the physical exam obtained by the emergency room physician assigned to the patient upon arrival at the emergency room
CN	Consultation record—consultations are in essence additional history and physical exams performed by doctors whose expertise was requested by the emergency room physician; the consultation may occur during the emergency room visit or after admission
ER	Emergency room report—where the author of this information is undefined
EN	Emergency room nurse—"nurse/complaint of" section on the emergency room report
ED	Emergency room doctor—"objective/physical exam" section plus "diagnosis and treatment" sections (i.e., doctor portion of emergency room report)
NN	Nurse notes—supplemental record containing additional notes taken by the emergency room nurse(s)
EX	Radiographic records—taken during the patients stay in the emergency room
CV	Coroner's verdict—statement of cause of death for legal specific regarding injuries; care must be exercised to ascertain the credentials of the verdict's author.
CR	Coroner's report—medical information based upon a noninvasive examination performed by a person who is not a doctor but who has the title of a coroner
ET	Emergency medical technician—report by a person who qualifies as an emergency medical services technician (EMS or EMT)
O	Other source—medical information based on an other source (e.g., newspaper, DVM—Doctor of Veterinary Medicine)

Rate	<input type="checkbox"/> Regular <input type="checkbox"/> Weak	Rate	<input type="checkbox"/> Clear <input type="checkbox"/> Wheezes <input type="checkbox"/> Rales	<input type="checkbox"/> Equal <input type="checkbox"/> R > L <input type="checkbox"/> L > R	<input type="checkbox"/> Normal <input type="checkbox"/> Labored <input type="checkbox"/> Assisted	<input type="checkbox"/> Perf <input type="checkbox"/> Non-React <input type="checkbox"/> Dilated	<input type="checkbox"/> Constricted <input type="checkbox"/> Deviated <input type="checkbox"/> Unequal	<input type="checkbox"/> Warm <input type="checkbox"/> Dry <input type="checkbox"/> Moist <input type="checkbox"/> Cool <input type="checkbox"/> Clammy <input type="checkbox"/> Cold <input type="checkbox"/> Pale <input type="checkbox"/> Sweaty <input type="checkbox"/> Assisted <input type="checkbox"/> Cap. Refill <input type="checkbox"/> Sec.
Rate	<input type="checkbox"/> Regular <input type="checkbox"/> Weak	Rate	<input type="checkbox"/> Clear <input type="checkbox"/> Wheezes <input type="checkbox"/> Rales	<input type="checkbox"/> Equal <input type="checkbox"/> R > L <input type="checkbox"/> L > R	<input type="checkbox"/> Normal <input type="checkbox"/> Labored <input type="checkbox"/> Assisted	<input type="checkbox"/> Perf <input type="checkbox"/> Non-React <input type="checkbox"/> Dilated	<input type="checkbox"/> Constricted <input type="checkbox"/> Deviated <input type="checkbox"/> Unequal	
Rate	<input type="checkbox"/> Regular <input type="checkbox"/> Weak	Rate	<input type="checkbox"/> Clear <input type="checkbox"/> Wheezes <input type="checkbox"/> Rales	<input type="checkbox"/> Equal <input type="checkbox"/> R > L <input type="checkbox"/> L > R	<input type="checkbox"/> Normal <input type="checkbox"/> Labored <input type="checkbox"/> Assisted	<input type="checkbox"/> Perf <input type="checkbox"/> Non-React <input type="checkbox"/> Dilated	<input type="checkbox"/> Constricted <input type="checkbox"/> Deviated <input type="checkbox"/> Unequal	

0. THERAPY				MEDICAL HISTORY												
TIME	DOSAGE LPM	ROUTE		Head	Face / eye	Neck	Chest	Back	Abdomen	Upper arm / shoulder	Lower arm / elbow	Hand / wrist	Upper leg / hip	Lower leg / knee	Foot / Ankle	
GLASGOW COMA SCALE	Spontaneous	4	4													
	To verbal command	3	3													
	To pain	2	2													
	No response	1	1													
	Verbal Response															
	Oriented	5	5													
	Confused	4	4													
	Inappropriate words	3	3													
	Incomprehensible sounds	2	2													
	No response	1	1													
Motor Response	Obeys commands	6	6													
	Localized pain	5	5													
	Withdraws	4	4													
	Abnormal flexion	3	3													
	Abnormal extension	2	2													
No response	1	1														
Total Score	15	15														
Time	2152															

TO THE SCENE <input type="checkbox"/> Lights & Siren <input type="checkbox"/> No Lights & Siren		FROM THE SCENE: <input type="checkbox"/> Lights & Siren <input type="checkbox"/> No Lights & Siren		NO TRANSPORT: <input type="checkbox"/> Cancelled <input type="checkbox"/> Refusal		<input type="checkbox"/> No Patient <input type="checkbox"/> Priv. Car <input type="checkbox"/> Amb.		SCENE DEATH: <input type="checkbox"/> No Transport <input type="checkbox"/> Transport		WORK RELATED: <input type="checkbox"/> Yes <input type="checkbox"/> No		SUSPECTED: <input type="checkbox"/> Alcohol <input type="checkbox"/> Drugs			
SAFETY EQUIPMENT <input type="checkbox"/> Lap & Shoulder <input type="checkbox"/> Air Bag <input type="checkbox"/> Shoulder Strap <input type="checkbox"/> Lap Belt				MODE OF INJURY: <input type="checkbox"/> ATV / REC <input type="checkbox"/> Bicycle <input type="checkbox"/> Blunt / Assault <input type="checkbox"/> Drowning <input type="checkbox"/> Electrical				Explosion Fall Gunshot Inhalation Machinery				Motorcycle Motor Vehicle Pedestrian Poison Stab / Cut Thermal/flame			
PLACE OF INCIDENT <input type="checkbox"/> Home <input type="checkbox"/> Street/Highway <input type="checkbox"/> Public Bldg <input type="checkbox"/> Recreational site <input type="checkbox"/> Residential site				PATIENT LOCATION: <input type="checkbox"/> Driver <input type="checkbox"/> Passenger <input type="checkbox"/> Front <input type="checkbox"/> Rear <input type="checkbox"/> Ambulatory <input type="checkbox"/> Ejected				CARE PRIOR TO AMBULANCE ARRIVAL AT SCENE: <input type="checkbox"/> Fire Dept. <input type="checkbox"/> Police <input type="checkbox"/> Other Amb <input type="checkbox"/> Bystander <input type="checkbox"/> Family				CARE PROVIDED <input type="checkbox"/> Immobilization <input type="checkbox"/> CPR <input type="checkbox"/> Defib <input type="checkbox"/> Dressing <input type="checkbox"/> Extrication			
												Incident: Time: _____ Witnessed Arrest <input type="checkbox"/> Yes <input type="checkbox"/> No ALS on Scene Time: _____ ALS EMS # _____			

Narrative should include a complete chronological flow of events, including times, patient condition, each procedure rendered and how each affected the patient's condition, and, if patient is monitored, describe ECG and staple ECG strip to original report.

Called to 10-50 type unknown @ St. R. 1st. Upon our arrival, was in the front passenger seat lying back & head & shoulders between the two seats. Noted that she had a facial pulse, & respirations. pupils dilated and were fixed. She was restrained. This vehicle was involved in a head-on collision & both trucks @ 60 mph pushed heavily into drivers area. Due to mechanism of injury, condition of vehicle that she was entrapped and the extrication equipment was not there yet, plus there was another person in the driver's seat that was conscious, breathing, and also needs extricated. I declared her not alive and had to work & him, since we had a chance upon the arrival of Medics they also declared her unviable. She was covered & a sheet out of respect. She was turned over to the Coroner.

Signature of Paramedic	Chauffeur Name	Technician Name	Technician Name
Person receiving Pt	Medical Control	Cellular	800 meg

Name of Guarantor		Relationship to Patient		Medicare Number		Mileage	
Home Address (street, apartment /RR#, city or town, Zip code)		Employer		Medicaid Number			
		Home Telephone		State		Other Insurance Information	

I request that payment of authorized Medicare benefits be made either to me or on my behalf for any services furnished me by the Columbus Regional Hospital. I authorize any holder of medical or other information about me to release to the Health Care Financing Administration (HCFA) and its agents any information needed to determine these benefits or benefits for related services. I further authorize my treatment and transportation by the Columbus Fire Department Ambulance Service.

SCHOOL OF MEDICINE
DEPARTMENT OF PATHOLOGY
FORENSIC DIVISION

AUTOPSY REPORT

Name: Autopsy No:
Age: 49 years Date: 1996
Sex: Female Time: 8:30 A.M.
Performed by: M.D.
Performed for: County Coroner

ANATOMIC FINDINGS

1. Subarachnoid hemorrhage, 50 cc
2. Atlanto-occipital subluxation
3. Lacerated basilar artery
4. Pattern contusion of chest and abdomen in the shape of a seat belt

TOXICOLOGY

Blood volatiles negative

CAUSE OF DEATH

Blunt force injury of head and neck

MANNER OF DEATH

Accident (Passenger)

Ph.D., M.D.
Forensic Pathologist

Resident Pathologist

Page 2

CIRCUMSTANTIAL SUMMARY

A middle aged white female restrained passenger in a head-on collision. The other driver crossed the center line.

DOCUMENTS AND EVIDENCE EXAMINED

Telephone conversation with _____ of the
County Coroner's Office.

X-RAYS

None

IDENTIFICATION

1996 at 8:30 A.M., a complete post mortem examination was performed on the body of _____ who was identified by a _____ County Coroner's toe tag. Persons present for the autopsy included _____ and _____

CLOTHING AND VALUABLES: Shirt, shorts, bra, panties, and tennis shoes - full of glass. Two diamond earrings, a gold chain with diamond pendant, two gold bracelets, a gold ring, a wedding band and an engagement ring.

EXTERNAL EXAMINATION

The body is that of a moderately obese white female adult. The body length is 66 inches and the body weight is 202 pounds. Scalp hair is brown. Jaundice is not present in the skin or sclerae.

The head is normocephalic. The irides are brown and the sclerae are white. The pupils are round and equal in diameter. There are no contact lenses present and there are no conjunctival petechiae. The nose is unremarkable. There is blood in the

nares and mouth. Lower teeth are present. There is an upper denture. Oral hygiene is good. The two ears are pierced. There is blood in the right ear.

There is no significant increase in the anteroposterior diameter of the chest. The breasts are symmetrical without palpable masses and the nipples appear normal without discharge. The abdomen is not distended. The external genitalia are those of a female adult. The anus is not dilated and has no evidence of injury.

The extremities are symmetrical and there are no significant deforming blunt force or penetrating injuries.

The following scars, nevi and tattoos are present: A 6" midabdominal suprapubic scar.

SIGNS OF DEATH: Rigor mortis is generalized and post mortem lividity is purple and fixed on the posterior surface of the body.

ARTIFACTS: The following artifacts of medical and post mortem care are present: None

The following artifacts of putrefaction are present: None

INJURIES

There is a pattern contusion in the shape of a seat belt extending from the right shoulder across the midline to the left hip and across the suprapubic area. There are multiple small lacerations surrounded by a contusion on the left thigh and a small linear abrasion in the right groin. Deceleration injuries of the neck include an Atlanto-occipital subluxation which lacerated the basilar artery causing the subarachnoid hemorrhage.

INTERNAL EXAMINATION

SEROUS CAVITIES: The body cavities are opened with a standard Y-shaped

incision. The cranial cavity is opened with a coronal incision of the scalp and removal of the calvarium. An odor like alcohol is not apparent in the body cavities. The lungs are well aerated and fill the pleural cavities.

There is no evidence of pneumothorax. There is no blood or effusion in either pleural cavity. The pleural surfaces are smooth and glistening and there are no pleural adhesions. There is no blood or excess fluid in the pericardial sac. There is no evidence of pericarditis. There is no evidence of peritonitis. There is no blood in the peritoneal cavity. There is no ascitic fluid. After removal of the organs from the body, inspection of the serous cavities reveals no evidence of fracture of the ribs, sternum, clavicles, vertebral column or pelvic bones. Contusion hemorrhage is not present in the body walls.

NECK ORGANS: The larynx and trachea are in the midline. The neck dissection is performed following removal of the thoracoabdominal viscera. No significant hemorrhage is present in the skin, fat or sternocleidomastoid muscles of the anterior neck. The strap muscles are free of hemorrhage. The thyroid gland is symmetrical and composed of reddish-brown parenchyma. There is no hemorrhage in the intrinsic muscles of the larynx. The laryngeal cartilages and hyoid bone are not fractured. There is no obstruction of the respiratory tract in the nasopharynx, larynx or trachea. There is gastric content in the larynx. The mucosa of the hypopharynx, larynx and trachea is smooth and glistening without ulceration or tumor. The arytenoideus muscles are free of hemorrhage. Cervical lymph nodes are appropriate for age. No fractures or dislocations of the cervical vertebrae are detected.

THYMUS: The thymus is not identified.

HEART: The 330 gram heart is in usual position with respect to the great vessels and chest cavity. The left ventricle is firm. The left ventricle is not significantly hypertrophied and the cardiac chambers are not dilated. On opening the aorta and pulmonary trunk, there is no evidence of air embolism and there is no evidence of pulmonary thromboembolism. There is no evidence of pericarditis. There are no epicardial petechiae. The circumflex coronary artery arises from the left main coronary. The coronary arteries are examined by multiple cross sections. There is generalized calcified atherosclerotic plaque in the major coronary arteries.

The left main coronary artery is generally less than 25% narrowed by plaque. The left anterior descending coronary artery is generally less than 25% narrowed by plaque. The circumflex coronary artery is generally less than 25% narrowed by plaque. The right coronary artery is generally less than 25% narrowed by plaque.

Thrombosis of a coronary artery is not present. The cardiac valve leaflets are delicate, translucent and membranous. The circumferences of the cardiac valves are within normal limits for age and heart size.

There is no softening or mottling of the myocardium due to recent myocardial infarction or necrosis. There is no myocardial fibrosis. There is no myocardial contusion. There are no defects in the atrial or ventricular septa. The ductus arteriosus is not patent. Autolysis is not significant.

VASCULAR SYSTEM: The aorta and its main branches show mild yellow streak atherosclerosis. There is no evidence of aneurysm, coarctation, dissection or laceration of the aorta. The renal arteries are not stenotic.

LUNGS: Right: 520 grams. Left: 490 grams. There is no atelectasis. The trachea is complete, without malformation, from the larynx to the carina. There is no aspirated gastric material and no aspirated blood in the trachea. The distal bronchi contain scant mucus. The pleural surfaces are smooth and glistening. No petechiae are visible. The lungs and hilar nodes are mildly anthracotic and there is no emphysema. On cut section, there is no aspirated blood apparent in alveoli. Bronchopneumonia is not recognized. There is no focal consolidation and no tumor. There is no significant passive congestion of the lungs. There is no evidence of pulmonary edema. There is no pulmonary contusion. Pulmonary thromboemboli are not present. There is no putrid gas cavitation.

LIVER: The 2160 gram liver has a smooth capsular surface. On cut section, the parenchyma is reddish-brown and has a lobular architecture. The liver is not significantly passively congested. Metastatic tumor is not present. The hepatic duct is patent. The gallbladder is present. There are no gallstones. Autolysis of the liver is not significant.

PANCREAS: The pancreas is appropriate in shape and size with respect to total

body fat stores. On cut surface, it is lobular with interspersed fat without focal calcification, fibrosis, hemorrhage and/or fat necrosis. Autolysis is not significant.

GASTROINTESTINAL SYSTEM: The esophagus is lined with glistening white mucosa. The stomach is coarsely rugated. The stomach contains 250 ml of grey-tan semiliquid food. There is no odor like alcohol in the stomach. There are no erosions or ulcers in the stomach or duodenum. The small bowel and colon are intact without perforation, diverticula or palpable tumors. The vermiform appendix is surgically absent.

SPLEEN: The 120 gram spleen is composed of very soft red and white trabecular pulp. There is no laceration of the splenic capsule. Autolysis is not significant.

ADRENALS: Two adrenals are present with golden brown cortex and white medulla. No cortical nodules are present in either adrenal. Autolysis is not significant.

URINARY TRACT: Right kidney: 150 grams. Left kidney: 150 grams. The two kidneys, ureters and a bladder are present in their usual positions without dilatation. The kidneys are symmetrical in shape and size. The capsules strip from the cortices with ease and the cortical surfaces are smooth. On cut section, the cortex appears of ample thickness and the medulla appears ample. The kidneys are not congested. There are no stones or tumors in the kidneys, pelves, ureters or bladder. The mucosa of the urinary bladder appears glistening. Autolysis of the kidneys is not significant.

REPRODUCTIVE SYSTEM: The uterus, fallopian tubes and ovaries are surgically absent. No tumors are present.

CENTRAL NERVOUS SYSTEM: There is no hemorrhage in the scalp and galea. The dura, removed by stripping from the calvarium and base of the skull, shows no epidural or subdural hemorrhage. The cerebral and cerebellar hemispheres of the 1410 gram brain are symmetrical. The leptomeninges are transparent and can be stripped with ease. There is a 50 cc fresh subarachnoid hemorrhage. There is no

flattening of the gyri and no widening of the sulci. The basilar artery is lacerated at the level of the medulla. The major vessels at the base of the brain have a usual anatomic distribution and there is no significant atherosclerosis. The cranial nerves are symmetrical and intact. There is no evidence of herniation at any of the portals of the brain. On serial coronal sectioning of the brain, there is no internal evidence of contusion, edema, hemorrhage, tumor, atrophy, infection or infarction in the cerebrum, cerebellum and brain stem. There are no fractures of the convexity or base of the skull. There is Atlanto-occipital subluxation. The spinal cord is not examined.

PHOTOGRAPHS: None

SPECIMENS FOR FIREARMS EXAMINATION OR TRACE EVIDENCE: None

SPECIMENS FOR TOXICOLOGY: Blood
Specimens Analyzed: Blood

SPECIMENS FOR CHEMICAL ANALYSIS: None

SPECIMENS FOR CULTURE: None

MICROSCOPIC EXAMINATION: Tissue samples representative of the major organs and injuries have been processed onto glass slides for microscopic examination. These histologic specimens have been examined and there are no additional significant pathologic findings other than those noted on the Anatomic Findings.

UNIVERSITY

FORENSIC TOXICOLOGY REPORT

SCHOOL OF MEDICINE

Demographic Data:

Name:

Case No.:

Submitted by: IU Forensic Pathology

Date submitted:

Specimens:

1 Blood, gray top

96-7762

Chain of Custody: Acceptable

Tests ordered: Blood volatile screen

RESULTS

Blood Volatile Screen

Negative

Results reviewed by:

Date:

ab

**DEPARTMENT OF PATHOLOGY
AND LABORATORY MEDICINE**

**DRUG ANALYSIS LABORATORY
FOR
ATHLETIC DRUG TESTING
AND TOXICOLOGY**